



**REPORT OF**

**PHASE I ENVIRONMENTAL SITE ASSESSMENT**

**U.S. EPA BROWNFIELDS ASSESSMENT PROJECT  
SEMINOLE MILLS SITE  
CLEARWATER, SOUTH CAROLINA**

Prepared for:

**CONCURRENT TECHNOLOGIES CORPORATION**

**1233 WASHINGTON STREET, SUITE 1000  
COLUMBIA, SOUTH CAROLINA**

ON BEHALF OF

**AIKEN COUNTY**

**828 RICHLAND AVENUE WEST  
AIKEN, SOUTH CAROLINA 29801**

Prepared by:

PREPARED BY:

**MACTEC ENGINEERING AND CONSULTING, INC.  
720 GRACERN ROAD, SUITE 132  
COLUMBIA, SOUTH CAROLINA**

**APRIL 11, 2005**

**MACTEC PROJECT 6671-05-0323.01**



April 11, 2005

Mr. David Sykes  
Concurrent Technologies Corporation  
1233 Washington Street, Suite 1000  
Columbia, South Carolina 29201

**Subject: Report of Phase I Environmental Site Assessment  
U.S. EPA Brownfields Assessment Project  
Seminole Mills Site  
Clearwater, South Carolina  
MACTEC Project 6671-05-0323.01**

Dear Mr. Sykes:

MACTEC Engineering and Consulting, Inc. (MACTEC) is pleased to submit this report of our Phase I Environmental Site Assessment for the Seminole Mills Site located along Belvedere Road (S.C. Road 126) in Clearwater, South Carolina. The purpose of our services was to identify recognized environmental conditions and obvious potential recognized environmental conditions.

This report presents project information, which includes survey procedures and limitations, along with our findings, conclusions and recommendations. We appreciate your selection of MACTEC for this project and look forward to assisting you further on this and other projects. If you have any questions, please do not hesitate to contact us.

Sincerely,

**MACTEC ENGINEERING AND CONSULTING, INC.**

A handwritten signature in black ink, appearing to read "M. F. Cooke".

Matthew F. Cooke, P.G.  
Project Geologist

A handwritten signature in black ink, appearing to read "Shaun C. Rankin".

Shaun C. Rankin, CHMM  
Principal Scientist

**TABLE OF CONTENTS**

Page No.

**EXECUTIVE SUMMARY.....v**

**1.0 INTRODUCTION..... 1-1**

1.1 PURPOSE ..... 1-1

1.2 DETAILED SCOPE OF SERVICES ..... 1-2

1.3 SIGNIFICANT ASSUMPTIONS ..... 1-3

1.4 LIMITATIONS AND EXCEPTIONS ..... 1-3

1.5 SPECIAL TERMS AND CONDITIONS ..... 1-3

1.6 USER RELIANCE..... 1-4

**2.0 SITE DESCRIPTION..... 2-1**

2.1 LOCATION AND DESCRIPTION..... 2-1

2.2 SITE AND VICINITY GENERAL CHARACTERISTICS ..... 2-1

2.3 CURRENT USE OF THE PROPERTY ..... 2-1

2.4 DESCRIPTIONS OF STRUCTURES, ROADS, AND OTHER IMPROVEMENTS ..... 2-1

2.5 CURRENT USES OF THE ADJOINING PROPERTIES ..... 2-2

2.5.1 North ..... 2-2

2.5.2 West..... 2-2

2.5.3 South ..... 2-2

2.5.4 East ..... 2-2

**3.0 USER PROVIDED INFORMATION ..... 3-1**

3.1 TITLE RECORDS ..... 3-1

3.2 ENVIRONMENTAL LIENS OR ACTIVITY AND USE LIMITATIONS ..... 3-1

3.3 SPECIALIZED KNOWLEDGE..... 3-1

3.4 VALUATION REDUCTION FOR ENVIRONMENTAL ISSUES ..... 3-1

3.5 OWNER, PROPERTY MANAGER, AND OCCUPANT INFORMATION..... 3-1

3.6 REASON FOR PERFORMING A PHASE I ESA ..... 3-1

3.7 OTHER ..... 3-2

**4.0 RECORDS REVIEW ..... 4-1**

4.1 STANDARD ENVIRONMENTAL RECORD SOURCES ..... 4-1

4.1.1 EPA National Priorities List ..... 4-1

4.1.2 EPA Comprehensive Environmental Response, Compensation, and Liability Information System List ..... 4-1

4.1.3 EPA Resource Conservation & Recovery Information System List..... 4-3

4.1.4 EPA Emergency Response Notification System List ..... 4-4

4.1.5 State Permitted Landfills List ..... 4-4

4.1.6 State Leaking Underground Storage Tank List..... 4-4

4.1.7 State Comprehensive Underground Storage Tank List..... 4-5

4.1.8 State Hazardous Waste Sites List..... 4-5

4.2 ADDITIONAL ENVIRONMENTAL RECORD SOURCES ..... 4-5

4.2.1 Ground Water Contamination Inventory List ..... 4-5

4.2.2 Orphan Site List ..... 4-5

4.2.3 Zip Code Scan Report..... 4-6

4.3 OTHER RECORD SOURCES ..... 4-6

4.4	PHYSICAL SETTING SOURCES .....	4-7
4.5	HISTORICAL USE INFORMATION ON THE PROPERTY.....	4-8
4.5.1	Sanborn Fire Insurance Maps .....	4-9
4.5.2	City Directories.....	4-9
4.5.3	Aerial Photographs.....	4-9
4.5.4	Topographic Maps .....	4-9
4.5.5	Previous Environmental Reports .....	4-9
4.6	HISTORICAL USE INFORMATION ON ADJOINING PROPERTIES.....	4-9
4.6.1	North .....	4-10
4.6.2	South .....	4-10
4.6.3	West .....	4-10
4.6.4	East.....	4-10
<b>5.0</b>	<b>SITE RECONNAISSANCE .....</b>	<b>5-1</b>
5.1	METHODOLOGY AND LIMITING CONDITIONS .....	5-1
5.2	GENERAL SITE SETTING .....	5-1
5.3	EXTERIOR OBSERVATIONS .....	5-2
5.3.1	Pits, Ponds, Lagoons and Surface Waters.....	5-2
5.3.2	Stained Soil or Pavement.....	5-2
5.3.3	Stressed Vegetation.....	5-2
5.3.4	Solid Waste.....	5-2
5.3.5	Wastewater System.....	5-3
5.3.6	Potable Water Supply and Wells .....	5-3
5.3.7	Septic Systems .....	5-3
5.3.8	Electrical Transformers.....	5-3
5.3.9	Storage Tanks.....	5-3
5.3.10	Dry Cleaning.....	5-4
5.3.11	Other Observations .....	5-4
5.4	INTERIOR OBSERVATIONS.....	5-5
5.4.1	Heating and Cooling .....	5-5
5.4.2	Stains or Corrosion .....	5-5
5.4.3	Drains and Sumps .....	5-5
5.4.4	Odors.....	5-5
5.4.5	Hazardous Substance and Petroleum Products, Containers, and Drums.....	5-5
<b>6.0</b>	<b>INTERVIEWS.....</b>	<b>6-1</b>
6.1	INTERVIEW WITH OWNER .....	6-1
6.2	INTERVIEW WITH SITE MANAGER .....	6-1
6.3	INTERVIEW WITH OCCUPANTS .....	6-1
6.4	INTERVIEW WITH LOCAL GOVERNMENT OFFICIALS.....	6-1
6.5	INTERVIEW WITH OTHERS .....	6-2
<b>7.0</b>	<b>FINDINGS.....</b>	<b>7-1</b>
7.1	ON SITE CONCERNS .....	7-1
7.2	OFF SITE CONCERNS .....	7-1
<b>8.0</b>	<b>OPINION.....</b>	<b>8-1</b>
<b>9.0</b>	<b>CONCLUSIONS .....</b>	<b>9-1</b>
<b>10.0</b>	<b>DEVIATIONS .....</b>	<b>10-1</b>
<b>11.0</b>	<b>ADDITIONAL SERVICES.....</b>	<b>11-1</b>

<b>12.0</b>	<b>REFERENCES.....</b>	<b>12-1</b>
<b>13.0</b>	<b>SIGNATURES OF ENVIRONMENTAL PROFESSIONALS.....</b>	<b>13-1</b>
<b>14.0</b>	<b>QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS .....</b>	<b>14-1</b>

**FIGURES**

**APPENDICES**

- APPENDIX A: REGULATORY RECORDS DOCUMENTATION
- APPENDIX B: PHOTOGRAPHS
- APPENDIX C: RESUMES

**EXECUTIVE SUMMARY**

**PROPERTY NAME:** Seminole Mills Site  
**LOCATION:** Clearwater, Aiken County, South Carolina

This executive summary is provided for convenience and should not substitute for review of the complete report, including all attachments. Based on the data collected during the assessment, our findings and conclusions are summarized below:

<b>Environmental Conditions</b>	<b>Acceptable</b>	<b>Further Research</b>	<b>Sampling and Testing</b>
Site Regulatory Status	Yes	No	
Off-Site Listed Facilities	No	Yes	Surface and Ground-water Sampling
Site Use History	No	Yes	Soil and Ground-water Sampling
Present Site Use	No	Yes	Soil and Ground-water Sampling
Surrounding Land Use	Yes	No	

**GENERAL SITE INFORMATION**

The approximate 25-acre Seminole Mills Site is located in the northeast quadrant of the intersection of Belvedere Road (S.C. Road 126) and Augusta Road (S.C. Highway 421) in Clearwater, Aiken County, South Carolina. The northwestern portion of the site is occupied by the remnants of the Seminole Mills buildings, most of which were destroyed by fire in 1996. Although some of the outer walls and rooms remain, the interior consists primarily of large mounds of bricks, concrete, structural steel, and other building materials, including asbestos-containing steam pipe and block insulation. The boiler structure, located on the eastern side of the building remains largely intact. However, we were unable to inspect the interior of the boiler structure due to unsafe conditions. A small maintenance shed containing mostly ceramic fire bricks for the boiler is located immediately to the east of the main building. Other structures on the site include an elevated water tank located to the east of the main building, and two other water tanks located further to the east, across the rear access road. A canal traverses the north central portion of the site, flowing through an intake structure, and then continuing east to join with Little Horse Creek in the northeast corner of the site. The remainder of the site consists of undeveloped woodlands.

**SITE REGULATORY STATUS**

The site was not listed on the regulatory databases reviewed for our assessment. However, a PRECERCLIS Screening and Preliminary Assessment/Inspection indicated recognized environmental conditions in relation to the site and surrounding properties.

**OFF-SITE FACILITIES**

Three facilities were identified on the regulatory lists within the established search radii from the site. However, due to either anticipated ground-water flow direction or regulatory listing information, two of these facilities (Honda Cars of Aiken and Pantry 3247 DBA Depot) are not expected to impact the site. The Clearwater Finishing Site, a former dyeing and finishing plant, is located adjacent to the site on the north. The Clearwater Finishing Site is currently being assessed under a Voluntary Cleanup Contract (VCC No. 98-5210-NRP) with the South Carolina Department of Health and Environmental Control (SCDHEC). MACTEC reviewed files pertaining to this facility at the SCDHEC under the Freedom of Information Act. Ground-water sampling and chemical analysis at this facility indicated the presence of a chromium plume in the ground water which appears to originate from a point beneath the Clearwater Finishing Site building. The plume appears to be migrating toward the canal of Little Horse Creek, where a portion of it may discharge

to surface waters. In addition, sediment sampling conducted in an abandoned surface impoundment on the island between Little Horse Creek and the canal indicated high levels of chromium. Thus, potential recognized environmental conditions exist in relation to the adjacent Clearwater Finishing Site. Particularly, in the area of the canal, Little Horse Creek, and the island between Little Horse Creek and the canal.

#### SITE USE HISTORY

According to the historical references reviewed for this assessment the site or portions of the site has been occupied by previous textile mills since the early 1800s. The original Seminole Mill building was constructed in 1900. However, much of the original structure was destroyed by additions and renovations in the 1940s. Little is known about the operations of the mill prior to the early 1920s. The Seminole Mill and Clearwater Finishing Plant were owned by United Merchants and Manufacturing and operated from the 1920s until 1989. The two facilities operated in tandem, in that the Seminole Mills was a spun rayon fabric manufacturer and Clearwater Finishing Plant was a dyeing and finishing plant. Although no dyeing or finishing was known to have taken place at the Seminole Mills Site, potential recognized environmental conditions exist from past site use, due to the past use of petroleum-based lubricants and chlorinated solvents typically associated with textile mills and the fact that the mill operated long before the establishment of environmental regulations. A rail spur was formerly located in the southwestern portion of the site. Various herbicides were commonly used in the past to control vegetation along railroad tracks. In addition, random dumping and spillage of fuel and lubricants from the rail cars is common in these areas. Therefore, the former presence of the rail spur on the site constitutes a potential recognized environmental condition.

#### PRESENT SITE USE

MACTEC also identified potential recognized environmental conditions due to the present uses of the property. These include the following:

- Presence of asbestos-containing materials throughout the debris in the building area
- Presence of petroleum ASTs and former petroleum ASTs in an area without proper containment.
- Area of dumping containing several 5 and 55-gallon drums.

#### SURROUNDING LAND USE

The site is bordered to the east by Little Horse Creek, followed by undeveloped woodlands; to the west by residential properties and S.C. Road 126; to the south by residential properties, followed by S.C. Highway 421; and to the north by the Clearwater Finishing Site.

#### CONCLUSIONS

This assessment has revealed evidence of recognized environmental conditions associated with the subject property. Further assessment, consisting of soil, sediment, surface, and ground water sampling and chemical analysis is recommended to further assess the identified on and off-site recognized environmental conditions. In addition, asbestos abatement activities should occur before reclamation of the on-site building materials.

## 1.0 INTRODUCTION

Concurrent Technologies Corporation, on behalf of Aiken County, has engaged MACTEC to provide environmental consulting services at the site under a U.S. Environmental Protection Agency Brownfields Assessment Project. MACTEC has completed a Phase I Environmental Site Assessment for the Seminole Mills Site located along Belvedere Road (S.C. Road 126) in Clearwater, South Carolina.

### 1.1 PURPOSE

The purpose of this Phase I ESA is to identify, to the extent feasible pursuant to the processes prescribed herein, recognized environmental conditions in connection with the subject property. According to ASTM E 1527-00, the purpose of the practice is to “define good commercial and customary practice in the United States of America for conducting an environmental site assessment of a parcel of commercial real estate with respect to the range of contaminants within the scope of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) and petroleum products. As such, this practice is intended to permit a user to satisfy one of the requirements to qualify for the innocent landowner defense to CERCLA liability: that is, the practices that constitute ‘all appropriate inquiry into the previous ownership and uses of the property consistent with good commercial or customary practice’ as defined in 42 USC §9601(35)(B).”

ASTM E 1527-00 defines a “recognized environmental condition” as “the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include “*de minimus*” conditions that generally do not present a material risk of harm to public health or the environment and that would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies.”

## **1.2 DETAILED SCOPE OF SERVICES**

The Phase I ESA is a general characterization of environmental concerns based on readily available information and site observations. The assessment was performed in accordance with ASTM E1527-00 "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". The services provided are summarized below.

A qualitative hydrogeologic evaluation of the site and vicinity was performed using both published topographic and geologic maps and area observations to characterize the area drainage.

Selected available documents, maps, and aerial photographs were reviewed and interviews with knowledgeable persons were completed to evaluate present and past land uses.

Selected environmental lists published by state and federal agencies were reviewed to determine if the site or nearby properties are listed as having a present or past environmental problem, are under investigation, or are regulated by state or federal environmental regulatory agencies.

A site and adjacent property reconnaissance was performed to identify obvious indications of present or past activities that have or could have contaminated the site.

MACTEC completed an on-site limited polychlorinated biphenyl (PCB) survey consisting of a visual reconnaissance for fluid-containing major electrical devices (transformers and capacitor banks), excluding fluorescent light ballasts. The PCB status of these devices was determined by the presence or absence of labeling. The general condition of these devices was noted, especially evidence of leakage. The limited PCB survey did not include sampling or testing of dielectric fluids.

This report was prepared to present our findings and conclusions.

Items not within the ASTM-scope, including asbestos, radon, lead in drinking water, wetlands, regulatory compliance, cultural and historic resources, industrial hygiene, health and safety, ecological resources, endangered species, indoor air quality, and high voltage powerlines were not assessed, except as documented in Section 3.7. Our scope of services did not include sampling of soil, water, or air at the site.

### **1.3 SIGNIFICANT ASSUMPTIONS**

This assessment included a review of documents listed in Section 12.0 of this report. MACTEC has assumed these documents are accurate, unless stated otherwise. It is our understanding that the subject property is being considered for redevelopment/rehabilitation by Aiken County.

### **1.4 LIMITATIONS AND EXCEPTIONS**

The findings and opinions presented are relative to the dates of our site work and should not be relied on to represent conditions at substantially later dates. The opinions included herein are based on information obtained during the study and our experience. If additional information becomes available that might impact our environmental conclusions, we request the opportunity to review the information, reassess the potential concerns, and modify our opinions, if warranted. This assessment included a review of documents prepared by others. MACTEC has no responsibility for the accuracy of information contained therein.

No environmental site assessment can wholly eliminate uncertainty regarding the potential for recognized environmental conditions in connection with a property. Performance of the services provided by MACTEC is intended to reduce, but not eliminate, uncertainty regarding the potential for recognized environmental conditions in connection with a property, and the assessment is limited by time and cost. Although this assessment has attempted to identify the potential for environmental impacts to the subject property, potential sources of contamination may have escaped detection due to: (1) the limited scope of this assessment; (2) the inaccuracy of public records; (3) the presence of undetected or unreported environmental incidents; (4) inaccessible areas; and/or (5) deliberate concealment of detrimental information. It was not the purpose of this study to determine the actual presence, degree or extent of contamination, if any, at the site. This would require additional exploratory work, including sampling and laboratory analysis.

### **1.5 SPECIAL TERMS AND CONDITIONS**

This assessment was performed substantially as outlined in MACTEC proposal 04COLM.0179, dated August 26, 2004. Written authorization was received from Ms. Virginia Switzer of Concurrent Technologies Corporation on January 31, 2005.

## **1.6 USER RELIANCE**

Reliance on this document is subject to the mutually agreed upon terms and conditions outlined in MACTEC's proposal 04COLM.0179, dated August 26, 2004.

## **2.0 SITE DESCRIPTION**

### **2.1 LOCATION AND DESCRIPTION**

The approximate 25-acre Seminole Mills Site is located in the northeast quadrant of the intersection of Belvedere Road (S.C. Road 126) and Augusta Road (S.C. Highway 421) in Clearwater, Aiken County, South Carolina (Figure 1). The site is bordered to the east by Little Horse Creek, followed by undeveloped woodlands; to the west by residential properties and S.C. Road 126; to the south by residential properties, followed by S.C. Highway 421; and to the north by the Clearwater Finishing Site.

### **2.2 SITE AND VICINITY GENERAL CHARACTERISTICS**

The subject property is developed with a former industrial structure as well as vacant land. The area in the vicinity of the subject property is generally developed with industrial properties, residential properties, and vacant land.

### **2.3 CURRENT USE OF THE PROPERTY**

The site is developed with the remnants of the Seminole Mills buildings. The remainder of the site consists of undeveloped woodlands.

### **2.4 DESCRIPTIONS OF STRUCTURES, ROADS, AND OTHER IMPROVEMENTS**

The northwestern portion of the site is occupied by the remnants of the Seminole Mills buildings, most of which were destroyed by fire in 1996. Although some of the outer walls and rooms remain, the interior consists primarily of large mounds of bricks, concrete, structural steel, and other building materials, including asbestos-containing steam pipe and block insulation. The boiler structure, located on the eastern side of the building remains largely intact. However, we were unable to inspect the interior of the boiler structure due to unsafe conditions. A small maintenance shed containing mostly ceramic fire bricks for the boiler is located immediately to the east of the main building. Other structures on the site include an elevated water tank located to the east of the main building, and two other water tanks located further to the east, across the rear access road. A canal traverses the north central portion of the site, flowing through an intake structure, and then continuing east to join with Little Horse Creek in the northeast corner of the site. The remainder of the site consists of undeveloped woodlands.

## **2.5 CURRENT USES OF THE ADJOINING PROPERTIES**

Nearby property usage could potentially impact the surface and subsurface conditions of a property. Developing a history of past to present uses or occupancies can provide an indication of the likelihood of recognized environmental conditions. Nearby property usage is presented below according to geographic location with respect to the site: north, west, south, and east.

### **2.5.1 North**

Properties to the north are generally considered to be topographically crossgradient in relation to the site. Immediately north of the site is the Clearwater Finishing Site, a former dyeing a finishing plant.

### **2.5.2 West**

Properties to the west are generally considered to be topographically upgradient in relation to the site. Immediately west of the site are residential properties and S.C. Road 126.

### **2.5.3 South**

Properties to the south are generally considered to be topographically crossgradient in relation to the site. Immediately south of the site are residential properties.

### **2.5.4 East**

Properties to the northwest are generally considered to be topographically downgradient in relation to the site. Immediately east of the site are undeveloped woodlands.

### **3.0 USER PROVIDED INFORMATION**

#### **3.1 TITLE RECORDS**

No title records were provided to MACTEC.

#### **3.2 ENVIRONMENTAL LIENS OR ACTIVITY AND USE LIMITATIONS**

MACTEC was not provided with information regarding environmental liens or activity and land use limitations.

#### **3.3 SPECIALIZED KNOWLEDGE**

MACTEC was not provided with specialized knowledge or experience from the users of this report that is material to recognized environmental conditions in connection with the subject property.

#### **3.4 VALUATION REDUCTION FOR ENVIRONMENTAL ISSUES**

MACTEC was not provided with information indicating that the purchase price of the property is significantly less than the purchase price for comparable properties due to environmental factors.

#### **3.5 OWNER, PROPERTY MANAGER, AND OCCUPANT INFORMATION**

MACTEC was provided with information indicating the property owner, tax map reference, and size (acres) of property.

#### **3.6 REASON FOR PERFORMING A PHASE I ESA**

It is our understanding that the subject property is being considered for redevelopment/rehabilitation by Aiken County.

### **3.7 OTHER**

There was no other information provided by the user pertaining to the site.

## 4.0 RECORDS REVIEW

### STANDARD ENVIRONMENTAL RECORD SOURCES

MACTEC contracted with Environmental Data Resources, Inc. (EDR) to conduct a search for regulatory information in the area of the subject property. This regulatory records search is based on information published by State and Federal regulatory agencies and is used to evaluate if the site or nearby properties are listed as having a past or present record of actual or potential environmental impact. Please note that regulatory listings include only those sites that are known to the regulatory agencies at the time of publication to be 1) contaminated, 2) in the process of evaluation for potential contamination, or 3) regulated. Inclusion of a facility in a government database list does not necessarily indicate that the facility has an environmental problem. A copy of the information provided by EDR is attached in Appendix A. Descriptions of each database are included in the EDR report.

#### 4.1.1 EPA National Priorities List

The Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) established the Environmental Protection Agency (EPA) National Priorities List (NPL) of federal "superfund" sites. These are the contaminated sites that have been assigned a high ranking, in terms of potential public health effects, by the EPA. The following information was found on the NPL, dated December 2004.

The site does not appear on the NPL.

There are no facilities identified on the NPL within a one-mile radius from the site.

#### 4.1.2 EPA Comprehensive Environmental Response, Compensation, and Liability Information System List

The EPA Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS) list identifies documented and suspected contamination sites throughout the nation that were not ranked high enough to be listed on the NPL. On the CERCLIS list, dated December 2004, the following information was found.

- The site does not appear on CERCLIS. However, a Pre-CERCLIS Screening (dated June 23, 2003) and a Preliminary Assessment/Site Inspection (dated July

30, 2004) were conducted by the SCDHEC. MACTEC reviewed these reports under the Freedom of Information Act (FOIA). Soil and sediment sampling and chemical analyses were conducted as part of these assessments. The sediment samples were obtained along the canal, Little Horse Creek, and an abandoned surface impoundment located on an island between Little Horse Creek and the Canal. The abandoned surface impoundment is on the Clearwater Finishing Site's property. The results of the sediment sampling along Little Horse Creek indicate the presence of several metals, polychlorinated biphenyls (PCBs), and polynuclear aromatic hydrocarbons (PAHs) over three times background levels. Chromium was detected at a concentration of 5,000 parts per million in the abandoned surface impoundment sediments. Soil sampling was conducted in an area of dumping located in the wooded area east of the building. Several metals, benzo-a-pyrene, dieldrin, and Aroclor 1254 were detected above Region III RBC screening values in the soils. Arsenic, barium, and vanadium were detected above industrial screening values. SCDHEC recommended the Seminole Mills Site as a low priority for an Expanded Site Investigation (ESI) under the Federal Superfund Program. The SCDHEC also recommended that due to the close connection (sharing of resources, complexity of surface water pathway) between Seminole Mills and Clearwater Finishing that the two facilities be cooperatively assessed.

- One facility was identified on CERCLIS within a one-half mile radius from the site. The Clearwater Finishing Site, a former dyeing and finishing plant, is located adjacent to the site on the north. The Clearwater Finishing Site is currently being assessed under a Voluntary Cleanup Contract (VCC No. 98-5210-NRP) with the SCDHEC. MACTEC reviewed files pertaining to this facility at the SCDHEC under the Freedom of Information Act. Recent assessment activities consisted of an investigation of chromium and copper in the soil, sediment, surface water, and ground water at the site. This report was prepared by Dunaway Fletcher and Moore, Inc. and was submitted to the SCDHEC for review and comment on December 3, 2004. Due to ongoing review of this document by the SCDHEC, MACTEC was unable to obtain a copy of this report for our review. However, MACTEC contacted the author, Mr. Brad Hubbard, of Dunaway Fletcher and Moore, Inc. who provided a brief synopsis of the findings of the investigation. Mr. Hubbard stated that ground-water sampling and chemical analysis at this facility

indicated the presence of a chromium plume in the ground water which appears to originate from a point beneath the plant building. The plume appears to be migrating toward the canal of Little Horse Creek, where a portion of it may discharge to surface waters. Future assessment activities at this facility may consist of further characterization of the chromium in ground water, and remediation of the wastewater lagoons on the site.

#### 4.1.3 EPA Resource Conservation & Recovery Information System List

RCRIS is the EPA database of facilities that generate, transport, treat, store, or dispose of hazardous wastes. Generators and transporters are found on the RCRIS list of Notifiers. Treatment, Storage, and Disposal facilities are found on the RCRIS TSD list, and TSD facilities requiring corrective actions are found on the CORRACTS list. The following information was found on the RCRIS list of Notifiers, dated November 2004.

- The site does not appear on the RCRIS Notifiers (generators/transporters) list.
- There were no facilities identified on the RCRIS Notifiers list adjacent to the site.

The following information was found on the TSD list, dated November 2004.

- The site does not appear on the RCRIS TSD list.
- There are no facilities identified on the RCRIS TSD list within a one-half mile radius from the site.

The following information was found on the TSD CORRACTS list, dated December 2004.

- The site does not appear on the CORRACTS list.
- There are no facilities identified on the CORRACTS list within a one-mile radius from the site.

#### 4.1.4 EPA Emergency Response Notification System List

The EPA Emergency Response Notification System (ERNS) list is a list of hazardous material and petroleum spills reported to various State agencies. The following information was found on the ERNS list, dated December 2003.

- The site does not appear on the ERNS list.

#### 4.1.5 State Permitted Landfills List

Lists of active and inactive landfills, artificial fills, and disposal sites are maintained by the SCDHEC. The landfill listing includes known unpermitted landfills or dumps. The following information was found on the Landfill list, dated August 2004.

- The site does not appear on the Permitted Landfills list.
- There were no properties identified on the landfill list within a one-half mile radius from the site.

#### 4.1.6 State Leaking Underground Storage Tank List

The State Leaking Underground Storage Tank (LUST) list is a listing of UST systems within the state of South Carolina which have reported releases of UST contents. This list is maintained by the SCDHEC. The following information was found on the LUST list, dated December 2004.

- The site does not appear on the LUST list.
- Two facilities were identified on the LUST list within a one-half mile radius from the site and are tabulated below as follows.

Honda Cars of Aiken. (3720 Augusta Road) is located approximately 1000 feet to the east, downgradient in relation to the site. This facility was issued a “No Further Action” letter by the SCDHEC, dated July 19, 1995.

Pantry 3247 DBA Depot (3533 Augusta Road) is located approximately 700 feet to the east, downgradient in relation to the site. This facility was issued a “No Further Action” letter from the SCDHEC, dated May 8, 1998.

#### **4.1.7 State Comprehensive Underground Storage Tank List**

The State Registered Underground Storage Tank (UST) list is a listing of petroleum storage tank systems which are registered with the SCDHEC. The following information was found on the UST list, dated December 2004.

- The site does not appear on the UST list.
- There were no facilities identified on the UST list adjacent to the site.

#### **4.1.8 State Hazardous Waste Sites List**

The State Hazardous Waste Sites (SHWS) list is maintained by the SCDHEC. On the State Hazardous Waste Sites (SHWS) list, dated October 2004, the following information was found:

- The site does not appear on the SHWS list.
- There were no facilities identified on the State Hazardous Waste Sites (SHWS) list within a one-mile radius from the site.

### **4.2 ADDITIONAL ENVIRONMENTAL RECORD SOURCES**

#### **4.2.1 Ground Water Contamination Inventory List**

The SCDHEC maintains a Ground-Water Contamination Inventory (GWCI) list. On the GWCI list, dated July 2004, the following information was found:

- The site does not appear on the GWCI list.
- One facility was identified on the GWCI list within a one-half mile radius from the site. Clearwater Finishing Site (S.C. Road 126 at U.S. Highway 1/78) is located adjacent to the site on the north. This facility is considered to be crossgradient in relation to the site. Please see Section 3.2 for further information on this facility.

#### **4.2.2 Orphan Site List**

The Orphan Site list consists of facilities with poor address quality, usually without zip code information. However, if street addresses are available, these facility locations are checked against the known vicinity of the subject property to evaluate their potential for being located within the

select ASTM search radii. Based on this information, we did not identify orphan sites within ASTM-specified radii of the site during our site reconnaissance.

#### **4.2.3 Zip Code Scan Report**

The Zip Code Scan Report list consists of sites located in the same zip code as the site with poor address quality or that have not been assigned a latitude/longitude coordinate. However, if street addresses are available, or the facility name is recognizable, these locations are checked against the known vicinity of the subject property to evaluate their potential for being located within the select ASTM-specified search radii. Based on this information, there were no facilities identified on the zip code scan report within the established search radii from the site with the exception of those listed in the previous sections.

### **4.3 OTHER RECORD SOURCES**

There were no other regulatory lists reviewed for this assessment.

#### 4.4 PHYSICAL SETTING SOURCES

MACTEC reviewed the current United States Geological Survey (USGS) 7.5-minute series topographic maps, Augusta East and North Augusta, South Carolina and Georgia Quadrangles (Figure 2), and additional sources listed in Section 12.0 of this report. This purpose of the review was to evaluate the sensitivity of the hydrogeology to potential contamination from sources either on or near the site. It was not the purpose of this study to evaluate the geotechnical conditions of the site or to assess engineering geology concerns such as foundation conditions, faulting, or subsidence. No geotechnical reports were available for review.

According to the United States Geological Survey Topographic Maps (USGS) Augusta East and North Augusta, South Carolina and Georgia Quadrangles, the average elevation of the site is approximately 150 feet above mean sea level (refer to Figure 2). Existing surface drainage appears to follow the natural slope of the site. Surface drainage on the site is generally to the east/northeast towards Little Horse Creek.

The site is situated in the Atlantic Coastal Plain Physiographic Province. The Atlantic Coastal Plain Physiographic Province generally extends seaward from the Fall Line, where it lies in contact with the Piedmont Physiographic Province, to the Atlantic Ocean. Sands, silts, and clays of recent geologic age immediately underlie the site. Surface soils are underlain at depth by much older marine sediments.

According to the Soil Survey of Aiken County, the soils beneath the site are mapped as Ailey sand (well drained, gently sloping soils found adjacent to major drainageways in the Coastal Plain). The depth to seasonal high water table for these soils is reported to be greater than six feet below ground surface (bgs).

In the Atlantic Coastal Plain Physiographic Province, ground water in the shallow aquifer generally occurs under water table conditions and is stored in the overlying mantle of alluvial and fluvial soils. Recharge to the water table is primarily by precipitation infiltrating the upper soils and percolating downward, under the influence of gravity, to the ground-water table. Typically, the water table is not a level surface, but a subdued reflection of the land surface. Also, the depth to the water table is variable, being dependent on many factors that include: the amount of rainfall, the permeability of the in place soils, tidal fluctuations, and the amount of the ground water being

pumped in the area. Based on a review of topographic maps and ground water elevations measured in monitoring wells on the adjacent Clearwater Finishing Site, a shallow ground-water flow direction primarily to the east/northeast is anticipated for the site. We anticipate depths to ground water on the site to be in the range of about 12 to 25 feet bgs, based on ground water level data from the adjacent Clearwater Finishing Site.

#### **4.5 HISTORICAL USE INFORMATION ON THE PROPERTY**

MACTEC performed a site and vicinity reconnaissance, conducted interviews and reviewed selected historical information in order to evaluate the current and historical uses of the site and surrounding properties and to evaluate past or present activities of potential environmental conditions. The ASTM E 1527-00 standard lists the mandatory physical setting sources and specifies that the historical review should be conducted using as many sources as are practically reviewable from the initial development of the subject property or back to 1940, whichever is earlier. To comply with the ASTM standard, a reasonable attempt was made to obtain historical data from as many physical setting sources and to review historical records as far in the past as practical. The reference materials listed below and in Section 12.0 are the physical setting and historical sources that were publicly available, obtainable within reasonable time and cost restraints, and practically reviewable as defined in the ASTM standard.

According to the historical references listed below that were reviewed for this assessment the site or portions of the site has been occupied by previous textile mills since the early 1800s. The original Seminole Mill building was constructed in 1900. However, much of the original structure was destroyed by additions and renovations in the 1940s. Little is known about the operations of the mill prior to the early 1920s. The Seminole Mill and Clearwater Finishing Plant were owned by United Merchants and Manufacturing and operated from the 1920s until 1989. The two facilities operated in tandem, in that the Seminole Mills was a spun rayon fabric manufacturer and Clearwater Finishing Plant was a dyeing and finishing plant. Although no dyeing or finishing was known to have taken place at the Seminole Mills Site, potential recognized environmental conditions exist from past site use, due to the past use of petroleum-based lubricants and chlorinated solvents typically associated with textile mills and the fact that the mill operated long before the establishment of environmental regulations. A rail spur was formerly located in the southwestern portion of the site.

#### **4.5.1 Sanborn Fire Insurance Maps**

Sanborn fire insurance maps were not available for the site.

#### **4.5.2 City Directories**

City Directories were not available for the site.

#### **4.5.3 Aerial Photographs**

Aerial Photographs dated 1938, 1943, 1951, 1955, 1959, and 1966, 1971, and 1979, were reviewed at the Thomas Cooper Library, University of South Carolina, Columbia, South Carolina. An aerial photograph, dated 1994 was also obtained from the website [www.terraserver.com](http://www.terraserver.com). In addition, an aerial photograph, dated 1981 from the Soil Survey of Aiken County, South Carolina was obtained and reviewed.

#### **4.5.4 Topographic Maps**

MACTEC reviewed the United States Geological Survey (USGS) Topographic Map, 7.5-minute series, Augusta East Quadrangle, South Carolina and Georgia, dated 1965, Photorevised 1981, published by the USGS (Figure 2) as well as the North Augusta Quadrangle, South Carolina and Georgia, dated 1964, Photorevised 1980, published by the USGS (Figure 2).

#### **4.5.5 Previous Environmental Reports**

MACTEC reviewed a Pre-CERCLIS Screening Report, prepared by the South Carolina Department of Health and Environmental Control (SCDHEC), dated June 23, 2003. MACTEC also reviewed a Preliminary Assessment/Site Inspection, prepared by the SCDEHC, dated July 30, 2004. Please see Section 4.1.2 for further information concerning these reports.

### **4.6 HISTORICAL USE INFORMATION ON ADJOINING PROPERTIES**

Nearby property usage could potentially impact the surface and subsurface conditions of the subject property. Developing a history of past uses or occupancies can provide an indication of the likelihood of environmental concern to the subject property. Below is a summary of the past surrounding land use based on the historical documents reviewed. There were no past adjoining property uses identified that MACTEC considers to be historic recognized environmental conditions to the site.

#### **4.6.1 North**

A review of historical references indicates the area to the north of the site has been occupied by the Clearwater Finishing plant from at least the 1920s until the present. The plant ceased operations in 1990 after filing for bankruptcy. As previously mentioned, this facility is listed on the CERCLIS list and is currently undergoing assessment under a Voluntary Cleanup Contract with the SCDHEC.

#### **4.6.2 South**

A review of aerial photographs indicated the area to the south of the site has consisted of residential properties from at least 1938 until the present.

#### **4.6.3 West**

A review of aerial photographs indicates that the area to the west of the site has consisted of residential properties and S.C. Road 126 from at least 1938 until the present.

#### **4.6.4 East**

A review of aerial photographs indicated that the area to the east of the site has consisted of undeveloped woodlands from at least 1938 until the present.

## 5.0 SITE RECONNAISSANCE

### 5.1 METHODOLOGY AND LIMITING CONDITIONS

Mr. Matthew F. Cooke, P.G., and Mr. Shaun C. Rankin, CHMM environmental professionals with MACTEC experienced in environmental site assessments, conducted site and area visits on February 16, 2005. The site reconnaissance was performed on foot and the area reconnaissance was a driving tour, on public access routes. The objective of the site reconnaissance was to obtain information indicating the likelihood of identifying recognized environmental conditions in connection with the subject property. Mr. David Sykes of Concurrent Technologies Corporation provided MACTEC access to the site.

### 5.2 GENERAL SITE SETTING

The approximate 25-acre Seminole Mills Site is located in the northeast quadrant of the intersection of Belvedere Road (S.C. Road 126) and Augusta Road (S.C. Highway 421) in Clearwater, Aiken County, South Carolina (Figure 1). The northwestern portion of the site is occupied by the remnants of the Seminole Mills buildings, most of which were destroyed by fire in 1996. Although some of the outer walls and rooms remain, the interior consists primarily of large mounds of bricks, concrete, structural steel, and other building materials, including asbestos-containing steam pipe and block insulation (Photograph 1). The boiler structure, location on the eastern side of the building remains largely intact. However, we were unable to inspect the interior of the boiler structure due to unsafe conditions. A small maintenance shed containing mostly ceramic fire bricks for the boiler is located immediately to the east of the main building (Photograph 2). Other structures on the site include an elevated water tank located to the east of the main building, and two other water tanks located further to the east, across the rear access road (Photograph 3). A canal traverses the north central portion of the site, flowing through an intake structure, and then continuing east to join with Little Horse Creek in the northeast corner of the site. The remainder of the site consists of undeveloped woodlands.

MACTEC reviewed regulatory files pertaining to the site at the SCDHEC under the Freedom of Information Act and had verbal correspondence with representatives of the SCDHEC. Our research did not reveal evidence of (1) any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in or on or from the subject property, (2) any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products

in or on or from the subject property, (3) any notices from any governmental entity regarding any possible violations of environmental laws or possible liability relating to hazardous substances or petroleum products. However, a Pre-CERCLIS Screening and a Preliminary Assessment/Inspection were conducted by the SCDHEC in 2003 and 2004. As a result of the findings of these investigations, the site was recommended as a low priority for an ESI under the Federal Superfund Program. In addition, a Notice of Violation and an Administrative Order were recently issued to the owner, Mr. Charles Merritt, regarding the presence of friable asbestos containing materials on the site.

### **5.3 EXTERIOR OBSERVATIONS**

The following conditions were specifically assessed for their potential to create recognized environmental conditions. Pertinent photographs of the subject property are provided in Appendix B.

#### **5.3.1 Pits, Ponds, Lagoons and Surface Waters**

There were no pits, ponds or lagoons observed on the site. As previously mentioned, a canal traverses the northern portion of the site and eventually connects with Little Horse Creek in the northeast corner of the site. No sheen indicative of petroleum products was observed on the surface of the canal or Little Horse Creek.

#### **5.3.2 Stained Soil or Pavement**

No areas of significant soil and concrete pavement staining were observed at the site.

#### **5.3.3 Stressed Vegetation**

No stressed vegetation was observed on the subject property.

#### **5.3.4 Solid Waste**

As previously mentioned, large amounts of debris remain in the interior of the building from the 1996 fire. The debris consists primarily of large mounds of bricks, concrete, structural steel, and other building materials, including asbestos-containing steam pipe and block insulation. An area of dumping was observed in the wooded area east of the main building near Little Horse Creek. The

debris in this area appeared to consist primarily of mounds of ash and several rusted 55 and 5-gallon drums (Photograph 6).

### **5.3.5 Wastewater System**

Wastewater systems were not observed at the subject property. A public sanitary sewer line easement traverses the wooded area to the east of the site. The building is presumably connected to this system.

### **5.3.6 Potable Water Supply and Wells**

Potable water service was presumably provided to the site by the local utility provider. There were no drinking water wells observed on the site.

### **5.3.7 Septic Systems**

MACTEC did not observe any septic systems during our site reconnaissance. However, due to the age of the mill, it is likely that septic tanks were present on the site at some time in the past. If a septic system is encountered during site exploration or construction, MACTEC recommends the system(s) be closed in accordance with applicable regulations.

### **5.3.8 Electrical Transformers**

Electrical transformers are a source of recognized environmental condition due to the potential presence of polychlorinated biphenyls (PCB) contained in dielectric fluids used in some units. Several electrical transformers were observed in a fenced area on a concrete pad near the water intake structure on the canal. In addition, a pole-mounted transformer was observed near the rear loading dock. MACTEC was unable to determine the PCB containing status of these transformers. However, no stained soil or other evidence of leakage was observed around the transformers.

### **5.3.9 Storage Tanks**

No visible indications of existing underground storage tanks (USTs) were observed at the site. MACTEC observed a large aboveground storage tank (AST) in the eastern portion of the site near the maintenance shed (Photograph 4). The AST was located in a concrete-walled containment area. The floor of the containment area consisted of gravel. Two other cradles that formerly held ASTs were also present in the containment area. These ASTs were likely used for the bulk storage

of fuel oil for the on-site boiler. A smaller, approximate 250-gallon AST was observed near the canal intake structure (Photograph 5). The 250-gallon AST was located in a concrete floored and walled containment area. This AST was likely used for the storage of fuel for the water pump observed in the pump-house. Additionally, two large ASTs reportedly used as supply and return water for the former boiler house at the site were observed east of the main building across the rear access road.

#### **5.3.10 Dry Cleaning**

Dry cleaning operations are frequently sources of recognized environmental conditions due to the chlorinated solvents used in the cleaning process. No dry cleaning operations were observed on or adjacent to the site.

#### **5.3.11 Other Observations**

Steam pipe insulation, block insulation and roofing materials were observed scattered about the building area (Photograph 7). An asbestos survey conducted by Davis and Floyd, Inc. in 1996 identified the insulation and roofing materials around the boiler house to be asbestos-containing materials (ACM). Much of the ACM appeared to be damaged and friable. In 1996, the SCDHEC Bureau of Air Quality Control reviewed the data gathered by Davis and Floyd, Inc., and required that asbestos abatement activities be performed prior to the reclamation of any of the building materials on site. A hydraulically-operated air compressor was observed in a room near the rear loading dock. There was no other hydraulically-operated equipment observed on the site.

## **5.4 INTERIOR OBSERVATIONS**

The following conditions were specifically assessed for their potential to create recognized environmental conditions. As previously mentioned, much of the former structure on the site was destroyed by fire in 1996. MACTEC entered the interior of the burned and collapsed building, a detached maintenance shed, and the canal intake structure building. Many interior areas of the buildings were inaccessible due to unsafe conditions.

### **5.4.1 Heating and Cooling**

There were no heating or cooling units observed at the site.

### **5.4.2 Stains or Corrosion**

Much of the floor of the former building was covered with mounds of debris at the time of our site visit, and thus was not visible. In the areas that were visible, there was no stains or corrosion observed on the surface of the floors.

### **5.4.3 Drains and Sumps**

There were no drains or sumps observed on the site.

### **5.4.4 Odors**

No obvious strong, pungent, or noxious odors were noted during the site reconnaissance, with the exception of a slight petroleum odor noted near the large bulk storage AST in the eastern portion of the site (Refer to Section 4.1.1).

### **5.4.5 Hazardous Substance and Petroleum Products, Containers, and Drums**

No hazardous or petroleum products or drums were observed at the site, with the exception of the previously mentioned ASTs and the following: Several buckets of hydraulic oil and a 55-gallon waste oil drum were observed in a room containing a large air compressor near the rear loading dock area.

## **6.0 INTERVIEWS**

### **6.1 INTERVIEW WITH OWNER**

The current owner of the site, Mr. Charles Merritt, was not available for interview.

### **6.2 INTERVIEW WITH SITE MANAGER**

The facility is currently vacant, therefore a site manager was not available for interview. However, on April 1, 2005, MACTEC interviewed Mr. Denton Johnson, a former employee of Seminole Mills. Mr. Johnson stated that he worked as an industrial engineer at the mill from 1966 until 1974. Mr. Johnson indicated that the mill produced spun-rayon fabric during his tenure, which was then transported to the adjacent Clearwater Finishing Site for dyeing and finishing. Mr. Johnson indicated that to the best of his knowledge that hazardous substances were not utilized at the Seminole Mills site, with the exception of fuel oil for the on-site boiler and minor amounts of various lubricants and solvents associated with the machines in the mill.

### **6.3 INTERVIEW WITH OCCUPANTS**

There are currently no occupants at the site. Therefore, no occupants were interviewed for this assessment.

### **6.4 INTERVIEW WITH LOCAL GOVERNMENT OFFICIALS**

MACTEC contacted the SCDHEC and reviewed documents under the Freedom of Information Act regarding environmental incidents at the site or in the immediate surrounding area. As previously mentioned, the mill building was destroyed by fire in 1996. Since then, there have been no emergency responses to incidents of environmental significance at the site. The EPA's Emergency Response and Removal Branch conducted an emergency removal at the Clearwater Finishing Plant site on August 11, 1995. The following materials were removed from the site: 2,694 drums, 10,500 gallons of caustic liquid, 12,600 gallons of base-neutral liquid, 7,500 gallons of acid/neutral liquid, 35 drums of oxides and peroxides, 3,500 gallons of acidic liquid, 240 tons of organic/inorganic solids, 80 tons of inorganic solids, 12,450 gallons of liquid flammables, and 83 containers of lab chemicals.

## **6.5 INTERVIEW WITH OTHERS**

No other persons were interviewed by MACTEC during the performance of this assessment.

## 7.0 FINDINGS

Based on the findings of our Phase I Environmental Site Assessment at the subject property, we offer the following comments relative to recognized environmental conditions.

### 7.1 ON SITE CONCERNS

The site was not listed on the regulatory databases reviewed for our assessment. However, a Pre-CERCLIS Screening and Preliminary Assessment/Inspection indicated recognized environmental conditions in relation to the site and surrounding properties. Potential recognized environmental conditions also exist due to the past use of the site as a textile mill during a time period with no established environmental regulations. MACTEC also identified potential recognized environmental conditions due to the present uses of the property. These include the following:

- Presence of friable asbestos-containing materials throughout the debris in the building area.
- Presence of petroleum ASTs and former petroleum ASTs in an area without proper containment.
- Area of dumping containing several 5 and 55-gallon drums.
- Past use of petroleum-based lubricants and chlorinated solvents, typically associated with machinery in textile mills.
- Former presence of a rail spur on the site.

### 7.2 OFF SITE CONCERNS

Three facilities were identified on the regulatory lists within the established search radii from the site. However, due to either anticipated ground-water flow direction or regulatory listing information, two of these facilities (Honda Cars of Aiken and Pantry 3247 DBA Depot) are not expected to impact the site. The Clearwater Finishing Site, a former dyeing and finishing plant, is located adjacent to the site on the north. The Clearwater Finishing Site is currently being assessed under a Voluntary Cleanup Contract (VCC No. 98-5210-NRP) with the SCDHEC. MACTEC reviewed files pertaining to this facility at the SCDHEC under the Freedom of Information Act. Ground-water sampling and chemical analysis at this facility indicated the presence of a chromium plume in the ground water which appears to originate from a point beneath the Clearwater Finishing Site building. The plume appears to be migrating toward the canal of Little Horse Creek,

where a portion of it may discharge to surface waters. In addition, sediment sampling conducted in an abandoned surface impoundment on the island between Little Horse Creek and the canal indicated high levels of chromium. Thus, potential recognized environmental conditions exist in relation to the adjacent Clearwater Finishing Site. Particularly, in the area of the canal, Little Horse Creek, and the island between Little Horse Creek and the canal.

## **8.0 OPINION**

Based on the information obtained during this assessment, it is MACTEC's opinion that recognized environmental conditions have been identified at the site.

## 9.0 CONCLUSIONS

We have performed a Phase I Environmental Site Assessment in general accordance with the scope and limitations of ASTM 1527-00 of the Seminole Mills Site located along Belvedere Road (S.C. Road 126) in Clearwater, South Carolina. Any exceptions to or deletions from this practice are described in the appropriate sections of this report. The property reconnaissance was performed on February 16, 2005.

This assessment has revealed evidence of recognized environmental conditions associated with the subject property. Further assessment, consisting of soil, sediment, surface, and ground water sampling and chemical analysis is recommended to further assess the identified on and off-site recognized environmental conditions. In addition, asbestos abatement activities should occur before reclamation of the on-site building materials.

## **10.0 DEVIATIONS**

No significant deletions or deviations were made to the scope required by ASTM 1527-00 except as identified below.

An interview with the owner of the site was not reasonably obtainable.

## **11.0 ADDITIONAL SERVICES**

No additional services were provided for this assessment.

## 12.0 REFERENCES

Geologic Map of South Carolina Coastal Plain, dated 1983, University of South Carolina, Department of Geology.

United States Geological Survey (USGS) Topographic Map, 7.5-minute series, Augusta East Quadrangle, South Carolina and Georgia, dated 1965, Photorevised 1981, published by the USGS (Figure 2).

United States Geological Survey (USGS) Topographic Map, 7.5-minute series, North Augusta Quadrangle, South Carolina and Georgia, dated 1964, Photorevised 1980, published by the USGS (Figure 2).

Soil Survey of Aiken County, dated September 1985, published by USDA Soil Conservation Service.

Site Characterization Report, Clearwater Finishing Plant, prepared by Earth Management Systems, dated November 1999.

Aerial Photographs dated 1938, 1943, 1951, 1955, 1959, and 1966, 1971, and 1979, reviewed at the Thomas Cooper Library, University of South Carolina, Columbia, South Carolina.

Aerial Photograph, dated 1994, obtained from [www.terraserver.com](http://www.terraserver.com).

Interview and with Mr. Denton Johnson, a former employee of Seminole Mills during the 1960s and early 1970s, on April 1, 2005.

Pre-CERCLIS Screening, prepared by the South Carolina Department of Health and Environmental Control, dated June 23, 2003.

Preliminary Assessment/Site Inspection, prepared by the South Carolina Department of Health and Environmental Control, dated July 30, 2004.

Cultural Resource Literature Review for the Seminole Mills Site in Aiken County, South Carolina, prepared by TRC, dated February 23, 2005.


Limited Asbestos Survey Results, prepared by Davis and Floyd, Inc., dated September 5, 1996.

Verbal correspondence with Mr. David Sykes of CTC regarding his conversations with Mr. Tim Kadar of the South Carolina Department of Health and Environmental Control during the months of January and February 2005.

### 13.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

We appreciate your selection of MACTEC for this project and look forward to assisting you further on this and other projects. If you have any questions, please do not hesitate to contact us.

MACTEC ENGINEERING AND CONSULTING, INC.

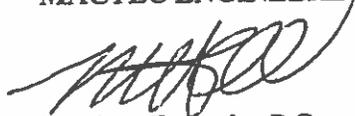

Matthew F. Cooke, P.G.  
Project Geologist




Shaun C. Rankin, CHMM  
Principal Scientist


## **14.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS**

Appendix D includes resumes of the environmental professionals responsible for the Phase I Environmental Site Assessment.

**FIGURES**

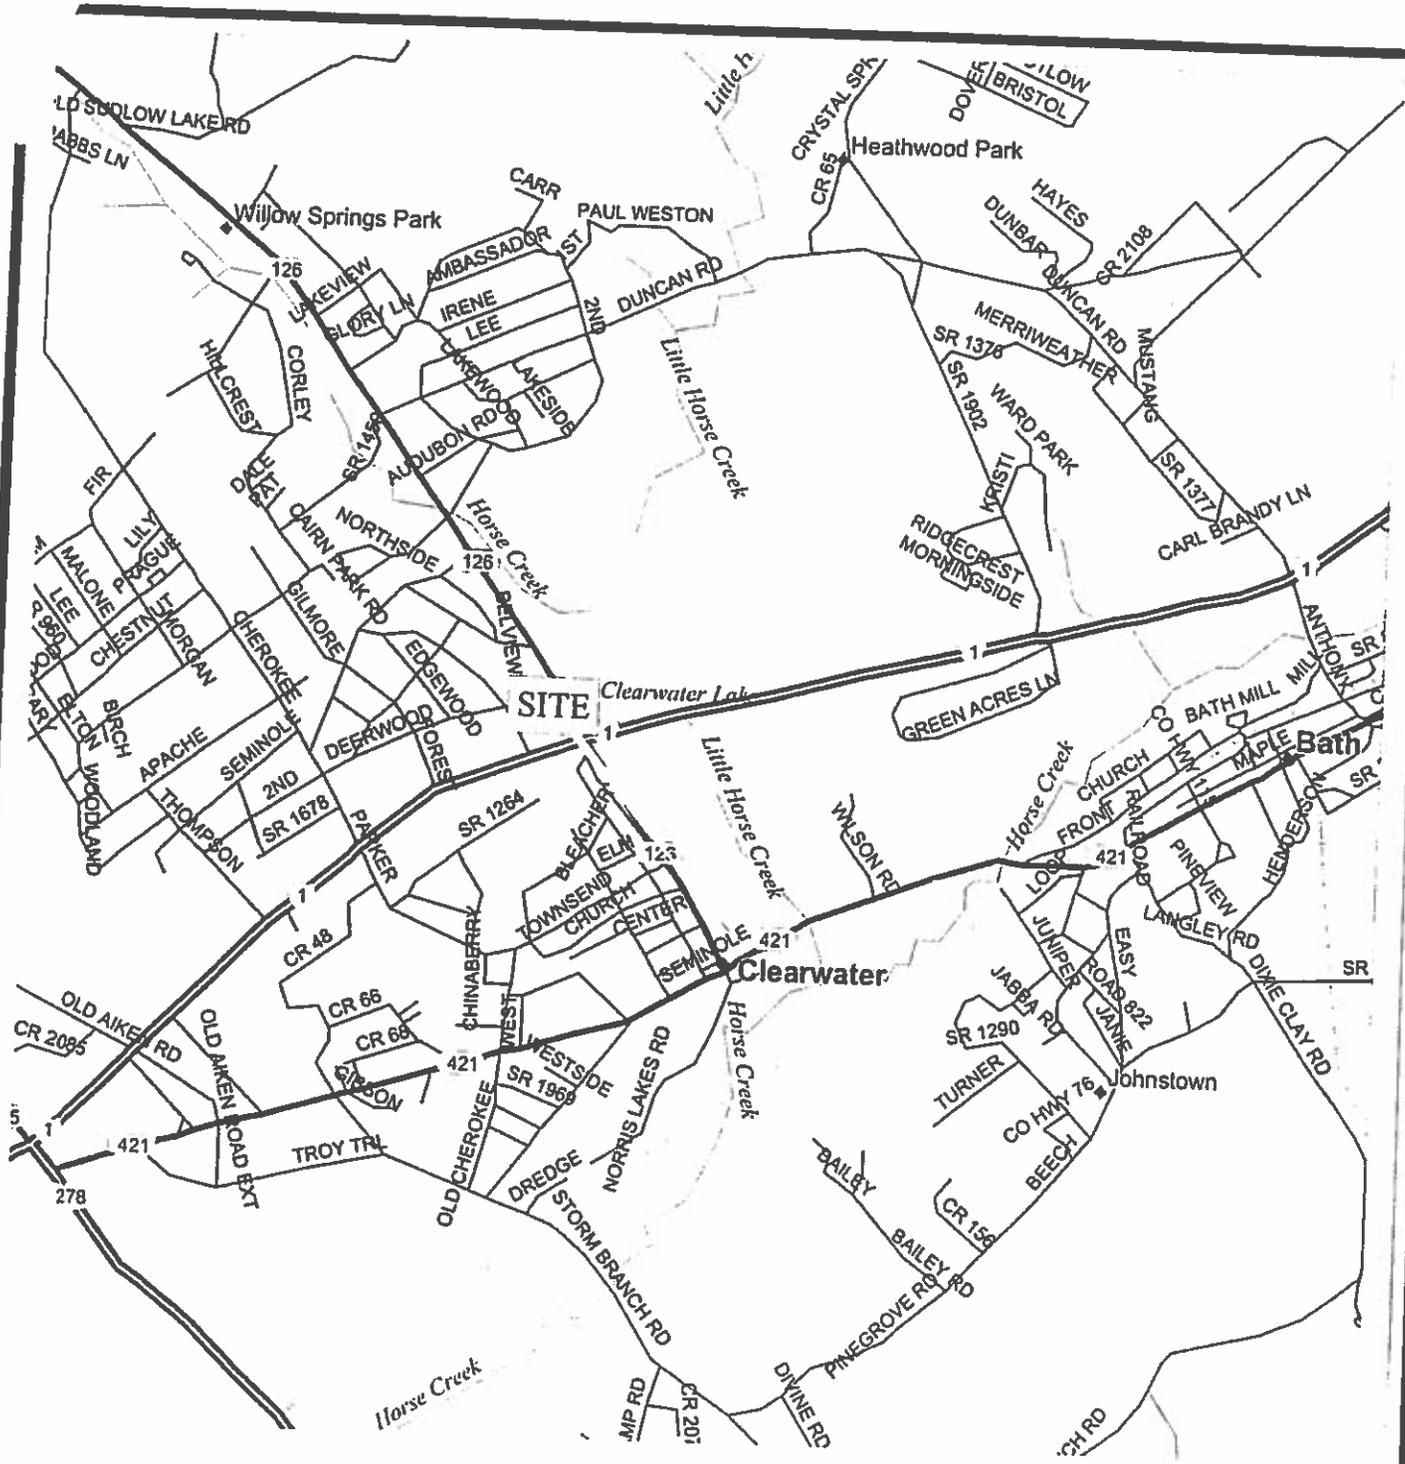

Source: DeLorme Street Atlas,  
Dated 2000.

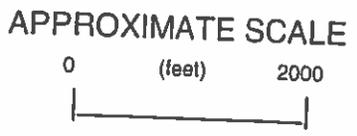

Concurrent Technologies  
Corporation  
Columbia, South Carolina




**SITE LOCATION MAP**  
Seminole Mills Site  
Clearwater, South Carolina

Prepared by: *[Signature]* Date: 4/05

Checked: *[Signature]* Date: 4/05

MACTEC Project 6671-05-0323 Figure 1

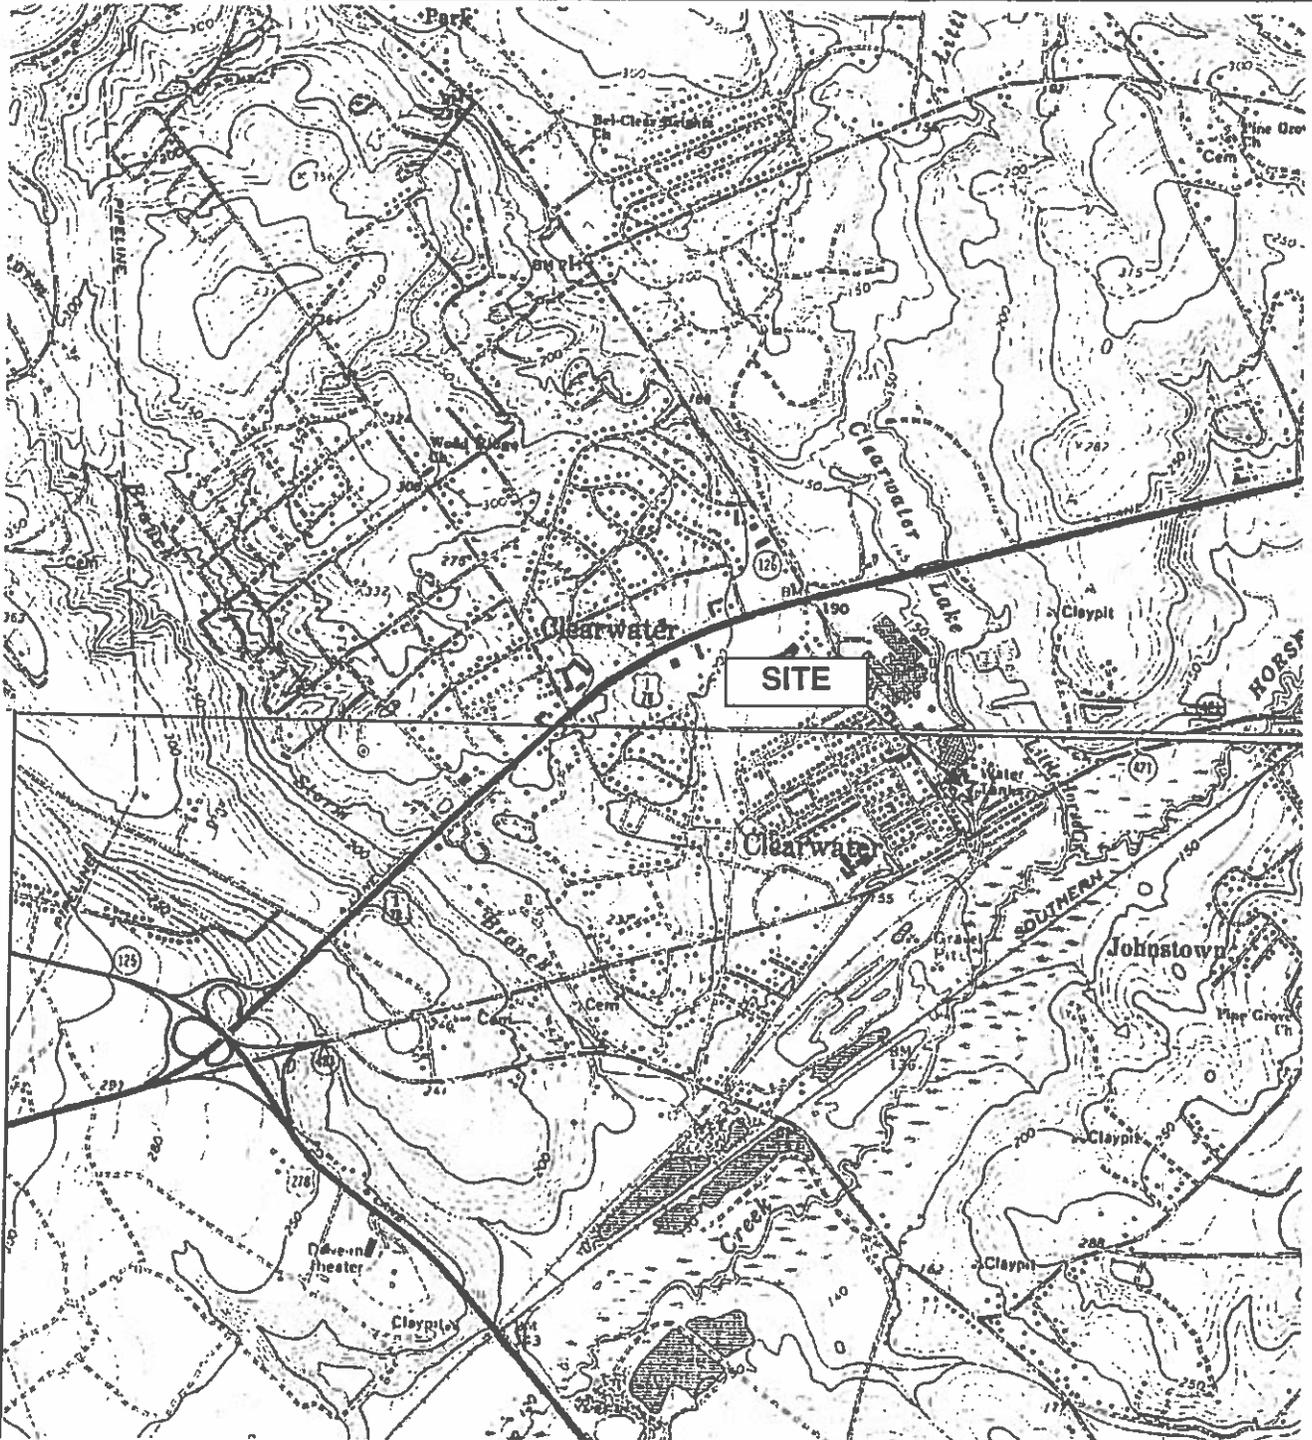

Source: USGS Topographic Map of North Augusta, South Carolina, dated 1965 and Augusta East, SC-GA, dated 1965.



APPROXIMATE SCALE

0 (feet) 2000



Concurrent Technologies Corporation  
Columbia, South Carolina

 **MACTEC**  
Columbia, South Carolina

**TOPOGRAPHIC MAP**  
Seminole Mills Site  
Columbia, South Carolina

**APPENDICES**

**APPENDIX A**  
**REGULATORY RECORDS DOCUMENTATION**



**EDR™** Environmental  
Data Resources Inc

# **The EDR Radius Map™ Report**

**Seminole Mills  
Belvedere Road  
NORTH AUGUSTA, SC 29842**

**Inquiry Number: 01359135.1r**

**February 11, 2005**

**The Standard in  
Environmental Risk  
Management Information**

**440 Wheelers Farms Road  
Milford, Connecticut 06460**

**Nationwide Customer Service**

**Telephone: 1-800-352-0050  
Fax: 1-800-231-6802  
Internet: [www.edrnet.com](http://www.edrnet.com)**

## TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary.....	ES1
Overview Map.....	2
Detail Map.....	3
Map Findings Summary.....	4
Map Findings.....	6
Orphan Summary.....	21
Zip Scan Report.....	ZIP-1
Government Records Searched/Data Currency Tracking.....	GR-1

### GEOCHECK ADDENDUM

GeoCheck - Not Requested

*Thank you for your business.*  
Please contact EDR at 1-800-352-0050  
with any questions or comments.

#### Disclaimer - Copyright and Trademark Notice

This report contains information obtained from a variety of public and other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL EDR BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. It can not be concluded from this report that coverage information for the target and surrounding properties does not exist from other sources. Any analyses, estimates, ratings or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Any liability on the part of EDR is strictly limited to a refund of the amount paid for this report.

Copyright 2005 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

## EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc. (EDR). The report meets the government records search requirements of ASTM Standard Practice for Environmental Site Assessments, E 1527-00. Search distances are per ASTM standard or custom distances requested by the user.

### TARGET PROPERTY INFORMATION

#### ADDRESS

BELVEDERE ROAD  
NORTH AUGUSTA, SC 29842

#### COORDINATES

Latitude (North): 33.498400 - 33° 29' 54.2"  
Longitude (West): 81.892300 - 81° 53' 32.3"  
Universal Transverse Mercator: Zone 17  
UTM X (Meters): 417113.7  
UTM Y (Meters): 3706705.2  
Elevation: 141 ft. above sea level

#### USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property: 33081-D8 AUGUSTA EAST, GA SC  
Source: USGS 7.5 min quad index

#### TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

#### DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ( "reasonably ascertainable ") government records either on the target property or within the ASTM E 1527-00 search radius around the target property for the following databases:

#### FEDERAL ASTM STANDARD

NPL..... National Priority List  
Proposed NPL..... Proposed National Priority List Sites  
CERC-NFRAP..... CERCLIS No Further Remedial Action Planned  
CORRACTS..... Corrective Action Report  
RCRA-TSDF..... Resource Conservation and Recovery Act Information  
RCRA-LQG..... Resource Conservation and Recovery Act Information  
ERNS..... Emergency Response Notification System

#### STATE ASTM STANDARD

SHWS..... Site Assessment Section Project List

## EXECUTIVE SUMMARY

SWF/LF..... Permitted Landfills List  
VCP..... Voluntary Cleanup Sites

### FEDERAL ASTM SUPPLEMENTAL

CONSENT..... Superfund (CERCLA) Consent Decrees  
ROD..... Records Of Decision  
Delisted NPL..... National Priority List Deletions  
HMIRS..... Hazardous Materials Information Reporting System  
MLTS..... Material Licensing Tracking System  
MINES..... Mines Master Index File  
NPL Liens..... Federal Superfund Liens  
PADS..... PCB Activity Database System  
INDIAN RESERV..... Indian Reservations  
UMTRA..... Uranium Mill Tailings Sites  
ODL..... Open Dump Inventory  
FUDS..... Formerly Used Defense Sites  
DOD..... Department of Defense Sites  
RAATS..... RCRA Administrative Action Tracking System  
TRIS..... Toxic Chemical Release Inventory System  
TSCA..... Toxic Substances Control Act  
SSTS..... Section 7 Tracking Systems  
FTTS INSP..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

### STATE OR LOCAL ASTM SUPPLEMENTAL

AST..... Aboveground Storage Tank List  
SC Spills..... Spill List  
DRYCLEANERS..... Drycleaner Database

### EDR PROPRIETARY HISTORICAL DATABASES

Coal Gas..... Former Manufactured Gas (Coal Gas) Sites

### BROWNFIELDS DATABASES

US BROWNFIELDS..... A Listing of Brownfields Sites  
VCP..... Voluntary Cleanup Sites  
BROWNFIELDS..... Brownfields Sites Listing  
AUL..... Land Use Controls

### SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in *bold italics* are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

## EXECUTIVE SUMMARY

### FEDERAL ASTM STANDARD

**CERCLIS:** The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA).

CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 12/14/2004 has revealed that there is 1 CERCLIS site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>CLEARWATER FINISHING SITE</i>	<i>SC RD 126 AT US HWY 117</i>	<i>1/2 - 1 WNW G14</i>		<i>14</i>

**RCRAInfo:** RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act ( RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store , treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 11/23/2004 has revealed that there are 5 RCRA-SQG sites within approximately 0.75 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>BEN TIMBERMAN MTRS</i>	<i>3900 AUGUSTA RD</i>	<i>0 - 118 S</i>	<i>A1</i>	<i>6</i>
<i>R E PHELON COMPANY INCORPORATE</i>	<i>3980 AUGUSTA RD</i>	<i>118 - 1/4 SSW</i>	<i>B3</i>	<i>6</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>HONDA CARS OF AIKEN</i>	<i>3720 AUGUSTA RD</i>	<i>118 - 1/4 E</i>	<i>C6</i>	<i>8</i>
<i>BEST IMPORTS, INC</i>	<i>3720 AUGUSTA ROAD</i>	<i>118 - 1/4 E</i>	<i>C7</i>	<i>9</i>
<i>DEPOT</i>	<i>3533 AUGUSTA ROAD</i>	<i>114 - 1/2 ENE</i>	<i>E10</i>	<i>10</i>

### STATE ASTM STANDARD

**LUST:** The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Health & Environmental Control's Leaking UST list.

A review of the LUST list, as provided by EDR, and dated 12/10/2004 has revealed that there are 3 LUST sites within approximately 1 mile of the target property.

## EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>SUNOCO 0616-1111/COOP2669</i>	<i>4368 JEFFERSON DAVIS HW</i>	<i>1/2 - 1 WNW</i>	<i>G17</i>	<i>20</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>HONDA CARS OF AIKEN</i>	<i>3720 AUGUSTA RD</i>	<i>1/8 - 1/4 E</i>	<i>C6</i>	<i>8</i>
<i>PANTRY 3247 DBA DEPOT</i>	<i>3533 AUGUSTA RD</i>	<i>1/4 - 1/2 ENE</i>	<i>E11</i>	<i>11</i>

**UST:** The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Health & Environmental Control's list: Comprehensive Underground Storage Tanks.

A review of the UST list, as provided by EDR, and dated 12/10/2004 has revealed that there are 6 UST sites within approximately 0.75 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>TRIANGLE PONTIAC GMC INC</i>	<i>4000 AUGUSTA RD</i>	<i>1/8 - 1/4 SSW</i>	<i>B5</i>	<i>7</i>
<i>CURGINS CORNER</i>	<i>3446 JEFFERSON DAVIS HW</i>	<i>1/2 - 1 NE</i>	<i>F12</i>	<i>12</i>
<i>SHOP N FILL 50</i>	<i>3446 JEFFERSON DAVIS HW</i>	<i>1/2 - 1 NE</i>	<i>F13</i>	<i>12</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>HONDA CARS OF AIKEN</i>	<i>3720 AUGUSTA RD</i>	<i>1/8 - 1/4 E</i>	<i>C6</i>	<i>8</i>
<i>BILL VERNON CHEVROLET</i>	<i>3635 AUGUSTA RD</i>	<i>1/4 - 1/2 ENE</i>	<i>D8</i>	<i>10</i>
<i>PANTRY 3247 DBA DEPOT</i>	<i>3533 AUGUSTA RD</i>	<i>1/4 - 1/2 ENE</i>	<i>E11</i>	<i>11</i>

### FEDERAL ASTM SUPPLEMENTAL

**FINDS:** The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 09/09/2004 has revealed that there are 8 FINDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>BEN TIMBERMAN MTRS</i>	<i>3900 AUGUSTA RD</i>	<i>0 - 1/8 S</i>	<i>A1</i>	<i>6</i>
<i>BOBBY S BBQ</i>	<i>3915 AUGUSTA RD</i>	<i>0 - 1/8 S</i>	<i>A2</i>	<i>6</i>
<i>R E PHELON COMPANY INCORPORATE</i>	<i>3980 AUGUSTA RD</i>	<i>1/8 - 1/4 SSW</i>	<i>B3</i>	<i>6</i>
<i>TRIANGLE PONTIAC GMC INC</i>	<i>4000 AUGUSTA RD</i>	<i>1/8 - 1/4 SSW</i>	<i>B4</i>	<i>7</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>HONDA CARS OF AIKEN</i>	<i>3720 AUGUSTA RD</i>	<i>1/8 - 1/4 E</i>	<i>C6</i>	<i>8</i>
<i>BEST IMPORTS, INC</i>	<i>3720 AUGUSTA ROAD</i>	<i>1/8 - 1/4 E</i>	<i>C7</i>	<i>9</i>
<i>BILL VERNON CHEVROLET</i>	<i>3635 AUGUSTA RD</i>	<i>1/4 - 1/2 ENE</i>	<i>D9</i>	<i>10</i>

## EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>DEPOT</i>	<i>3533 AUGUSTA ROAD</i>	<i>1/4 - 1/2ENE</i>	<i>E10</i>	<i>10</i>

### STATE OR LOCAL ASTM SUPPLEMENTAL

**GWIC:** Groundwater Contamination Inventory Cases. Any site that has groundwater contamination over a federal MCL.

A review of the GWCI list, as provided by EDR, and dated 07/01/2004 has revealed that there are 4 GWCI sites within approximately 1 mile of the target property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>SHOP N FILL 50</i>	<i>3446 JEFFERSON DAVIS HW</i>	<i>1/2 - 1 NE</i>	<i>F13</i>	<i>12</i>
<i>CLEARWATER FINISHING SITE</i>	<i>SC RD 126 AT US HWY 117</i>	<i>1/2 - 1 WNW</i>	<i>G14</i>	<i>14</i>
<i>MAJIK MARKET 34062</i>	<i>US 1 &amp; PARKER ST</i>	<i>1/2 - 1 W</i>	<i>15</i>	<i>16</i>
<i>FIRST STOP CLEARWATER</i>	<i>4368 JEFFERSON DAVIS HW</i>	<i>1/2 - 1 WNW</i>	<i>G16</i>	<i>17</i>

## EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

<u>Site Name</u>	<u>Database(s)</u>
KIMBERLY CLARK CORP	SHWS
BELVEDERE CLEANERS	SHWS, DRYCLEANERS
GRANITEVILLE COMPANY/TOWNSEND DIV.	SHWS
GRANITEVILLE CEMETERY DUMP	SHWS, CERC-NFRAP
GRANITEVILLE CO/LAGOON	SHWS
ALLEN, EARL CHEMICAL SITE	SHWS, CERC-NFRAP
344 GEORGIA AVENUE	SHWS
NORTH AUGUSTA CITY DUMP	SHWS, CERC-NFRAP
SIMKINS FARM SITE	CERC-NFRAP
BELVEDERE AMOCO	FINDS, LUST
GULF SERVICE STATION 265603	FINDS, LUST
INTERSTATE-N AUGUSTA	FINDS, LUST
SC ARMY NATIONAL GUARD CO C 122 ENG BN	LUST
BELVEDERE AMOCO	GWCI, UST
J M HUBER CORPORATION	UST
GULF SERVICE STATION 265603	UST
MURPHY USA 6900	UST
FOX CANDY CO	UST
R L MCKIE & SONS	UST
FORMER CHEVRON FOOD MART	GWCI, UST
INTERSTATE-N AUGUSTA	GWCI, UST
KINDER MORGAN SOUTHEAST TERMINALS LLC N AUGUSTA	UST
EASY STOP	UST
PHILLIPS PIPELINE - SWEETWATER	AST
BP OIL-SITE #23776	RCRA-SQG, FINDS
JM HUBER GRANITEVILLE OPR	RCRA-SQG, FINDS
BP OIL-SITE #48786	RCRA-SQG
VIKING FREIGHT N AUGUSTA	RCRA-SQG, FINDS
AIKEN AUGUSTA AUTO BODY	RCRA-SQG, FINDS
HORSE CREEK WASTEWATER PLANT	RCRA-SQG, FINDS
SILVERSTEINS CLEANERS	RCRA-SQG, FINDS
NORTH AUGUSTA MIDDLE SCHOOL	RCRA-SQG, FINDS
HALOCARBON PRODUCTS CORPORATION	RCRA-LQG
AVONDALE MILLS INC	FINDS
AVONDALE MILLS INCORPORATED GREGG	FINDS
AVONDALE MILLS INCORPORATED WATER PLANT	FINDS
AVONDALE MILLS INC - WOODHEAD	SSTS

DETAIL MAP - 01359135.1r - MACTEC, Inc.

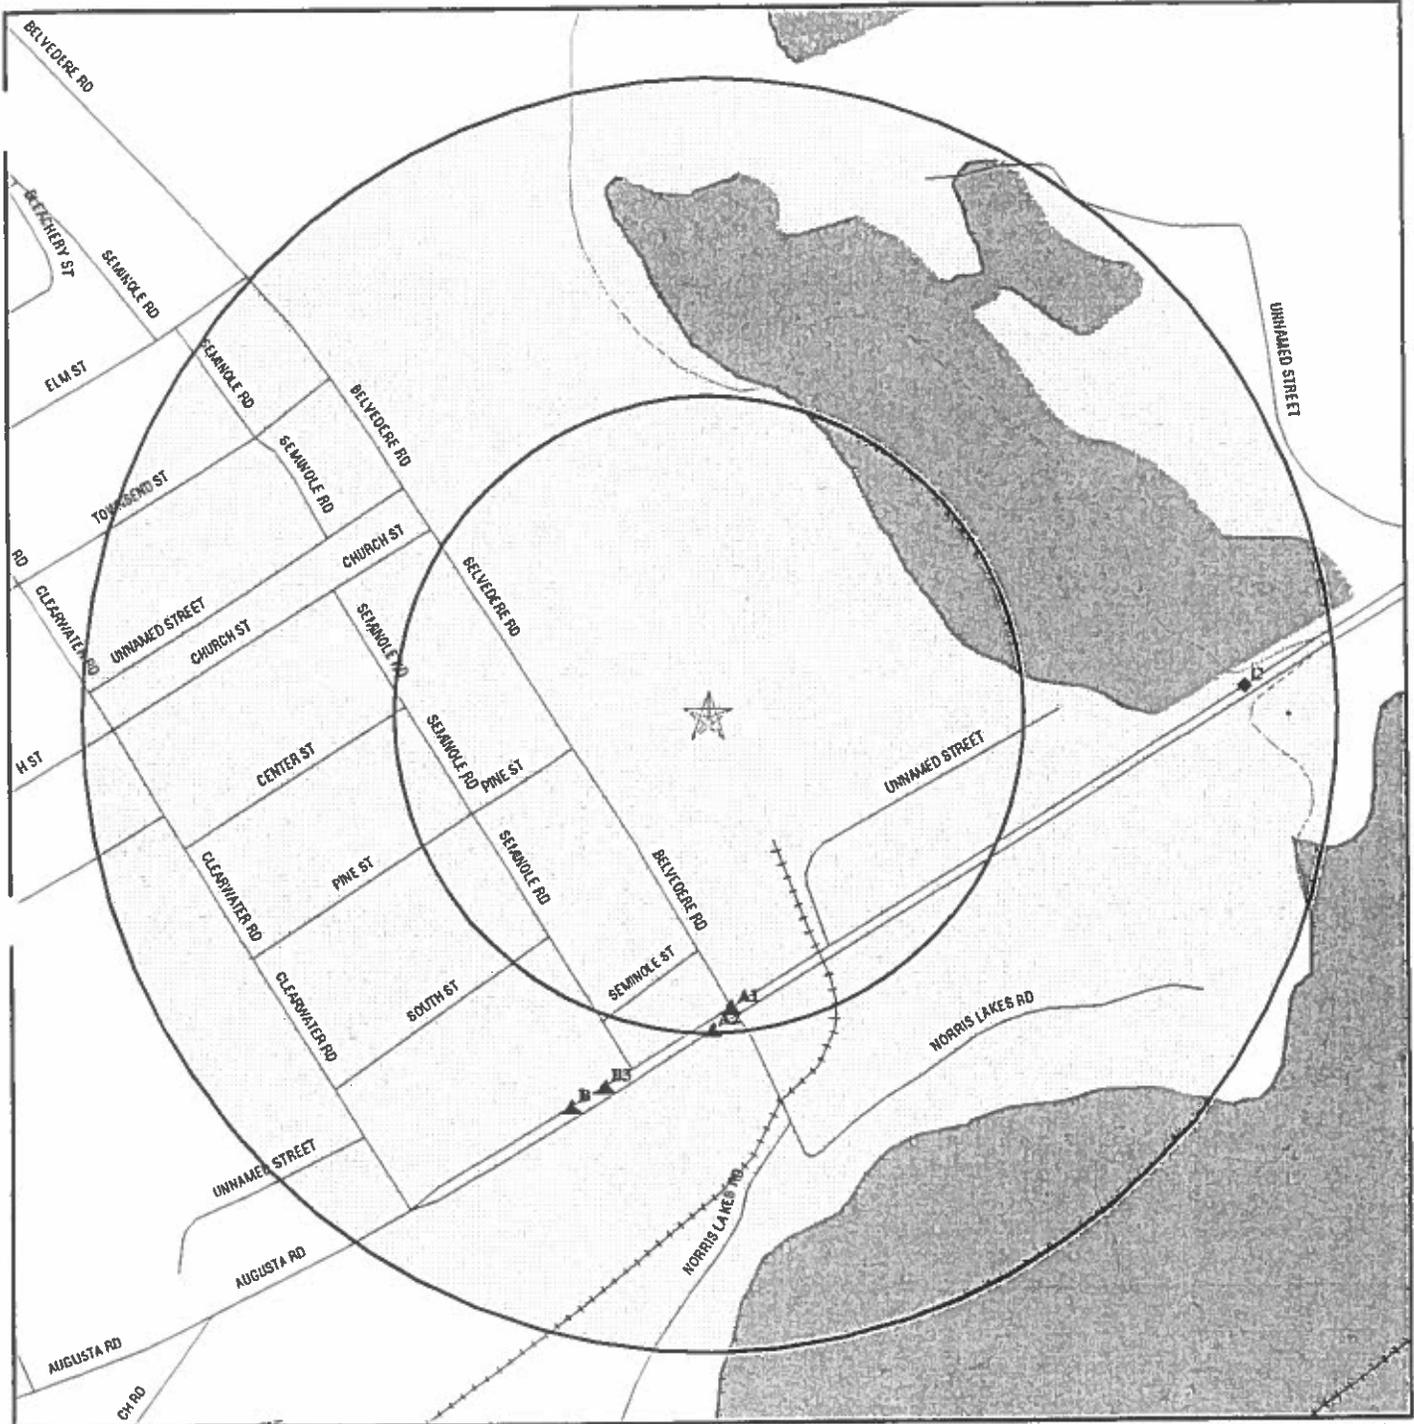


- ☆ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- Sensitive Receptors
- National Priority List Sites
- Landfill Sites
- Dept. Defense Sites

- Indian Reservations BIA
- County Boundary
- Oil & Gas pipelines
- Federal Wetlands



TARGET PROPERTY:	Seminole Mills	CUSTOMER:	MACTEC, Inc.
ADDRESS:	Belvedere Road	CONTACT:	Matt Cooke
CITY/STATE/ZIP:	NORTH AUGUSTA SC 29842	INQUIRY #:	01359135.1r
LAT/LONG:	33.4984 / 81.8923	DATE:	February 11, 2005 1:01 pm

OVERVIEW MAP - 01359135.1r - MACTEC, Inc.

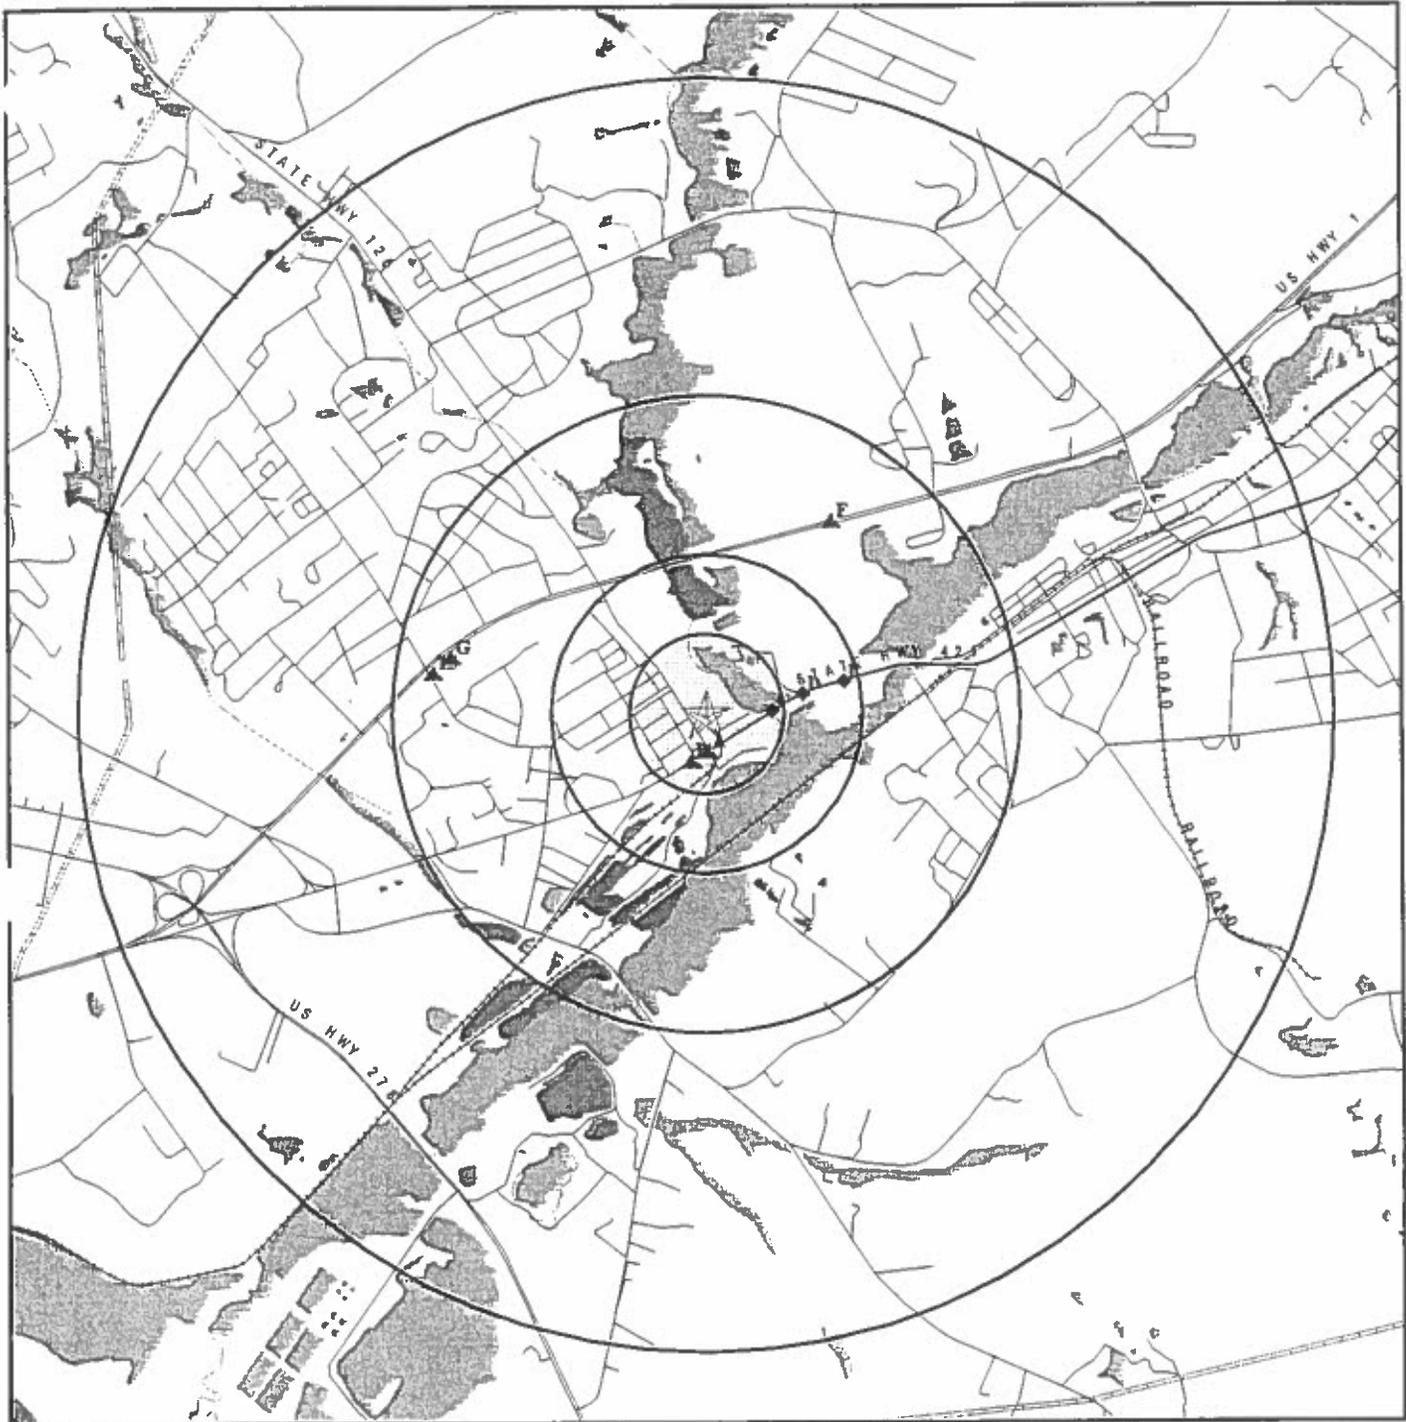

- ☆ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- National Priority List Sites
- Landfill Sites
- Dept. Defense Sites

- Indian Reservations BIA
- County Boundary
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▧ 500-year flood zone
- Federal Wetlands



<p><b>TARGET PROPERTY:</b> Seminole Mills  <b>ADDRESS:</b> Belvedere Road  <b>CITY/STATE/ZIP:</b> NORTH AUGUSTA SC 29842  <b>LAT/LONG:</b> 33.4984 / 81.8923</p>	<p><b>CUSTOMER:</b> MACTEC, Inc.  <b>CONTACT:</b> Matt Cooke  <b>INQUIRY #:</b> 01359135.1r  <b>DATE:</b> February 11, 2005 1:01 pm</p>
--	---

## MAP FINDINGS SUMMARY

<u>Database</u>	<u>Target Property</u>	<u>Search Distance (Miles)</u>	<u>&lt; 1/8</u>	<u>1/8 - 1/4</u>	<u>1/4 - 1/2</u>	<u>1/2 - 1</u>	<u>&gt; 1</u>	<u>Total Plotted</u>
<b><u>FEDERAL ASTM STANDARD</u></b>								
NPL		1.500	0	0	0	0	0	0
Proposed NPL		1.500	0	0	0	0	0	0
CERCLIS		1.000	0	0	0	1	NR	1
CERC-NFRAP		0.750	0	0	0	0	NR	0
CORRACTS		1.500	0	0	0	0	0	0
RCRA TSD		1.000	0	0	0	0	NR	0
RCRA Lg. Quan. Gen.		0.750	0	0	0	0	NR	0
RCRA Sm. Quan. Gen.		0.750	1	3	1	0	NR	5
ERNS		0.500	0	0	0	NR	NR	0
<b><u>STATE ASTM STANDARD</u></b>								
State Haz. Waste		1.500	0	0	0	0	0	0
State Landfill		1.000	0	0	0	0	NR	0
LUST		1.000	0	1	1	1	NR	3
UST		0.750	0	2	2	2	NR	6
VCP		1.000	0	0	0	0	NR	0
<b><u>FEDERAL ASTM SUPPLEMENTAL</u></b>								
CONSENT		1.500	0	0	0	0	0	0
ROD		1.500	0	0	0	0	0	0
Delisted NPL		1.500	0	0	0	0	0	0
FINDS		0.500	2	4	2	NR	NR	8
HMIRS		0.500	0	0	0	NR	NR	0
MLTS		0.500	0	0	0	NR	NR	0
MINES		0.750	0	0	0	0	NR	0
NPL Liens		0.500	0	0	0	NR	NR	0
PADS		0.500	0	0	0	NR	NR	0
INDIAN RESERV		1.500	0	0	0	0	0	0
UMTRA		1.000	0	0	0	0	NR	0
ODI		1.000	0	0	0	0	NR	0
FUDS		1.500	0	0	0	0	0	0
DOD		1.500	0	0	0	0	0	0
RAATS		0.500	0	0	0	NR	NR	0
TRIS		0.500	0	0	0	NR	NR	0
TSCA		0.500	0	0	0	NR	NR	0
SSTS		0.500	0	0	0	NR	NR	0
FTTS		0.500	0	0	0	NR	NR	0
<b><u>STATE OR LOCAL ASTM SUPPLEMENTAL</u></b>								
AST		0.500	0	0	0	NR	NR	0
SC Spills		0.500	0	0	0	NR	NR	0
GWCJ		1.000	0	0	0	4	NR	4
DRYCLEANERS		0.750	0	0	0	0	NR	0

## MAP FINDINGS SUMMARY

<u>Database</u>	<u>Target Property</u>	<u>Search Distance (Miles)</u>	<u>&lt; 1/8</u>	<u>1/8 - 1/4</u>	<u>1/4 - 1/2</u>	<u>1/2 - 1</u>	<u>&gt; 1</u>	<u>Total Plotted</u>
<b><u>EDR PROPRIETARY HISTORICAL DATABASES</u></b>								
Coal Gas		1.500	0	0	0	0	0	0
<b><u>BROWNFIELDS DATABASES</u></b>								
US BROWNFIELDS		1.000	0	0	0	0	NR	0
VCP		1.000	0	0	0	0	NR	0
BROWNFIELDS		1.000	0	0	0	0	NR	0
AUL		1.000	0	0	0	0	NR	0

**NOTES:**

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

MAP FINDINGS

Map ID Direction Distance Distance (ft.) Elevation	Site		EDR ID Number EPA ID Number
		Database(s)	

Coal Gas Site Search: No site was found in a search of Real Property Scan's ENVIROHAZ database.

A1 South < 1/8 608 ft.	<b>BEN TIMBERMAN MTRS</b> 3900 AUGUSTA RD AIKEN, SC 29801	RCRA-SQG FINDS	1000575714 SCD987581444
---------------------------------	---	-------------------	----------------------------

Site 1 of 2 in cluster A

Relative: Higher

Actual: 144 ft.

RCRAInfo:  
 Owner: BEN TIMMERMAN SR  
 (803) 649-2555  
 EPA ID: SCD987581444  
 Contact: BILL CAROTHERS  
 (803) 648-2654

Classification: Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site:  
 Resource Conservation and Recovery Act Information system  
 SC-EFIS

A2 South < 1/8 651 ft.	<b>BOBBY S BBQ</b> 3915 AUGUSTA RD AIKEN, SC 29801	FINDS	1007236200 110017076563
---------------------------------	--	-------	----------------------------

Site 2 of 2 in cluster A

Relative: Higher

Actual: 144 ft.

B3 SSW 1/8-1/4 801 ft.	<b>R E PHELON COMPANY INCORPORATED</b> 3980 AUGUSTA RD AIKEN, SC 29801	RCRA-SQG FINDS	1000835531 SCD987596095
---------------------------------	--	-------------------	----------------------------

Site 1 of 3 in cluster B

Relative: Higher

Actual: 146 ft.

RCRAInfo:  
 Owner: R E PHELON COMPANY INC  
 (803) 649-1381  
 EPA ID: SCD987596095  
 Contact: DOTTIE DESERTO  
 (803) 643-7813

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

MAP FINDINGS

Map ID			EDR ID Number
Direction			EPA ID Number
Distance			
Distance (ft.)		Database(s)	
Elevation	Site		

---

**R E PHELON COMPANY INCORPORATED (Continued)** 1000835531

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site:  
Resource Conservation and Recovery Act Information system  
SC-EFIS

<b>B4</b> <b>SSW</b> 1/8-1/4 862 ft.	<b>TRIANGLE PONTIAC GMC INC</b> <b>4000 AUGUSTA RD</b> <b>AIKEN, SC 29801</b>  Site 2 of 3 in cluster B	<b>FINDS</b> 1007236997 110017084698
---	---	---

Relative: Higher  
 Actual: 146 ft.

**FINDS:**  
Other Pertinent Environmental Activity Identified at Site:  
SC-EFIS

<b>B5</b> <b>SSW</b> 1/8-1/4 862 ft.	<b>TRIANGLE PONTIAC GMC INC</b> <b>4000 AUGUSTA RD</b> <b>AIKEN, SC 29801</b>  Site 3 of 3 in cluster B	<b>UST</b> U003526086 N/A
---	---	------------------------------

Relative: Higher  
 Actual: 146 ft.

**UST:**

Facility ID: 228 Contact: DICK FLYNT Capacity: 3000 Product: Gasoline Status: Abandoned Owner: TRIANGLE PONTIAC GMC INC Owner Contact: DICK FLYNT Owner Address: 4000 AUGUSTA RD  AIKEN, SC 29801 Owner Phone: 803-648-0471	Tank ID: 1 Contact Tel: 803-648-0471 Calcage: Not reported
---	--

Facility ID: 228 Contact: DICK FLYNT Capacity: 1000 Product: Gasoline Status: Abandoned Owner: TRIANGLE PONTIAC GMC INC Owner Contact: DICK FLYNT Owner Address: 4000 AUGUSTA RD  AIKEN, SC 29801 Owner Phone: 803-648-0471	Tank ID: 2 Contact Tel: 803-648-0471 Calcage: Not reported
---	--

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

C6  
East  
1/8-1/4  
1128 ft.

**HONDA CARS OF AIKEN**  
3720 AUGUSTA RD  
AIKEN, SC 29801

Database(s)      EDR ID Number  
EPA ID Number

RCRA-SQG      1000184378  
FINDS          SCD987566809  
LUST  
UST

Relative:  
Lower

Actual:  
134 ft.

**Site 1 of 2 in cluster C**

**RCRAInfo:**

Owner:            AIKEN AUTO INVESTORS CORP  
                      (404) 555-1212  
EPA ID:            SCD987566809  
Contact:          DAN KNAKE  
                      (803) 642-8109

Classification:   Small Quantity Generator  
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated:            262.13  
Area of Violation:                GENERATOR-GENERAL REQUIREMENTS  
Date Violation Determined:      01/19/2000  
Actual Date Achieved Compliance: 01/19/2000

There are 1 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20000119

Date of  
Compliance  
20000119

**FINDS:**

Other Pertinent Environmental Activity Identified at Site:  
Resource Conservation and Recovery Act Information system  
SC-EFIS

**LUST:**

Facility ID:	10919	Proj Manager:	PASLEYDC
Report Date:	05/29/90	Num Of Releases:	1
Owner:	HENDRICK MANAGEMENT CORP		
NFA Date:	7/19/1995	Rank:	Not reported
Date Confirmed:	03/05/91		
Facility Status:	0		
Substance:	PETRO		

**UST:**

Facility ID:	10919	Tank ID:	1
Contact:	JOHN FAIRCLOTH	Contact Tel:	803-642-8109
Capacity:	1000	Calcage:	Not reported
Product:	Gasoline		
Status:	Abandoned		
Owner:	HENDRICK MANAGEMENT CORP		
Owner Contact:	JOHN FAIRCLOTH		
Owner Address:	6000 MONROE RD - STE 100		

Owner Phone:      CHARLOTTE, NC 28212  
704-568-5550

Facility ID:	10919	Tank ID:	2
Contact:	JOHN FAIRCLOTH	Contact Tel:	803-642-8109
Capacity:	2000	Calcage:	Not reported
Product:	Motor Oil		
Status:	Abandoned		
Owner:	HENDRICK MANAGEMENT CORP		



MAP FINDINGS

Map ID			
Direction			
Distance			
Distance (ft.)			EDR ID Number
Elevation	Site	Database(s)	EPA ID Number

<b>D8</b> <b>ENE</b> 1/4-1/2 1688 ft.	<b>BILL VERNON CHEVROLET</b> <b>3635 AUGUSTA RD</b> <b>AIKEN, SC 29801</b>	<b>UST</b>	<b>U003519363</b> <b>N/A</b>
--	--	------------	---------------------------------

Site 1 of 2 in cluster D

<b>Relative:</b> <b>Lower</b>	<b>UST:</b> Facility ID: 62 Contact: JOHN KERR Capacity: 150 Product: Miscellaneous Hydrocarbons Status: Abandoned Owner: SOUTHEASTERN CHEMICAL & SOLVENT CO Owner Contact: JOHN KERR Owner Address: 755 INDUSTRIAL RD  SUMTER, SC 29150 Owner Phone: 803-773-1400	Tank ID: 1 Contact Tel: Not reported Calcage: Not reported	
----------------------------------	---	--	--

<b>D9</b> <b>ENE</b> 1/4-1/2 1688 ft.	<b>BILL VERNON CHEVROLET</b> <b>3635 AUGUSTA RD</b> <b>AIKEN, SC 29801</b>	<b>FINDS</b>	<b>1007260168</b> <b>110017332509</b>
--	--	--------------	--

Site 2 of 2 in cluster D

<b>Relative:</b> <b>Lower</b>	<b>FINDS:</b> Other Pertinent Environmental Activity Identified at Site: SC-EFIS		
----------------------------------	--	--	--

<b>E10</b> <b>ENE</b> 1/4-1/2 2396 ft.	<b>DEPOT</b> <b>3533 AUGUSTA ROAD</b> <b>WARRENVILLE, SC 29851</b>	<b>RCRA-SQG</b> <b>FINDS</b>	<b>1004780418</b> <b>SCD987574365</b>
---	--	---------------------------------	--

Site 1 of 2 in cluster E

<b>Relative:</b> <b>Lower</b>	<b>RCRAInfo:</b> Owner: THE PANTRY INC (919) 774-6700 EPA ID: SCD987574365 Contact: Not reported Classification: Small Quantity Generator TSDF Activities: Not reported Violation Status: No violations found		
----------------------------------	--	--	--

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site:  
 Resource Conservation and Recovery Act Information system  
 SC-EFIS

MAP FINDINGS

Map ID			
Direction			
Distance			
Distance (ft.)		Database(s)	EDR ID Number
Elevation	Site		EPA ID Number

<b>E11</b> <b>ENE</b> <b>1/4-1/2</b> <b>2396 ft.</b>	<b>PANTRY 3247 DBA DEPOT</b> <b>3533 AUGUSTA RD</b> <b>WARRENVILLE, SC 29851</b>	<b>LUST</b> <b>UST</b>	<b>U003558665</b> <b>N/A</b>
---	--	---------------------------	---------------------------------

Site 2 of 2 in cluster E

Relative:  
Lower

**LUST:**

Actual:  
134 ft.

Facility ID: 125 Report Date: 11/21/97 Owner: PANTRY INC NFA Date: 5/8/1998 Date Confirmed: 12/20/97 Facility Status: 0 Substance: PETRO	Proj Manager: STEPPAK Num Of Releases 1  Rank: Not reported
--	--

**UST:**

Facility ID: 125 Contact: DORIS BRIDGES Capacity: 4000 Product: Gasoline Status: Abandoned Owner: PANTRY INC Owner Contact: DORIS BRIDGES Owner Address: PO BOX 1410	Tank ID: 1 Contact Tel: Not reported Calcage: 5
---	---

SANFORD, NC 27331  
Owner Phone: 919-774-6700

Facility ID: 125 Contact: DORIS BRIDGES Capacity: 6000 Product: Gasoline Status: Abandoned Owner: PANTRY INC Owner Contact: DORIS BRIDGES Owner Address: PO BOX 1410	Tank ID: 2 Contact Tel: Not reported Calcage: 5
---	---

SANFORD, NC 27331  
Owner Phone: 919-774-6700

Facility ID: 125 Contact: DORIS BRIDGES Capacity: 8000 Product: Gasoline Status: Abandoned Owner: PANTRY INC Owner Contact: DORIS BRIDGES Owner Address: PO BOX 1410	Tank ID: 3 Contact Tel: Not reported Calcage: 5
---	---

SANFORD, NC 27331  
Owner Phone: 919-774-6700

Facility ID: 125 Contact: DORIS BRIDGES Capacity: 16000 Product: Multiple Petroleum Products Status: Currently in use Owner: PANTRY INC Owner Contact: DORIS BRIDGES Owner Address: PO BOX 1410	Tank ID: 4 Contact Tel: Not reported Calcage: 0
--	---

MAP FINDINGS

Map ID			EDR ID Number
Direction			
Distance			
Distance (ft.)			
Elevation	Site	Database(s)	EPA ID Number

**PANTRY 3247 DBA DEPOT (Continued)**

U003558665

SANFORD, NC 27331  
Owner Phone: 919-774-6700

F12  
NE  
1/2-1  
3857 ft.

**CURGINS CORNER**  
3446 JEFFERSON DAVIS HWY  
GRANITEVILLE, SC 29829

UST U003943120  
N/A

Site 1 of 2 in cluster F

Relative:  
Higher

Actual:  
213 ft.

UST:		Tank ID:	1
Facility ID:	19004	Contact Tel:	800-695-6626
Contact:	JOHN BOYD	Calclage:	0
Capacity:	12000		
Product:	Gasoline		
Status:	Currently in use		
Owner:	MANSFIELD OIL CO		
Owner Contact:	JOHN BOYD		
Owner Address:	1025 AIRPORT PKWY SW		

GAINESVILLE, GA 30501  
Owner Phone: 678-450-2126

Facility ID:	19004	Tank ID:	2
Contact:	JOHN BOYD	Contact Tel:	800-695-6626
Capacity:	12000	Calclage:	0
Product:	Multiple Petroleum Products		
Status:	Currently in use		
Owner:	MANSFIELD OIL CO		
Owner Contact:	JOHN BOYD		
Owner Address:	1025 AIRPORT PKWY SW		

GAINESVILLE, GA 30501  
Owner Phone: 678-450-2126

F13  
NE  
1/2-1  
3857 ft.

**SHOP N FILL 50**  
3446 JEFFERSON DAVIS HWY  
BATH, SC 29816

GWCI U003930063  
UST N/A

Site 2 of 2 in cluster F

Relative:  
Higher

Actual:  
213 ft.

SC GWIC:	
Contamination:	PETRO
Permit Number:	12030
EAP ID:	Not reported
WPC Permit:	Not reported
Surface Impact:	No
Source:	UST
Bureau:	Bureau of Land and Waste Management
Solid Waste Permit #:	Not reported
Bureau of Land and Waste Management file #:	Not reported
Program:	DUST
Petroleum Products:	True
Volatile Organic Compounds:	False
Metals:	False
Nitrates or Potential to Nitrate:	False
Pesticides and Herbicides:	False
Polychlorinated Biphenyls:	False

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

SHOP N FILL 50 (Continued)

U003930063

Base, Neutral, and Acid Extractables: False  
Phenols : False  
Radionuclides Over Max Contaminant Levels: False  
Sources Not In Other Categories: False  
Underground Storage Tanks: True  
Pits, Ponds, and Lagoons: False  
Spills and Leaks: False  
Landfills: False  
Aboveground Storage Tank: False  
Spray Irrigation: False  
Single-Event Spill : False  
Unpermitted Disposal : False  
Septic Tank/Tile Field: False  
Substances Not In Other Categories: False  
Sources of Contamination Undetermined: False  
Assessment: No  
Monitoring: No  
Remediation: Yes  
Drinking Water Well Impact: No  
Remarks: Site ID # 12030. RBCA Classification 2AA4. Active corrective action

UST:

Facility ID: 12030 Tank ID: 1  
Contact: W JACKSON Contact Tel: Not reported  
Capacity: 6000 Calcage: 5  
Product: Gasoline  
Status: Abandoned  
Owner: JACKSON PETROLEUM  
Owner Contact: W JACKSON  
Owner Address: PO BOX 861  
AIKEN, SC 29802  
Owner Phone: 803-648-0763

Facility ID: 12030 Tank ID: 2  
Contact: W JACKSON Contact Tel: Not reported  
Capacity: 6000 Calcage: 5  
Product: Gasoline  
Status: Abandoned  
Owner: JACKSON PETROLEUM  
Owner Contact: W JACKSON  
Owner Address: PO BOX 861  
AIKEN, SC 29802  
Owner Phone: 803-648-0763

Facility ID: 12030 Tank ID: 3  
Contact: W JACKSON Contact Tel: Not reported  
Capacity: 6000 Calcage: 5  
Product: Gasoline  
Status: Abandoned  
Owner: JACKSON PETROLEUM  
Owner Contact: W JACKSON  
Owner Address: PO BOX 861  
AIKEN, SC 29802  
Owner Phone: 803-648-0763

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

Database(s) EDR ID Number  
 EPA ID Number

**SHOP N FILL 50 (Continued)**

U003930063

Facility ID:	12030	Tank ID:	4
Contact:	W JACKSON	Contact Tel:	Not reported
Capacity:	6000	Calcage:	5
Product:	Gasoline		
Status:	Abandoned		
Owner:	JACKSON PETROLEUM		
Owner Contact:	W JACKSON		
Owner Address:	PO BOX 861		
	AIKEN, SC 29802		
Owner Phone:	803-648-0763		

G14  
 WNW  
 1/2-1  
 4385 ft.

**CLEARWATER FINISHING SITE**  
 SC RD 126 AT US HWY 1/78  
 CLEARWATER, SC 29822

GWCI 1000156559  
 CERCLIS SCD003303120  
 RCRA-SQG

Site 1 of 3 in cluster G

Relative:  
 Higher

Actual:  
 233 ft.

<b>CERCLIS Classification Data:</b>		Federal Facility:	Not a Federal Facility
Site incident category:	Not reported		
Non NPL Status:	NFRAP	NPL Status:	Not on the NPL
Ownership Status:	Other	Contact Tel:	(404) 562-8814
Contact:	Beth Brown		
Contact Title:	Not reported	Contact Tel:	(404) 562-8923
Contact:	BARBARA DICK		
Contact Title:	Not reported	Contact Tel:	(404) 562-8829
Contact:	Ralph Howard		
Contact Title:	Not reported	Contact Tel:	(404) 562-8793
Contact:	YVONNE JONES		
Contact Title:	Not reported	Contact Tel:	(404) 562-8795
Contact:	William Joyner		
Contact Title:	Not reported	Contact Tel:	(404) 562-8792
Contact:	Mike Norman		
Contact Title:	Not reported	Contact Tel:	(404) 562-8827
Contact:	CRAIG ZELLER		
Contact Title:	Not reported		
Site Description:	ABANDONED TEXTILE MILL CONTAINING HAZARDOUS WASTE. REMOVAL ACTION SCHEDULED.		
<b>CERCLIS Assessment History:</b>			
Assessment:	DISCOVERY	Completed:	06/01/1981
Assessment:	PRELIMINARY ASSESSMENT	Completed:	09/01/1982
Assessment:	INTEGRATED ASSESSMENT	Completed:	04/07/1994
Assessment:	ADMINISTRATIVE RECORDS	Completed:	08/25/1994
Assessment:	REMOVAL	Completed:	08/04/1995
Assessment:	SITE INSPECTION	Completed:	05/10/1996
Assessment:	NON-NPL PRP SEARCH	Completed:	06/01/1998
Assessment:	Lodged By DOJ	Completed:	06/01/1999
Assessment:	Lodged By DOJ	Completed:	06/29/1999
Assessment:	Lodged By DOJ	Completed:	08/02/1999
Assessment:	CONSENT AGREEMENT (ADMINISTRATIVE)	Completed:	09/17/1999
Assessment:	SECTION 107 LITIGATION	Completed:	11/12/1999
Assessment:	CONSENT DECREE	Completed:	11/12/1999
<b>CERCLIS Site Status:</b>			
Not reported			
<b>CERCLIS Alias Name(s):</b>			
CLEARWATER SITE			

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

Database(s) EDR ID Number  
 EPA ID Number

1000156559

**CLEARWATER FINISHING SITE (Continued)**

**RCRAInfo:**

Owner: OPERNAME  
 (404) 555-1212  
 EPA ID: SCD003303120  
 Contact: STEVE SPURLIH  
 (404) 347-3931

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated:	Not reported
Area of Violation:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	05/08/1986
Actual Date Achieved Compliance:	06/23/1986
Regulation Violated:	Not reported
Area of Violation:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	05/08/1986
Actual Date Achieved Compliance:	06/23/1986

There are 2 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19860623
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19860623

**SC GWIC:**

Contamination:	VOC, Metal
Permit Number:	Not reported
EAP ID:	SCD003303120
WPC Permit:	Not reported
Surface Impact:	Yes
Source:	PPL, S/L
Bureau:	Bureau of Land and Waste Management
Solid Waste Permit #:	Not reported
Bureau of Land and Waste Management file #:	Not reported
Program:	STATE SUPERFUND
Petroleum Products:	False
Volatile Organic Compounds:	True
Metals:	True
Nitrates or Potential to Nitrate:	False
Pesticides and Herbicides:	False
Polychlorinated Biphenyls:	False
Base, Neutral, and Acid Extractables:	False
Phenols :	False
Radionuclides Over Max Contaminant Levels:	False
Sources Not In Other Categories:	False
Underground Storage Tanks:	False
Pits, Ponds, and Lagoons:	True
Spills and Leaks:	True
Landfills:	False
Aboveground Storage Tank:	False
Spray Irrigation:	False
Single-Event Spill :	False
Unpermitted Disposal :	False
Septic Tank/Tile Field:	False

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Database(s)  
 EDR ID Number  
 EPA ID Number

**CLEARWATER FINISHING SITE (Continued)**

1000156559

Substances Not In Other Categories: False  
 Sources of Contamination Undetermined: True  
 Assessment: Yes  
 Monitoring: No  
 Remediation: No  
 Drinking Water Well Impact: No  
 Remarks: In assessment phase.

15  
 West  
 1/2-1  
 4626 ft.

**MAJIK MARKET 34062  
 US 1 & PARKER ST  
 CLEARWATER, SC 29822**

**GWCI U003523357  
 UST N/A**

Relative:  
 Higher

**SC GWIC:**

Contamination: PETRO  
 Permit Number: 00140  
 EAP ID: Not reported  
 WPC Permit: Not reported  
 Surface Impact: No  
 Source: UST  
 Bureau: Bureau of Land and Waste Management  
 Solid Waste Permit #: Not reported  
 Bureau of Land and Waste Management file #: Not reported  
 Program: DUST  
 Petroleum Products: True  
 Volatile Organic Compounds: False  
 Metals: False  
 Nitrates or Potential to Nitrate: False  
 Pesticides and Herbicides: False  
 Polychlorinated Biphenyls: False  
 Base, Neutral, and Acid Extractables: False  
 Phenols : False  
 Radionuclides Over Max Contaminant Levels: False  
 Sources Not In Other Categories: False  
 Underground Storage Tanks: True  
 Pits, Ponds, and Lagoons: False  
 Spills and Leaks: False  
 Landfills: False  
 Aboveground Storage Tank: False  
 Spray Irrigation: False  
 Single-Event Spill : False  
 Unpermitted Disposal : False  
 Septic Tank/Tile Field: False  
 Substances Not In Other Categories: False  
 Sources of Contamination Undetermined: False  
 Assessment: No  
 Monitoring: No  
 Remediation: Yes  
 Drinking Water Well Impact: No  
 Remarks: Site ID # 00140. RBCA Classification 2BB7. Approved Monitored Natural Attenuation (MNA Awaiting Funding)

**UST:**

Facility ID:	140	Tank ID:	1
Contact:	W MCFARLIN	Contact Tel:	Not reported
Capacity:	8000	Calcage:	15
Product:	Gasoline		
Status:	Abandoned		
Owner:	MUNFORD INC		

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

Database(s) EDR ID Number  
 EPA ID Number

**MAJIK MARKET 34062 (Continued)**

U003523357

Owner Contact: W MCFARLIN  
 Owner Address: PO BOX 607487

ORLANDO, FL 32860

Owner Phone: - -

Facility ID: 140  
 Contact: W MCFARLIN  
 Capacity: 8000  
 Product: Gasoline  
 Status: Abandoned  
 Owner: MUNFORD INC  
 Owner Contact: W MCFARLIN  
 Owner Address: PO BOX 607487

Tank ID: 2  
 Contact Tel: Not reported  
 Calcage: 15

ORLANDO, FL 32860

Owner Phone: - -

Facility ID: 140  
 Contact: W MCFARLIN  
 Capacity: 8000  
 Product: Gasoline  
 Status: Abandoned  
 Owner: MUNFORD INC  
 Owner Contact: W MCFARLIN  
 Owner Address: PO BOX 607487

Tank ID: 3  
 Contact Tel: Not reported  
 Calcage: 15

ORLANDO, FL 32860

Owner Phone: - -

G16  
 WNW  
 1/2-1  
 4635 ft.

**FIRST STOP CLEARWATER**  
 4368 JEFFERSON DAVIS HWY  
 NORTH AUGUSTA, SC 29822

GWCI U003878339  
 UST N/A

**Site 2 of 3 in cluster G**

Relative:  
 Higher

SC GWIC:  
 Contamination: PETRO  
 Permit Number: 00114  
 EAP ID: Not reported  
 WPC Permit: Not reported  
 Surface Impact: No  
 Source: UST  
 Bureau: Bureau of Land and Waste Management  
 Solid Waste Permit #: Not reported  
 Bureau of Land and Waste Management file #: Not reported  
 Program: DUST  
 Petroleum Products: True  
 Volatile Organic Compounds: False  
 Metals: False  
 Nitrates or Potential to Nitrate: False  
 Pesticides and Herbicides: False  
 Polychlorinated Biphenyls: False  
 Base, Neutral, and Acid Extractables: False  
 Phenols: False  
 Radionuclides Over Max Contaminant Levels: False  
 Sources Not In Other Categories: False  
 Underground Storage Tanks: True  
 Pits, Ponds, and Lagoons: False

Actual:  
 243 ft.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**FIRST STOP CLEARWATER (Continued)**

**U003878339**

Spills and Leaks: False  
 Landfills: False  
 Aboveground Storage Tank: False  
 Spray Irrigation: False  
 Single-Event Spill : False  
 Unpermitted Disposal : False  
 Septic Tank/Tile Field: False  
 Substances Not In Other Categories: False  
 Sources of Contamination Undetermined: False  
 Assessment: No  
 Monitoring: No  
 Remediation: Yes  
 Drinking Water Well Impact: No  
 Remarks: Site ID # 00114. RBCA Classification 2BB7. Approved Monitored Natural Attenuation (MNA Awaiting Funding)

**UST:**

Facility ID:	114	Tank ID:	1
Contact:	Not reported	Contact Tel:	Not reported
Capacity:	5000	Calcage:	15
Product:	Gasoline		
Status:	Abandoned		
Owner:	YOGI INVESTMENT LLC		
Owner Contact:	Not reported		
Owner Address:	11101 QUEARY CT		

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID:	114	Tank ID:	2
Contact:	Not reported	Contact Tel:	Not reported
Capacity:	6000	Calcage:	15
Product:	Gasoline		
Status:	Abandoned		
Owner:	YOGI INVESTMENT LLC		
Owner Contact:	Not reported		
Owner Address:	11101 QUEARY CT		

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID:	114	Tank ID:	3
Contact:	Not reported	Contact Tel:	Not reported
Capacity:	8000	Calcage:	15
Product:	Gasoline		
Status:	Abandoned		
Owner:	YOGI INVESTMENT LLC		
Owner Contact:	Not reported		
Owner Address:	11101 QUEARY CT		

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID:	114	Tank ID:	4
Contact:	Not reported	Contact Tel:	Not reported
Capacity:	12000	Calcage:	15
Product:	Gasoline		
Status:	Abandoned		

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

Database(s)    EDR ID Number  
 EPA ID Number

**FIRST STOP CLEARWATER (Continued)**

**U003878339**

Owner: YOGI INVESTMENT LLC  
 Owner Contact: Not reported  
 Owner Address: 11101 QUEARY CT

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID: 114	Tank ID: 5
Contact: Not reported	Contact Tel: Not reported
Capacity: 8000	Calcage: 15
Product: Diesel	
Status: Abandoned	
Owner: YOGI INVESTMENT LLC	
Owner Contact: Not reported	
Owner Address: 11101 QUEARY CT	

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID: 114	Tank ID: 6
Contact: Not reported	Contact Tel: Not reported
Capacity: 12000	Calcage: 0
Product: Gasoline	
Status: Currently in use	
Owner: YOGI INVESTMENT LLC	
Owner Contact: Not reported	
Owner Address: 11101 QUEARY CT	

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID: 114	Tank ID: 7
Contact: Not reported	Contact Tel: Not reported
Capacity: 8000	Calcage: 0
Product: Gasoline	
Status: Currently in use	
Owner: YOGI INVESTMENT LLC	
Owner Contact: Not reported	
Owner Address: 11101 QUEARY CT	

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

Facility ID: 114	Tank ID: 8
Contact: Not reported	Contact Tel: Not reported
Capacity: 8000	Calcage: 0
Product: Diesel	
Status: Currently in use	
Owner: YOGI INVESTMENT LLC	
Owner Contact: Not reported	
Owner Address: 11101 QUEARY CT	

CHARLOTTE, NC 28277  
 Owner Phone: 704-542-0369

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

Database(s)    EDR ID Number  
 EPA ID Number

**G17**            **SUNOCO 0616-1111/COOP2669**  
**WNW**        **4368 JEFFERSON DAVIS HWY**  
**1/2-1**        **NORTH AUGUSTA, SC 29822**  
**4635 ft.**

**FINDS**    **1007233585**  
**LUST**     **110017049166**

**Site 3 of 3 in cluster G**

**Relative:**  
**Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site:  
 SC-EFIS

**Actual:**  
**243 ft.**

**LUST:**

Facility ID:        114 Report Date:      12/29/89 Owner:              YOGI INVESTMENT LLC NFA Date:          1/29/2004 Date Confirmed:   05/04/90 Facility Status:    Approved Substance:         PETRO	Proj Manager:    SURBERJD Num Of Releases 1  Rank:              2BB
Facility ID:        114 Report Date:      12/14/93 Owner:              YOGI INVESTMENT LLC NFA Date:          12/8/1997 Date Confirmed:   08/23/94 Facility Status:    Currently inactive Substance:         PETRO	Proj Manager:    WILSONRL Num Of Releases 2  Rank:              2BB

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
AIKEN	1004780552	BP OIL-SITE #23776	RTE 4 BOX 436 & HIGHWAY 1	29841	RCRA-SQG, FINDS
BEECH ISLAND	S105528139	KIMBERLY CLARK CORP	ON CO RD 5 S OF THE INT OF SC	29842	SHWS
BEECH ISLAND	1003868470	SIMKINS FARM SITE	JCT S R 65 & S R 125	29842	CERC-NFRAP
BELVEDERE	1007245297	BELVEDERE AMOCO	501 CLEARWATER RD	29841	FINDS, LUST
BELVEDERE	S105621437	BELVEDERE CLEANERS	502 CLEARWATER RD	29841	SHWS, DRYCLEANERS
BELVEDERE	U003878576	BELVEDERE AMOCO	501 CLEARWATER RD	29841	GWCI, UST
GRANITEVILLE	U003522611	J M HUBER CORPORATION	SR 104	29829	UST
GRANITEVILLE	1007230732	AVONDALE MILLS INC	PO BOX 128	29829	FINDS
GRANITEVILLE	S105528089	GRANITEVILLE COMPANY/TOWNSEND DIV.	BREEZY HILL ROAD	29829	SHWS
GRANITEVILLE	1003869661	GRANITEVILLE CEMETERY DUMP	2000'S. OF GREGG HWY & 2700' E OF RT 191	29829	SHWS, CERC-NFRAP
GRANITEVILLE	1004594078	JM HUBER GRANITEVILLE OPR	SC HWY 104	29829	RCRA-SQG, FINDS
GRANITEVILLE	1005424876	AVONDALE MILLS INC - WOODHEAD	387 LEITNER ST	29829	SSTS
GRANITEVILLE	1005505899	AVONDALE MILLS INCORPORATED GREGG	168 MARSHALL ST.	29829	FINDS
GRANITEVILLE	S105528087	GRANITEVILLE COLAGOON	.5 MI FROM GREG RD ON FAULKNER	29829	SHWS
GRANITEVILLE	1004593501	AVONDALE MILLS INCORPORATED WATER PLANT	153 OLD GRANITEVILLE HWY.	29829	FINDS
N AUGUSTA	1004780548	BP OIL-SITE #48786	1849 GEORGIA AVENUE & HWY 25	29841	RCRA-SQG
N AUGUSTA	1007115477	HALOCARBON PRODUCTS CORPORATION	US HWY 1 & REVCO DR	29841	UST
N AUGUSTA	U003521997	GULF SERVICE STATION 265603	359 JEFFERSON DAVIS RD	29841	RCRA-SQG, FINDS
N AUGUSTA	1001216114	VIKING FREIGHT N AUGUSTA	1045 JEFFERSON DAVIS HWY	29841	FINDS, LUST
N AUGUSTA	1007233550	GULF SERVICE STATION 265603	359 JEFFERSON DAVIS RD	29841	UST
N AUGUSTA	U003878957	MURPHY USA 6900	1211 KNOX AVE HWY 25 BYPASS	29841	UST
N AUGUSTA	U003521511	FOX CANDY CO	OLD EDGEFIELD RD	29841	UST
N AUGUSTA	1001405311	AIKEN AUGUSTA AUTO BODY	5183 AUGUSTA ROAD NORTH	29841	RCRA-SQG, FINDS
NORTH AUGUSTA	U003524501	R L MCKIE & SONS	ROUTE 1 BOX 63	29841	UST
NORTH AUGUSTA	1003868491	ALLEN, EARL CHEMICAL SITE	US 1, 1/2 MI NE OF SAVANNAH RV	29841	SHWS, CERC-NFRAP
NORTH AUGUSTA	U003878551	FORMER CHEVRON FOOD MART	I 20 & MARTINTOWN RD	29841	GWCI, UST
NORTH AUGUSTA	1007239721	INTERSTATE-N AUGUSTA	HWY 25 BY PASS	29841	FINDS, LUST
NORTH AUGUSTA	U003878625	INTERSTATE-N AUGUSTA	HWY 25 BY PASS	29841	GWCI, UST
NORTH AUGUSTA	1004780590	HORSE CREEK WASTEWATER PLANT	US 278/SC 125 SOUTH OF US 1	29841	RCRA-SQG, FINDS
NORTH AUGUSTA	A100267670	PHILLIPS PIPELINE - SWEETWATER	HWY 36 & SWEETWATER ROAD	29841	AST
NORTH AUGUSTA	U003632695	KINDER MORGAN SOUTHEAST TERMINALS LLC N AUGUSTA	HWY 36 & SWEETWATER RD	29841	UST
NORTH AUGUSTA	1004780165	SILVERSTEINS CLEANERS	NORTH AUGUSTA PLAZA	29841	RCRA-SQG, FINDS
NORTH AUGUSTA	U003878567	EASY STOP	527 CLEARWATER RD	29841	UST
NORTH AUGUSTA	S105811273	344 GEORGIA AVENUE	344 GEORGIA AVENUE	29841	SHWS
NORTH AUGUSTA	1004780198	NORTH AUGUSTA MIDDLE SCHOOL	725 OLD ENGLISH RD	29841	RCRA-SQG, FINDS
NORTH AUGUSTA	1003868478	NORTH AUGUSTA CITY DUMP	WOMRATH	29841	SHWS, CERC-NFRAP
WARRENVILLE	S105860818	SC ARMY NATIONAL GUARD CO C 122 ENG BN	HWY 144	29851	LUST

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	MapDir/Dist	City	State	Databases
29829	U003522611	191	J M HUBER CORPORATION	SR 104	**	GRANITEVILLE	SC	UST
29829	1005792554	110002309911	BROWN S TIRE SERVICE	RT 2 BOX 168 B	**	GRANITEVILLE	SC	GWCI, CERCLIS, NPL
29829	1000207082	SCD058753971	HELENA CHEMICAL CO. LANDFILL	HWY 321 S	**	FAIRFAX	SC	ENG CONTROLS, ROD
29829	1007243960	110017157486	PO BOYS CONV STORE	210A AIKEN RD	**	GRANITEVILLE	SC	FINDS, LUST
29829	U003878609	149	PO BOYS CONV STORE	210A AIKEN RD	**	GRANITEVILLE	SC	UST
29829	1007230010	110017012365	BREEZYHILL CURB MKT	245 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	FINDS
29829	U003878862	178	BREEZYHILL CURB MKT	245 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	UST
29829	1004593810	110001664663	AVONDALE MILLS SWINT	358 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	FINDS
29829	U003414001	SCD980309769	AVONDALE MILLS: TOWNSEND	418 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	CERCLIS-NFRAP
29829	1004594508	11001664672	AVONDALE MILLS: TOWNSEND	418 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	FINDS
29829	1007236709	110017081726	FOUR SEASONS FOOD & FUEL 3	550 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	UST
29829	U003665519	15339	FOUR SEASONS FOOD & FUEL 3	550 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	FINDS
29829	U003600063	110001992719	SATTERFIELD CONST CO INC:GRANITEVI	822 ASCAUGA LAKE ROAD	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1004780792	110002310124	MARTIN MARIETTA AIKEN QUARRY	826 ASCAUGA LAKE RD	**	GRANITEVILLE	SC	FINDS
29829	1004592791	110900355464	AVONDALE MILLS INCORPORATED WARF	1124 AUGUSTA RD.	**	GRANITEVILLE	SC	SPILLS
29829	S106044473		AVONDALE MILLS	AVONDALE MILLS	**	GRANITEVILLE	SC	FINDS
29829	1007241375	110017130512	HILL S CONSTRUCTION	133 BETTIS ACADEMY RD	**	GRANITEVILLE	SC	FINDS
29829	1004593391	110000355473	AVONDALE MILLS GRANITEVILLE FABRIC	184 BETTIS ACADEMY RD.	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1004780860	110002257593	SCARNG GRANITEVILLE	365 BETTIS ACADEMY RD	**	GRANITEVILLE	SC	FINDS
29829	1007259474	110017325296	KENTS KORNER 24	651 BETTIS ACADEMEY RD	**	GRANITEVILLE	SC	FINDS
29829	U003853746	18826	KENTS KORNER 24	651 BETTIS ACADEMEY RD	**	GRANITEVILLE	SC	UST
29829	1007230732	110017020016	AVONDALE MILLS INC	PO BOX 128	**	GRANITEVILLE	SC	FINDS
29829	1007248575	110017205237	GRANITEVILLE COMPANY	PO BOX 128	**	GRANITEVILLE	SC	FINDS
29829	1007248501	110017204452	MIKE WILLIAMS CONSTRUCTION LLC	PO BOX 157	**	GRANITEVILLE	SC	FINDS
29829	1007237028	110017085018	MCKIE SAND AND GRAVEL	PO BOX 214	**	GRANITEVILLE	SC	FINDS
29829	1007230434	110017016860	BREEZY HILL WATER & SEWER COMPAN'	PO BOX 66	**	GRANITEVILLE	SC	FINDS
29829	1007246609	110017184982	AIKEN AUGUSTA SAND & GRAVEL	PO BOX 97	**	GRANITEVILLE	SC	FINDS
29829	S105528019		GRANITEVILLE COMPANY/TOWNSEND DI'	BREEZY HILL ROAD	**	GRANITEVILLE	SC	SHWS
29829	1004781125	110001673564	BRIDGESTONE FIRESTONE SC CO	1 BRIDGESTONE PKWY	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1007446195	29829BRDGS-1B	BRIDGESTONE FIRESTONE SOUTH CARC	1 BRIDGESTONE PKY.	**	GRANITEVILLE	SC	TRIS
29829	1004780196	110002199399	LEAVELLE MCCAMPBELL MIDDLE SCHOC	82 CANAL ST	**	GRANITEVILLE	SC	FINDS
29829	1007235102	110017065067	DWAIN MAYER	99 CANAL ST	**	GRANITEVILLE	SC	FINDS
29829	1005532529	110006893417	DIXIE CLAY COIPARDUE PIT	383 CHURCHED ROAD	**	GRANITEVILLE	SC	FINDS
29829	1007235564	110017069928	MICHELLE SAWYER	90 CHURCH ST	**	GRANITEVILLE	SC	FINDS
29829	1006382953	110017843413	HUBER, JIM:GRANITEVILLE-CLOSED	COUNTY ROADS 779 & 104	**	GRANITEVILLE	SC	FINDS
29829	1007241250	110017129212	HOME OWNER	302 ERGLE ST	**	GRANITEVILLE	SC	FINDS
29829	1007230028	110017012542	GOLDEN PANTRY 30	333 ERGLE ST	**	GRANITEVILLE	SC	FINDS
29829	U003970076	184	QUICK PANTRY	333 ERGLE ST	**	GRANITEVILLE	SC	LUST, UST
29829	1004780414	110907835931	R & H MAXXON DEPOT FOOD STORE 120	403 GEORGIA AVENUE	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1004594544	110008560969	GRANITEVILLE CO/WARRENVILLE	GRANITEVILLE CO	**	GRANITEVILLE	SC	FINDS
29829	1003689661	SCD987597440	GRANITEVILLE CEMETARY DUMP	2000'S OF GREGG HWY/2700'E RT.	**	GRANITEVILLE	SC	FINDS
29829	1005447554	29829VNDLML14	AVONDALE MILLS INC.-STEVENS STEAM	142 HARD ST	**	GRANITEVILLE	SC	TRIS
29829	U003525796	253	TAYLORS GULF	147 HICKMAN ST	**	GRANITEVILLE	SC	LUST, UST
29829	U003624038	13793	TAYLORS BP	147 HICKMAN ST	**	GRANITEVILLE	SC	FINDS
29829	1007236986	110017084572	TAYLORS GULF	147 HICKMAN STREET	**	GRANITEVILLE	SC	AST, FINDS
29829	1005816774	110006358672	AVONDALE MILLS	3 HICKMAN STREET	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1004594078	110007904349	JM HUBER GRANITEVILLE OPR	SC HWY 104	**	GRANITEVILLE	SC	TRIS
29829	1005447553	29829SKFTM10	SKF AUTOMOTIVE DIV	1084 INTERNATIONAL PL.	**	GRANITEVILLE	SC	RCAInfo-SQG, FINDS
29829	1004781090	110602184911	COMMUNITY SERVICES INC	JACKSON AT FAULKNER ST	**	GRANITEVILLE	SC	FINDS
29829	1007248000	110017199379	COMMUNITY SERVICES INC	JACKSON AT FAULKNER ST	**	GRANITEVILLE	SC	UST
29829	U003520440	13086	CURGINS CORNER	3446 JEFFERSON DAVIS HWY	**	GRANITEVILLE	SC	UST
29829	1007244860	110017166895	CURGINS CORNER	387 LEITNER ST	**	GRANITEVILLE	SC	FINDS
29829	U003943120	19004	AVONDALE MILLS INC. - WOODHEAD	387 LEITNER ST	**	GRANITEVILLE	SC	SSTS
29829	1005424876	110000355491	AVONDALE MILLS INCORPORATED WOOD	387 LEITNER ST.	**	GRANITEVILLE	SC	FINDS, LUST
29829	1004592817	110017171905	SPRADLEY TEXACO	202 MAIN ST	**	GRANITEVILLE	SC	UST
29829	U003678474	129	SPRADLEY TEXACO	202 MAIN ST	**	GRANITEVILLE	SC	FINDS
29829	1007231831	110017031219	DALES	208 MAIN ST	**	GRANITEVILLE	SC	FINDS
29829	U003624310	17403	DALES	208 MAIN ST	**	GRANITEVILLE	SC	FINDS
29829	1007245344	110017171950	PANTRY 542	MAIN ST	**	GRANITEVILLE	SC	FINDS
29829	U003878411	122	PANTRY 542	MAIN ST	**	GRANITEVILLE	SC	FINDS
29829	100717041413	110017041413	GRANITEVILLE COMPANY	1 MARSHALL ST	**	GRANITEVILLE	SC	LUST
29829	S106665916	11387	GRANITEVILLE COMPANY	1 MARSHALL ST	**	GRANITEVILLE	SC	CERCLIS, RCAInfo-LQG,
29829	1000316346	110002311070	AVONDALE MILLS INCORPORATED	133 MARSHALL STREET	**	GRANITEVILLE	SC	FINDS, TRIS, UST
29829	1005505899	110000355482	AVONDALE MILLS INCORPORATED GREG	168 MARSHALL ST.	**	GRANITEVILLE	SC	FINDS
29829	1007236989	110017084616	GRANITEVILLE COMPANY	MARSHALL & LEITNER ST	**	GRANITEVILLE	SC	UST
29829	U001536625	247	GRANITEVILLE COMPANY	MARSHALL & LEITNER ST	**	GRANITEVILLE	SC	FINDS

\*\* - Indicates location may or may not be in requested radius. Site has not been assigned a latitude/longitude coordinate. Further review recommended.

F. NE. 1/2 - 1

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29829	1007236990	110017084625	GRANITEVILLE COMPANY	MARSHALL ST & CANAL ST		GRANITEVILLE	SC	FINDS
29829	1003521862	246	GRANITEVILLE COMPANY	MARSHALL ST & CANAL ST		GRANITEVILLE	SC	UST
29829	1007236991	110017084634	GRANITEVILLE COMPANY	MARSHALL ST & NEWTON RD		AIKEN	SC	FINDS
29829	1003970080	65	GRANITEVILLE COMPANY	MARSHALL ST & NEWTON RD		AIKEN	SC	UST
29829	1003975366	245	GRANITEVILLE COMPANY	MARSHALL ST & NEWTON RD		AIKEN	SC	UST
29829	S106528087		GRANITEVILLE COLLAGOON	.5 MI FROM GREG RID ON FAULKNER		GRANITEVILLE	SC	SHWS
29829	1004593501	110001128538	AVONDALE MILLS INCORPORATED	153 OLD GRANITEVILLE HWY.		GRANITEVILLE	SC	FINDS
29829	1005429946	110001172261	Q&O CONSTRUCTION	212 OLD CHEROKEE RD		GRANITEVILLE	SC	FINDS
29829	1007242755		GRANITEVILLE COMPANY: GREGG DIVISI	ONE MARSHALL ST.		GRANITEVILLE	SC	SSTS
29829	1007242755		HOME OWNER	201 RAILROAD ST		GRANITEVILLE	SC	FINDS
29829	1007228236	110016994074	APAC COMPOSTING SITE	501 RAINBOW FALLS RD		GRANITEVILLE	SC	FINDS
29829	1007333268	110017045954	GL WILLIAMS AND DAUGHTER	501 RAINBOW FALLS RD		GRANITEVILLE	SC	FINDS
29829	1007245216	110017170648	G L WILLIAMS & SON TRUCKING	501 RAINBOW FALLS RD		GRANITEVILLE	SC	FINDS
29829	1005792409	110002311490	GL WILLIAMS LANDSCAPING INCORPORA	581 RAINBOW FALLS RD		GRANITEVILLE	SC	FINDS
29829	1007246361	110017202399	WILLIAMS SAND & GRAVEL COMPANY	RAINBOW FALLS RD		GRANITEVILLE	SC	FINDS
29829	1004593756	110007184322	MARTIN MAR-GRANITVL	413 SEASTRUNK ST		GRANITEVILLE	SC	ERNS
29829	2002598254		HARDWAY:PLANT #1	413 SEASTRUNK ST		GRANITEVILLE	SC	FINDS
29829	1006724517	110010363409	HARDWAY:PLANT #188	SPRINGDALE RD@BETTIS ACADMY RD		GRANITEVILLE	SC	FINDS
29829	1004593549	110010575056	R L MCKIE & SONS	ROUTE 1 BOX 63		NORTH AUGUSTA	SC	UST
29841	1003524501	10947	ABF FREIGHT SYSTEM	HWY 125		N AUGUSTA	SC	LUST, UST
29841	1003518832	68	ABF FREIGHT SYSTEM	HWY 125 PO BOX 6067		N AUGUSTA	SC	FINDS
29841	1007260165	110017332475	FLOYD & BEASLEY TRANS CO INC	120 & US 25 FRONTAGE RD		N AUGUSTA	SC	FINDS
29841	1007260164	72	FLOYD & BEASLEY TRANS CO INC	120 & US 25 FRONTAGE RD		N AUGUSTA	SC	UST
29841	0001536609	11407	PANTRY 3256 DBA DEPOT	HWY 25 / 120		N AUGUSTA	SC	LUST, UST
29841	0003665513	110017041814	MILNER ETHANOL TERMINAL	HWY 25 & SWEETWATER CH RD		N AUGUSTA	SC	FINDS
29841	1007232862	110017049148	SHOP & GAS 2	HWY 25 AT JOHNSON RD		N AUGUSTA	SC	FINDS
29841	1007233583	110017043206	INTERSTATE-N AUGUSTA	HWY 25 BY PASS		N AUGUSTA	SC	FINDS
29841	1007232997	110017113103	HOPE CREEK WASTE WATER PLANT	HWY 25 BY PASS		N AUGUSTA	SC	FINDS
29841	1007378925	173	BP EXPLORATION & OIL (SWEETWATER)	US 278/SC 125 SOUTH OF US 1		NORTH AUGUSTA	SC	FINDS, LUST
29841	1004780590	110007836734	KINDER MORGAN SOUTHEAST TERMINAL	HIGHWAY 36 - SWEETWATER JUNCTN		NORTH AUGUSTA	SC	GWCI, UST
29841	1004594510	110007244102	PHILLIPS PIPELINE - SWEETWATER	HWY 36 & SWEETWATER RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1003632695	3093	BP OIL CO SWEETWATER TERMINAL	SR 36		NORTH AUGUSTA	SC	FINDS
29841	A100267670	672	BP OIL CO SWEETWATER TERMINAL	SR 36		NORTH AUGUSTA	SC	UST
29841	1004780552	110007836556	MAGNOLIA TRAILER PARK	RT 6 BOX 436 & HIGHWAY 1		AIKEN	SC	LUST, UST
29841	1005791261	110002187231	BELVEDERE CAR WASH	ADAMS BROS 522 EDGEFIELD RD		BELVEDERE	SC	FINDS
29841	1005791128	110002188691	DON S COLLISION CENTER	5950 AIKEN-AUGUSTA HWY		N AUGUSTA	SC	FINDS
29841	1007235500	110017069232	BUILDERS TRANSPORT INC	1915 ASCAUGA LAKE RD		NORTH AUGUSTA	SC	UST
29841	0003519644	220	BUILDERS TRANSPORT INCORPORATED	1025 ATOMIC RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	10002199460	110017163193	CON WAY SOUTHERN EXPRESS	1025 ATOMIC RD		NORTH AUGUSTA	SC	FINDS, LUST
29841	1007344504	110017163193	CON WAY SOUTHERN EXPRESS	1025 ATOMIC RD		NORTH AUGUSTA	SC	UST
29841	0003520442	241	NORTHSIDE CHRISTIAN SCHOOL	1032 ATOMIC RD		NORTH AUGUSTA	SC	FINDS
29841	1004895251	110011848778	BOWMAN TRANSPORTATION CO INCORP	1337 ATOMIC RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1000295195	110002258011	AUGUSTA AIR BRAKE & RAILCAR PARTS I	1294 ATOMIC ROAD		NORTH AUGUSTA	SC	FINDS
29841	1000575984	110002257977	COOPERHEAT-MQS INC	1956 ATOMIC RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007235318	110017067332	BEECH ISLAND SECTION SHED	1980 ATOMIC RD		NORTH AUGUSTA	SC	FINDS
29841	1007240370	110017120006	GAS PLUS 7	525 ATOMIC RD		BEECH ISLAND	SC	FINDS
29841	1007226849	110016979894	E Z SERVE 8606	525 ATOMIC RD		NORTH AUGUSTA	SC	FINDS
29841	1007243961	110017157495	E Z SERVE 8606	525 ATOMIC RD		NORTH AUGUSTA	SC	GWCI, UST
29841	0003632044	148	GAS PLUS 7	525 ATOMIC RD		NORTH AUGUSTA	SC	FINDS, LUST
29841	10039590442	16640	CIRCLE K 2705340	602 ATOMIC RD		N AUGUSTA	SC	FINDS, LUST
29841	1007243500	110017152748	CIRCLE K 2705340	602 ATOMIC RD		N AUGUSTA	SC	UST
29841	0003665501	79	ARA SERVICES	616 ATOMIC RD		N AUGUSTA	SC	FINDS
29841	1007256617	9497	ARA SERVICES	616 ATOMIC RD		N AUGUSTA	SC	FINDS
29841	0003519032	110017295504	GROOMERS PAINT & BODY SHOP	701 ATOMIC RD		N AUGUSTA	SC	UST
29841	1000449224	110002257922	RAYMONDS PAINT & BODY	915 ATOMIC RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	100049224	110002257762	COWART CABINETS INCORPORATED	917 ATOMIC RD		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1000156170	110002258091	MUNDY CONST/MUNDY BORROW PIT	ATOMIC ROAD		BEECH ISLAND	SC	FINDS
29841	1005532514	110009811711	SCERG-NORTH AUGUSTA	ATTN: MR ROBERT ABERNATHY		BEECH ISLAND	SC	FINDS
29841	1006665917	110007016521	KIMBERLY-CLARK CORPORATION	5183 AUGUSTA ROAD, NORTH		BEECH ISLAND	SC	FINDS
29841	1007146912	110017116912	AIKEN AUGUSTA AUTO BODY	N AUGUSTA IND PARK		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007240082	110003199371	UCB CHEMICALS :CORP	1201 WEST AVE		NORTH AUGUSTA	SC	FINDS
29841	1006250805	110010496294	SILVERSTEINS CLEANERS	309 WEST AVE		NORTH AUGUSTA	SC	FINDS
29841	1004780165	110007833004	N AUGUSTA URGENT CARE & FAMILY ME	504 WEST AVE		NORTH AUGUSTA	SC	FINDS
29841	1007257668	110017306440	JOHN BUTLER DMD	815 W AVE		NORTH AUGUSTA	SC	FINDS
29841	1007256777	110017297138	FAMILY PHYSICIANS OF NORTH AUGUST.			NORTH AUGUSTA	SC	FINDS
29841	1007130732	110017307332	RON E BRYANT DDS			NORTH AUGUSTA	SC	FINDS
29841	1007240009	110017116128	DAVID A OWINGS DMD			NORTH AUGUSTA	SC	FINDS
29841	1007238112	110017096435				NORTH AUGUSTA	SC	FINDS

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29841	1007244621	110002178982	BEECH ISLAND WATER DISTRICT	480 BEECH ISLAND AVENUE	..	BEECH ISLAND	SC	FINDS
29841	1005864813	110008562368	BEECHWOOD SD	BEECH ISL RURAL COMM WTR DIST	..	BEECH ISLAND	SC	FINDS
29841	1000162844	SCD042971069	KIMBERLY CLARK CORP	BEECH ISLAND MILL	..	BEECH ISLAND	SC	RCRAInfo-LQG, CERCLIS-NFRAP
29841	1005532471	110009701518	DAVIS AGGREGATE/CLEARWATER MIN	BELVEDERE CLEARWATER ROAD	..	BELVEDERE	SC	FINDS
29841	1000875715	110000954139	C&S FABRICATORS AND ERECTORS INC	430 BERGEN ROAD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007258551	110017315868	HOME OWNERS	121 BEVERLY CIRLCE	..	N AUGUSTA	SC	FINDS
29841	1006931486	SCR000764894	TOTU TRUCKING	466 BLANCHARD RD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG
29841	1007087147	110015665786	GOLD MASTERS	466 BLANCHARD RD	..	BELVEDERE	SC	FINDS
29841	1004779818	110002199503	GURLEY S SUNSHINE CENTER	PO BOX 213	..	BEECH ISLAND	SC	RCRAInfo-SQG, FINDS
29841	100724404	110016954562	NORTH AUGUSTA INTERIM FACILITY	PO BOX 6177	..	NORTH AUGUSTA	SC	FINDS
29841	1007237094	110017085759	OVERNITE TRANSPORT	PO BOX 6220	..	NORTH AUGUSTA	SC	FINDS
29841	1007228179	110016992968	N AUGUSTA/BELVEDERE TERRACE SD	PO BOX 6400	..	NORTH AUGUSTA	SC	FINDS
29841	1007233143	110017044679	NORTH AUGUSTA CITY OF	PO BOX 6400	..	N AUGUSTA	SC	FINDS
29841	1007237181	110017086801	BP PRODUCTS NORTH AMERICA INC	PO BOX 6427	..	N AUGUSTA	SC	FINDS
29841	1007246009	110017199388	INTERSTATE MOBILE TRUCK & TIRE	PO BOX 7947	..	N AUGUSTA	SC	FINDS
29841	1007241414	110002182441	ALLTEL	555 BRADLET DRIVE	..	N AUGUSTA	SC	FINDS
29841	1005791561	110002182441	CLEAN HARBORS ENVIRONMENTAL SER'	400 E BUENA VISTA AVE	..	N AUGUSTA	SC	LUST, UST
29841	1000477364	13087	CLEAN HARBORS ENVIRONMENTAL SER'	400 E BUENA VISTA AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1007081568	110015587514	YE OLDE GROCERY	628 E BUENA VISTA AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1007242169	110017138827	BRYANTS 201	628 E BUENA VISTA AVE	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	1007246014	110017178846	FRIENDLY GROCERY	628 E BUENA VISTA AVE	..	NORTH AUGUSTA	SC	GWCI, UST
29841	1003586931	9967	FRIENDLY GROCERY	825 E BUENA VISTA AVE	..	N AUGUSTA	SC	FINDS
29841	1007246219	110017180922	FOUR SEASONS FOOD & FUEL STORE 11	812 CHURCH ST	..	WILLISTON	SC	UST
29841	U0039300771	12130	BELVEDERE AMOCO	501 CLEARWATER RD	..	BELVEDERE	SC	FINDS, LUST
29841	10073930479	17050	BELVEDERE AMOCO	501 CLEARWATER RD	..	BELVEDERE	SC	GWCI, UST
29841	1007245297	110017171479	BELVEDERE CLEANERS	502 CLEARWATER RD	..	BELVEDERE	SC	SHWS, DRYCLEANERS
29841	U003878576	145	CHANG WON YI	527 CLEARWATER RD	..	BELVEDERE	SC	FINDS
29841	1007243654	110017154318	EASY STOP	527 CLEARWATER RD	..	N AUGUSTA	SC	FINDS
29841	1007245298	110017171488	EASY STOP	527 CLEARWATER RD	..	NORTH AUGUSTA	SC	UST
29841	U003878567	144	BEECH ISLAND DRUM SITE	302 DICKS DRIVE	..	N AUGUSTA	SC	SHWS
29841	1007246365	110017203042	UCB CHEMICALS CORPORATION BIOPRO	1024 DITTMAN COURT	..	N AUGUSTA	SC	FINDS, TRIS
29841	964971110	29841	1100 DITTMAN CORP	1100 DITTMAN CORP	..	NORTH AUGUSTA	SC	ERNS
29841	1003327779	29841	HALOCARBON PRODUCTS CORPORATION	1100 DITTMAN COURT	..	NORTH AUGUSTA	SC	ERNS
29841	1005929042	29841	HALOCARBON PROD CORP	1100 DITTMAN CT	..	NORTH AUGUSTA	SC	ERNS
29841	94381630	29841	1100 DITTMAN CT	1100 DITTMAN CT	..	N AUGUSTA	SC	ERNS
29841	92286566	29841	1100 DITTMAN CT N. AUGUSTA INDUSTR	1100 DITTMAN CT N. AUGUSTA INDUSTR	..	N AUGUSTA	SC	ERNS
29841	1005929043	29841	ITHACA INDUSTRIES-CLOSED	120 DITTMAN CT	..	NORTH AUGUSTA	SC	TSCA
29841	1004593093	110007025263	PUMP N SHOP	DITTMAN CRT (S2-1753)	..	NORTH AUGUSTA	SC	ERNS
29841	1007232624	110017039300	SWEETWATER BP	1014 EDGEFIELD RD	..	N AUGUSTA	SC	FINDS
29841	U003524354	177017198646	SWEETWATER BP	1014 EDGEFIELD RD	..	N AUGUSTA	SC	FINDS
29841	1007247937	11614	SWEETWATER BP	1015 EDGEFIELD RD	..	N AUGUSTA	SC	FINDS, UST
29841	U003623746	11614	SOUTHEASTERN FREIGHT LINES	1015 EDGEFIELD RD	..	N AUGUSTA	SC	LUST, UST
29841	U003622500	232	SOUTHEASTERN FREIGHT LINES	1040 EDGEFIELD RD	..	NORTH AUGUSTA	SC	LUST, UST
29841	1004780180	110002257520	GAS PLUS 2	1040 EDGEFIELD ROAD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007243475	110017152490	GAS PLUS 2	107 EDGEFIELD RD	..	N AUGUSTA	SC	FINDS, LUST
29841	U003665721	83	MCELMURRAY W H	107 EDGEFIELD RD	..	N AUGUSTA	SC	UST
29841	1007240806	110017124583	R AND J DIESEL TRUCK WASH	1075 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	1004593477	110002237936	DUTCH BOY LINES INC	1175 EDGEFIELD ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	1000169275	SCD981759152	DUTCHBOY MOTOR COACH	1182 EDGEFIELD RD	..	NO AUGUSTA	SC	RCRAInfo-SQG
29841	1007243785	110017155665	DUTCHBOY MOTOR COACH	1182 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U002323391	15652	EAGLE TRANSPORT CORP	1448 EDGEFIELD RD	..	NORTH AUGUSTA	SC	LUST, UST
29841	U003632089	10549	PIONEER CLEARING	1514 EDGEFIELD RD	..	NORTH AUGUSTA	SC	LUST, UST
29841	100790422	110002234172	J&L COUNTRY MARKET	1625 EDGEFIELD RD HWY 25	..	NORTH AUGUSTA	SC	FINDS
29841	1007233532	110017048620	J&L COUNTRY MARKET	1625 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003878375	118	DEES GROCERY	1661 EDGEFIELD RD	..	N AUGUSTA	SC	UST
29841	U002040844	3134	SOUTHERN FELT COMPANY INCORPORA	1695 EDGEFIELD RD	..	NORTH AUGUSTA	SC	UST
29841	1004593125	110002180292	FMR CARLYN SERVICES	217-A EDGEFIELD RD	..	NORTH AUGUSTA	SC	DRYCLEANERS
29841	S105621337	110004940654	SUNDANCE CLEANERS	236 EDGEFIELD RD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1000184854	110017298609	ROBERT L GORDON DMD	244 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007256924	110016972169	DEGRAAF CHIROPRACTIC CLINIC-EDGEF	248 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007226089	110017332845	QUALITY PLANNING	346 EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007259809	110016984726	BILLYS BP	346 EDGEFIELD RD	..	BELVEDERE	SC	FINDS
29841	1007227319	18250	BILLYS BP	346 EDGEFIELD RD	..	BELVEDERE	SC	LUST
29841	S106666052	18250	BILLYS BP	346 EDGEFIELD RD	..	BELVEDERE	SC	UST
29841	U0038930577	18250	PANTRY 3245 DBA DEPOT	349 EDGEFIELD ROAD	..	BELVEDERE	SC	UST
29841	U003878695	158	DEPOT	349 EDGEFIELD ROAD	..	BELVEDERE	SC	RCRAInfo-SQG, FINDS
29841	1004780416	110004940849	A T1 MUFFLER	450 EDGEFIELD RD	..	BELVEDERE	SC	FINDS
29841	1007231926	110017032174						

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29841	U00366578	16482	A 1 MUFFLER	450 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U007237001	110017084732	NELSON SERVICE CONST CO	525 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U003523828	222	NELSON SERVICE CONST CO	525 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U007245300	110017171503	FOUR SEASONS FOOD & FUEL STORE 10	600 EDGEFIELD RD		BELVEDERE	SC	FINDS, LUST
29841	U003878523	139	FOUR SEASONS FOOD & FUEL STORE 10	600 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U004780272	110002257886	MANLY AUTO COLLISION INC	601 EDGEFIELD ROAD		BELVEDERE	SC	RCRAInfo-SQG, FINDS
29841	U007233538	110017046884	BARGERONS CHAMPION SERVICE STATII	605 EDGEFIELD RD		BELVEDERE	SC	FINDS, LUST
29841	U003878323	112	BARGERONS CHAMPION SERVICE STATII	605 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U007260167	110017332493	H O W TRUCKING INC	847 EDGEFIELD RD		BELVEDERE	SC	FINDS, LUST
29841	U003522039	63	H O W TRUCKING INC	847 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U007235519	1100170698429	ADAMS SUPPLY CO	871 EDGEFIELD RD		N AUGUSTA	SC	FINDS
29841	U007232368	1100170387113	COUNTRY CONVENIENCE	901 EDGEFIELD RD		BELVEDERE	SC	FINDS
29841	U007246351	110017182261	FOUR SEASONS FOOD & FUEL STORE 12	901 EDGEFIELD RD		N AUGUSTA	SC	FINDS
29841	U003665518	14550	FOUR SEASONS FOOD & FUEL STORE 12	901 EDGEFIELD RD		N AUGUSTA	SC	LUST, UST
29841	U004780426	110002257735	DEPOT	937 EDGEFIELD ROAD		N AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	U007233537	110017046675	SUNOCO 0616-1129/COOP2670	938 EDGEFIELD RD		NORTH AUGUSTA	SC	FINDS, LUST
29841	U003878331	113	SUNOCO 0616-1129/COOP2670	938 EDGEFIELD RD		NORTH AUGUSTA	SC	FINDS, LUST
29841	U007244503	110017163184	TURNER TRANSPORT CO	982 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U007174287	110002189497	TURNER TRANSPORT CO	982 EDGEFIELD RD		BELVEDERE	SC	UST
29841	U005416376	110012260702	WALMART EXPRESS	101 EDGEWOOD DR		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	S106044579		WALMART STORE 1270	179 EDGEWOOD DR		BELVEDERE	SC	RCRAInfo-SQG, FINDS
29841	U003518982	3138	AMOCO OIL CO	I-20 EXIT 5 @ HWY 25		BELVEDERE	SC	SPILLS
29841	U007235689	110017071176	HOME OWNER	FIVE NOTCH RD & ST RD 34		N AUGUSTA	SC	UST
29841	96495380		180 FREELAND DR	111 E FOREST		N AUGUSTA	SC	FINDS
29841	U003970079	235	180 FREELAND DR	180 FREELAND DR		NORTH AGUSTA	SC	ERNS
29841	U007244505	110017163200	OVERNITE TRANSPORTATION CO	FRONTAL RD US 25 / I-20		NORTH AGUSTA	SC	LUST, UST
29841	U007256297	110017292222	OVERNITE TRANSPORTAION CO	FRONTAL RD US 25 & I-20		BELVEDERE	SC	LUST, UST
29841	U003526534	18105	WBBO	1305 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U005490693	110001674108	POTEET FUNERAL HOME	1400 GEORGIA AVENUE		N AUGUSTA	SC	UST
29841	U007259262	110017323163	CARTER ORTHODONTICS	1743-A GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	U007257665	110017306413	NORTH AUGUSTA ANIMAL HOSPITAL	1801 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	U007242173	110017138863	BP SERVICE STATION 48786	1849 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	S105684798	11640	PANTRY 3269 DBA DEPOT	1849 GEORGIA AVE		N AUGUSTA	SC	LUST
29841	U007227567	110016987233	PANTRY 3269 DBA DEPOT	1849 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U003930028	11640	PANTRY 3269 DBA DEPOT	1849 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U004780548	SCD987582483	BP OIL-SITE #48786	1849 GEORGIA AVENUE & HWY 25		N AUGUSTA	SC	GWCI, UST
29841	U007245301	110017171512	LYNN BOYDS TEXACO	226 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	U003665509	110017194515	CIRCLE K 2705580	226 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	S105812349	10135	CIRCLE K 2705580	226 GEORGIA AVE		N AUGUSTA	SC	LUST, UST
29841	U003878922	185	UST	266 GEORGIA AVE		N AUGUSTA	SC	SPILLS
29841	U007230027	110017012533	CARPENTER EXXON	326 GEORGIA AVE		NORTH AUGUSTA	SC	UST
29841	U007227090	110016982372	CARPENTER EXXON	326 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS, LUST
29841	S105511273		CHAMPION NORTH AUGUSTA GARAGE	336 GEORGIA AVENUE		NORTH AUGUSTA	SC	FINDS
29841	U007247791	110017197086	344 GEORGIA AVENUE	344 GEORGIA AVENUE		NORTH AUGUSTA	SC	SHWS
29841	U003930098	12310	GREGS GAS PLUS 5	403 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U007244075	110017158662	GREGS GAS PLUS 5	403 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U007243781	110017158662	CHEVRON FOOD MART	403 GEORGIA AVENUE		N AUGUSTA	SC	UST
29841	S105621355	110017155629	KENRICKS CONVENIENCE INC	411 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS, DRYCLEANERS
29841	U001540393	15172	FORCE CLEANERS INC	417 GEORGIA AVE		NORTH AUGUSTA	SC	UST
29841	U007230998	110017022693	NORTH AUGUSTA FEED & SEED	502 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	S105811274	110016995420	BRANTLEY CHIROPRACTIC	503 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U007228358	110017151887	LAKES AND STREAMS DEV	523 GEORGIA AVENUE		NORTH AUGUSTA	SC	SHWS
29841	U007243412	110017332982	NORTH AUGUSTA HEALTH CENTER	524 GEORGIA AVE		N AUGUSTA	SC	FINDS
29841	U007260215	110017127356	THE IMAGING CENTER NORTH AUGUSTA	531 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	U007242172	110017136854	TURNER AMOCO	625 GEORGIA AVE		NORTH AUGUSTA	SC	FINDS
29841	U003878234	101	TURNER AMOCO	638 GEORGIA AVE		NORTH AUGUSTA	SC	UST
29841	U003523894	11041	NORTH AUGUSTA COUNTRY CLUB	2001 GREGORY LAKE RD		N AUGUSTA	SC	UST
29841	U005816779	110017037473	N AUGUSTA COUNTRY CLUB	GREGORY LAKE RD		N AUGUSTA	SC	FINDS
29841	U007115500	110006359029	BEECH ISLAND SAND & GRAVEL INCORPI	1022 GUM SWAMP ROAD		BEECH ISLAND	SC	FINDS
29841	U002542650	SCD980842769	TTX COMPANY/ISRD HAMBURG DIVISION	1 HAMBURG ROAD		NORTH AUGUSTA	SC	RCRAInfo-SQG
29841	U005790148	110002338720	TTX COMPANY HAMBURG DIVISION	1 HAMBURG ROAD		NORTH AUGUSTA	SC	FINDS
29841	U007214656	110002238720	HAMBURG INDUSTRIES INCORPORATED	HAMBURG IND # 1 HAMBURG RD		NORTH AUGUSTA	SC	FINDS
29841	U007225612	110015967059	NORTH AUGUSTA CITY OF	130 HAMMONDS FERRY RD		NORTH AUGUSTA	SC	FINDS
29841	U007259109	110017321575	MICHAEL & PEGGIE RUBEN	210 HICKORY PL		NORTH AUGUSTA	SC	FINDS
29841	U000758894	14786	JOHDARL AND ASSOCIATES	305 HOLLY LN		N AUGUSTA	SC	FINDS
29841	U007115477	SCD9808401493	HALOCARBON PRODUCTS CORPORATIONI	308 HOLLY LN		N AUGUSTA	SC	UST
29841	U005790119	110002239248	CLEARWATER GULF CAR WASH	1030 JEFFERSON DAVIS HWY		NORTH AUGUSTA	SC	FINDS

EDR ZIP Code Scan Report

ZIP	EOR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29841	1007224656	110016957186	WRIGHT PEST CONTROL	1034 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS
29841	1007218114	110002257469	VIKING FREIGHT N AUGUSTA	1045 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007236898	110017084705	THURSTON MOTOR LINES INC	1045 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	1007233550	110017048808	GULF SERVICE STATION 265603	359 JEFFERSON DAVIS RD	..	N AUGUSTA	SC	UST
29841	1003521997	91	GULF SERVICE STATION 265603	359 JEFFERSON DAVIS RD	..	N AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1004781064	110002165117	DONS COLLUSION CENTER	420 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	1007236694	110017084661	KMART #3003	425 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	UST
29841	1003522976	237	KMART #3003	425 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1001493872	110002257897	MIDLAND PAINT & BODY	5115 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS
29841	1000835387	110002257959	ANDY JONES MAZDA	5512 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	RCRAInfo-SQG
29841	1007116050	SCD987592045	ANDY JONES MAZDA	5512 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	FINDS
29841	1007248231	110017201641	KENRICKS HILLTOP	6043 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	LUST, UST
29841	1003759628	13189	GREGS GAS PLUS 1	6043 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS
29841	1005951620	110006553476	AUGUSTA CONCRETE BLOCK	6269 JEFFERSON DAVIS HIGHWAY	..	NORTH AUGUSTA	SC	FINDS
29841	1007233075	110017043983	CIRCLE K 2705348	598 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	GWCI, LUST, UST
29841	1003666511	10345	CIRCLE K 2705348	598 JEFFERSON DAVIS HWY	..	N AUGUSTA	SC	FINDS
29841	1007244102	110017458939	TAYLOR TOYOTA INC	651 JEFFERSON DAVIS HWY	..	NORTH AUGUSTA	SC	FINDS
29841	1007244330	110017161319	WALDEN HALL SCHOOL	1896 KNOBCCONE AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1007240200	110002199415	NORTH AUGUSTA HIGH SCHOOL	2000 KNOBCCONE AVE	..	N AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007233757	110017051161	MURPHY USA 6900	1211 KNOX AVE HWY 25 BYPASS	..	N AUGUSTA	SC	FINDS
29841	1003878957	18995	MURPHY USA 6900	1211 KNOX AVE HWY 25 BYPASS	..	N AUGUSTA	SC	UST
29841	1007265036	SCRO00765487	TIRE KINGDOM INC 282	1283 KNOX AVE	..	NORTH AUGUSTA	SC	RCRAInfo-SQG
29841	1007483466	110017613894	TIRE KINGDOM INC 282	1283 KNOX AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1003525372	250	SOUTHERN BELL NAGSSCMA	1702 KNOX AVE	..	N AUGUSTA	SC	UST
29841	1005678282	110002370522	BELLSOUTH/NORTH AUGUSTA	1702 KNOX AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1007256927	110017298636	JAMES D QUARLES DMD	1760 KNOX AVE	..	N AUGUSTA	SC	FINDS
29841	1007240010	110017116137	MARTINTOWN ANIMAL HOSPITAL	1807 KNOX AVE	..	NORTH AUGUSTA	SC	FINDS
29841	1007228839	110017010560	J MICHAEL HAYIRD DMD	1810 KNOX AVENUE STE A	..	NORTH AUGUSTA	SC	FINDS
29841	1007233057	110017043803	JOYCE FACTEAU & WAYNE BRANTLEY	704 LAKE Santee DR	..	N AUGUSTA	SC	FINDS
29841	1003655503	62	CIRCLE K 2705350	115 LAUREL LAKES DR	..	N AUGUSTA	SC	LUST, UST
29841	1007269018	110017332000	CIRCLE K 2705350	115 LAUREL LAKES DR	..	N AUGUSTA	SC	FINDS
29841	1000369986	110000894344	CHARTER TERMINAL COMPANY	221 LAUREL LAKES DR	..	NORTH AUGUSTA	SC	RCRAInfo-LQG
29841	1007115366	SCD1144811966	CHARTER TERMINAL COMPANY	221 LAUREL LAKES DR	..	NORTH AUGUSTA	SC	FINDS
29841	1007259960	110017288727	NORTH AUGUSTA CHIROPRACTIC	404B E MAINTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007235091	110017064950	PALMETTO PLACE HOA	398 MAPLEWOOD DR	..	NORTH AUGUSTA	SC	DRYCLEANERS
29841	100704462	84	OXFORD CLEANERS	165 MARKET PLAZA	..	N AUGUSTA	SC	UST
29841	10017152481	110017152481	SMILE GAS 11	128 W MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007243474	110017152739	SMILE GAS 11	128 W MARTINTOWN RD	..	N AUGUSTA	SC	FINDS, LUST
29841	1007243499	81	CIRCLE K 2705588	132 W MARTINTOWN RD	..	N AUGUSTA	SC	GWCI, UST
29841	1003665502	110017018822	CIRCLE K 2705588	132 W MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007230615	11641	GULF SERVICE STATION	1601 E MARTINTOWN RD	..	N AUGUSTA	SC	UST
29841	1003521995	110022257496	GULF SERVICE STATION	1601 E MARTINTOWN RD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1003707861	110002199193	SHERWIN WILLIAMS COMPANY	310 E MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	10014095312	110017331993	OLSON TIRE TOTAL CAR CARE 6064	404 E MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007260117	85	SMILE GAS 14	410 W MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1001536636	110016974951	SMILE GAS 14	410 W MARTINTOWN RD	..	N AUGUSTA	SC	UST
29841	1007226361	17831	FORMER CAR QUEST	416 E MARTINTOWN RD	..	N AUGUSTA	SC	LUST, UST
29841	1006666045	17831	FORMER CAR QUEST	416 E MARTINTOWN RD	..	N AUGUSTA	SC	GWCI, LUST, UST
29841	1003930542	155	FORMER CAR QUEST	416 E MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1003878656	110002257708	PANTRY 3249 DBA DEPOT	421 W MARTINTOWN RD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1004760420	12082	DEPOT	421 W MARTINTOWN ROAD	..	N AUGUSTA	SC	LUST, UST
29841	1005439244	12082	WATER COMFORT POOLS	431 E MARTINTOWN ROAD	..	N AUGUSTA	SC	UST
29841	1001536670	110017035812	MITCHELLS GROCERY	450 W MARTINTOWN RD	..	N AUGUSTA	SC	GWCI, LUST, UST
29841	1007232279	110016968502	MITCHELLS GROCERY	450 W MARTINTOWN RD	..	N AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	1007225756	110017095427	HAMMOND HILLS ANIMAL HOSPITAL	454 W MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007238013	110017095427	DEBORAH A ASHCRAFT DMD	460 W MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	1007233547	96	LYNN HURST 76	469 MARTINTOWN RD	..	N AUGUSTA	SC	UST
29841	1003622660	110016971785	LYNN HURST 76	469 MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007226052	11001711460	CLARENCE L NORTON DDS	501 E MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007244071	110017159626	CLARISSA SCHMIDT DMD LLC	501-A E MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007240422	146	GARY A WAUGH DMD	523 E MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	1003878585	110017171460	BRECKENRIDGE AMOCO	523 E MARTINTOWN RD	..	N AUGUSTA	SC	UST
29841	1007245296	110017172977	BRECKENRIDGE AMOCO	525 MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007245441	14258	NORTH AUGUSTA AMOCO DQ	525 MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1003624059	110017048791	NORTH AUGUSTA AMOCO DQ	601 E MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007233549	110017037277	GULF SERVICE STATION 265538	715 E MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007232423	13017	WESTERN AUTO	827 E MARTINTOWN RD	..	N AUGUSTA	SC	UST
29841	1003526583	110017027634	WESTERN AUTO	827 E MARTINTOWN RD	..	N AUGUSTA	SC	FINDS
29841	1007231483	11833	HILLTOP	MARTINTOWN RD	..	NORTH AUGUSTA	SC	GWCI, LUST, UST
29841	1003522282	110017113096	HILLTOP	MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS
29841	1007239720	110017113096	FRANKS GROCERY	MARTINTOWN RD	..	NORTH AUGUSTA	SC	FINDS

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29841	U003878834	174	FRANKS GROCERY	MARTINTOWN RD	..	NORTH AUGUSTA	SC	UST
29841	U005626925	110009811114	THE MARTIN GROUP	MARTINTOWN ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	U007226054	110016971801	C.A. WILLIAMS DDS	401 METZ DR	..	NORTH AUGUSTA	SC	FINDS
29841	U005791375	110002185590	MOBILE HOME ESTATES	MOBILE HOME EST RT 4 BOX 32	..	NORTH AUGUSTA	SC	FINDS
29841	S1058690886	17082	SCHMAUDER	1 MULBERRY LN	..	PEAK	SC	LUST
29841	U007238702	110017402552	UNITED OIL MARKETERS	121 MURRAH RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003526065	10108	TRANSPORT SOUTH INC	121 MURRAH RD	..	NORTH AUGUSTA	SC	LUST, UST
29841	U003526181	10610	UNITED OIL MARKETERS	121 MURRAH RD	..	NORTH AUGUSTA	SC	LUST, UST
29841	U007224667	110016957293	HANCOCK MHP	214 NORTHSIDE DR	..	NORTH AUGUSTA	SC	FINDS
29841	U006869586	110014326639	NORTH AUGUSTA FAMILY DENTISTRY	181 OLD JACKSON HIGHWAY	..	NORTH AUGUSTA	SC	FINDS
29841	U007257603	110017305771	FORMER SAVE-A-TON	415 OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003521449	15763	FORMER SAVE-A-TON	415 OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007248128	110017200599	SUNBELT FRONT WHEEL DR	509 OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U001125630	110002199228	COLONIAL CLEANERS INC	706 OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U00727552	110016987082	COLONIAL CLEANERS INC	706 OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003520362	12535	NORTH AUGUSTA MIDDLE SCHOOL	725 OLD ENGLISH RD	..	NORTH AUGUSTA	SC	FINDS
29841	U004780198	110002199424	FOX CANDY CO	OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003521511	70	FOX CANDY CO	OLD EDGEFIELD RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007243501	110017152757	PARDUE CONSTRUCTION CO	615 1/2 PIEN LOG RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007243390	110017151614	WJBF TV	206 PINE LOG RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007248164	110017200955	FOUR SEASONS FOOD & FUEL 5	2031 PISGAH RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007236710	110017081735	FOUR SEASONS FOOD & FUEL 5	2031 PISGAH RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003507439	120	HORSE CREEK POLLUTION CONTROL FA	707 PSA ROAD OFF SC HIGHWAY 125	..	NORTH AUGUSTA	SC	FINDS
29841	U000206320	1100000706941	REDCLIFF STATE PARK	181 REDCLIFFE RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007230220	110017014586	SPARTAN EXPRESS INC	131 REVCO RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007236995	110017084670	UCB RADCCURE INC	131 REVCO RD	..	NORTH AUGUSTA	SC	FINDS
29841	U005933067	SCD987595451	SURFACE SPECIALTIES INC NORTH AUGI	1610 RICHLAND AVENUE	..	AIKEN	SC	RCRAInfo-LQG
29841	U007116062	110007836547	BP OIL-SITE #	701 RIDGE RD	..	NORTH AUGUSTA	SC	UST
29841	U004780551	143	CURRY'S GROCERY	701 RIDGE RD	..	NORTH AUGUSTA	SC	FINDS, LUST
29841	U003878559	110017149548	CURRY'S GROCERY	1129 SAND BAR FERRY RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007243192	110017012631	MELVIN YOUNGS EXXON	1230 SAND BAR FERRY RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007230036	110002199433	ASSOCIATED CRAFTS INCORPORATED	1420 SAND BAR FERRY ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	U006082780	110001664661	KIMBERLY CLARK	1051 SANDBAR FERRY RD	..	BEECH ISLAND	SC	RCRAInfo-SQG, FINDS
29841	U001662848	110001664661	TODD S QUICK & EASY CAR WASH	1420 SANDBAR FERRY RD	..	BEECH ISLAND	SC	ERNS
29841	U004595393	110002237507	1420 SANDBAR FERRY RD	1420 SANDBAR FERRY RD	..	BEECH ISLAND	SC	ERNS
29841	974125751	110017306299	KENNETH A. & SHIRLEY W NEWSOME	105 SAVANNAH POINT	..	NORTH AUGUSTA	SC	FINDS
29841	U007257653	110017311737	HARRY & BEVERLY FULLER	188 E SHORELINE DR	..	NORTH AUGUSTA	SC	FINDS
29841	U007258164	110017136810	WARREN HEALTH CARE FOUNDATION	1604 SUMMERHILL RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007241983	110017136810	JULIUS A STEPHENS DDS	219 SWEETWATER RD	..	NORTH AUGUSTA	SC	ERNS
29841	U007244234	110017160294	221 SWEETWATER RD	221 SWEETWATER RD	..	NORTH AUGUSTA	SC	ERNS
29841	93305847	670	BP SWEETWATER TERMINAL	221 SWEETWATER ROAD	..	NORTH AUGUSTA	SC	AST
29841	U002626595	110002233510	MAGELLAN TERMINALS HOLDINGS LP	222 SWEETWATER RD	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	A100174713	110002233510	SOUTHERN FACILITIES INCORPORATED	222 SWEETWATER RD	..	NORTH AUGUSTA	SC	FINDS
29841	U00408107	1100022337687	CONOCO INC NORTH AUGUSTA	224 SWEETWATER RD	..	NORTH AUGUSTA	SC	FINDS
29841	U005790223	1100169898418	CONOCO INC NORTH AUGUSTA	224 SWEETWATER RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007228652	9486	KENAN TRANSPORT CO	251 SWEETWATER RD	..	NORTH AUGUSTA	SC	ERNS
29841	U003520452	110002257851	KENAN TRANSPORT COMPANY	251 SWEETWATER RD	..	NORTH AUGUSTA	SC	ERNS
29841	U004780104	3102	MURPHY ESTATES S/D/SWEETWTR CO	SWEETWATER RD PO BOX 6	..	NORTH AUGUSTA	SC	UST
29841	U002114704	110017086972	KINDER MORGAN SOUTHEAST TERMINAL	1109 THURMOND ST	..	NORTH AUGUSTA	SC	FINDS
29841	U000289222	110001138714	ALLEN, EARL CHEMICAL SITE	ON U.S. 1 .5 MILES NE OF SAVAN	..	NORTH AUGUSTA	SC	FINDS
29841	S106044428	SCD981024102	URQUHART STATION SOUTH CAROLINA I	100 URQUHART DR.	..	NORTH AUGUSTA	SC	SPILLS
29841	U003868491	110000335534	SCANA URQUHART STATION	637 VICTORIA DR	..	NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS
29841	U000137450	29841RCHRT10	HOME OWNER	120 WALNUT LN	..	NORTH AUGUSTA	SC	TRIS
29841	U005453230	110017327418	CROWN ENTERPRISES	1804 WELL ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	U007259872	1100170000911	CROWN ENTERPRISES	311 WHITLAW RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007228902	10686	PAUL KNOX MIDDLE	311 WHITLAW RD	..	NORTH AUGUSTA	SC	FINDS
29841	U004780199	110002199317	SOUTHERN BELL NAGSSCGS	311 WHITLAW RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003525371	9606	SCE&G NORTH AUGUSTA FLEET MAINT	311 WHITLAW RD	..	NORTH AUGUSTA	SC	FINDS
29841	U003807324	224	SCE&G NORTH AUGUSTA FLEET MAINT	311 WHITLAW RD	..	NORTH AUGUSTA	SC	FINDS
29841	U001961985	110017001795	SUDLOW LAKE ASSN	376 WOLDUS RD	..	NORTH AUGUSTA	SC	FINDS
29841	U007278985	110017330128	NORTH AUGUSTA CITY DUMP	ROUTE 5 OLD JACKSON HIGHWAY 28	..	NORTH AUGUSTA	SC	FINDS
29841	U007259833	SCD980844166	TENNECO BEECH ISLAND	1159 ATOMIC RD	..	BEECH ISLAND	SC	RCRAInfo-SQG, FINDS
29841	U003868478	110017001795	WERT'S EQUIPMENT RENTAL INC	1986 ATOMIC RD	..	BEECH ISLAND	SC	FINDS
29841	U006256804	110017001795	GENERAL ELECTRIC INSPECTION SERVIC	1986 ATOMIC RD	..	BEECH ISLAND	SC	FINDS
29841	U007241570	15097	GE INSPECTIONS SERVICES INC - NORTH	1986 ATOMIC ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	U003622340	110017001795	GE INSPECTIONS SERVICES INC - NORTH	1986 ATOMIC ROAD	..	NORTH AUGUSTA	SC	FINDS
29841	U004781025	110017067467	GE INSPECTIONS SERVICES INC - NORTH	1986 ATOMIC ROAD	..	NORTH AUGUSTA	SC	FINDS
29842	U007235331	110017067467	GE INSPECTIONS SERVICES INC - NORTH	1986 ATOMIC ROAD	..	NORTH AUGUSTA	SC	FINDS

EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29842	1005791681	110002180657	SONS SUPERMARKET	2000 ATOMIC RD		BEECH ISLAND	SC	FINDS
29842	1007258587	110017316251	GRADESOUTH INC	2335 ATOMIC RD		BEECH ISLAND	SC	FINDS
29842	1007235580	110017070088	BEAMS PAVEMENT MAINTENANCE CO	2335 ATOMIC RD		BEECH ISLAND	SC	FINDS
29842	1007462071	110017843501	UCB CHEMICALS CORP-INDUSTRIAL PAR	NORTH AUGUSTA INDUSTRIAL PARK		NORTH AUGUSTA	SC	FINDS
29842	1005790107	110002239499	BEECHWOOD S D	BEACH IS WTR 480 BEECH IS DR		BEECH ISLAND	SC	FINDS
29842	A100174736	1477	A & J PAVING	476 BEECH ISLAND ROAD		BEECH ISLAND	SC	AST
29842	1007257443	110017304175	VAUCLOSE HEIGHTS SD	PO BOX 188		BEECH ISLAND	SC	FINDS, LUST
29842	1007230025	110017012515	FOUR SEASONS FOOD & FUEL 111	211 CAREY DR		BEECH ISLAND	SC	GWCI, UST
29842	1003878851	176	FOUR SEASONS FOOD & FUEL 111	211 CAREY DR		BEECH ISLAND	SC	SHWS
29842	S105528139		KIMBERLY CLARK CORP	ON CO RD 5 S OF THE INT OF SC		BEECH ISLAND	SC	FINDS
29842	1007242510	110017142359	QUALITY ROOFING	221 DICKS DR		N AUGUSTA	SC	RCRAInfo-LOG
29842	1006811469	SCR000763706	UCB BIOPRODUCTS INC	1024 DITTMAN CT		BEECH ISLAND	SC	FINDS
29842	1004593094	110007032120	AIKEN CO PUBLIC SERVICE AUTHORITY	SC HWY 125 (US HWY 278)		BEECH ISLAND	SC	FINDS
29842	S102448917		SIMKINS FARM SITE	JCT OF SR 65 / SR 125		BEECH ISLAND	SC	SHWS
29842	1003666470	SCD980842801	SIMKINS FARM SITE	JCT S R 65 & S R 125		BEECH ISLAND	SC	CERCLIS-NFRAP
29842	1003525935	227	THURSTON MOTOR LINES INC	1045 JEFFERSON DAVIS HWY		NORTH AUGUSTA	SC	UST
29842	1003878339	114	FIRST STOP CLEARWATER	4368 JEFFERSON DAVIS HWY	G, WNW, 1/2 - 1	NORTH AUGUSTA	SC	GWCI, UST
29842	1007233585	110017049166	FIRST STOP CLEARWATER	4368 JEFFERSON DAVIS HWY	G, WNW, 1/2 - 1	NORTH AUGUSTA	SC	FINDS, LUST
29842	1001125613	1100022331076	TAYLOR TOYOTA INC	651 JEFFERSON-DAVIS HWY		NORTH AUGUSTA	SC	RCRAInfo-SQG, FINDS,
29842	1005792531	110002310605	SCE&G URQUHART STATION	100 KEITH MULLIS DR		BEECH ISLAND	SC	FINDS
29842	1000875739	110004836776	ASSOCIATED CRAFTS INC	128 OLD JACKSON HWY		BEECH ISLAND	SC	RCRAInfo-SQG, FINDS
29842	1007261442	110017348084	KIMBERLY CLARK CORPORATION	246 OLD JACKSON HIGHWAY		BEECH ISLAND	SC	FINDS
29842	U003975543	9499	KIMBERLY CLARK CORP	246 OLD JACKSON HWY		BEECH ISLAND	SC	UST
29842	U003970403	186	KIMBERLY CLARK CORP	246 OLD JACKSON HWY		BEECH ISLAND	SC	LUST, UST
29842	1000175873	110000574619	KIMBERLY CLARK CORP	246 OLD JACKSON HWY		BEECH ISLAND	SC	FINDS
29842	1007115039	SCD069186310	PACTIV CORPORATION	578 OLD JACKSON HIGHWAY		BEECH ISLAND	SC	RCRAInfo-LOG
29842	U001536632	14863	PACTIV CORP	578 OLD JACKSON HWY		BEECH ISLAND	SC	LUST, UST
29842	U003622242	266	WJBF TV	206 PINE LOG RD		NORTH AUGUSTA	SC	UST
29842	U003524580	271	HORSECREEK TREATMENT PLANT	70 PSA RD		BEECH ISLAND	SC	UST
29842	1000175697	110002257771	REDCLIFFE STATE PARK	181 REDCLIFFE RD		BEECH ISLAND	SC	RCRAInfo-SQG, FINDS,
29842	1007236935	110017084055	REVCO INC	111 REVCO RD		NORTH AUGUSTA	SC	LUST, UST
29842	U003518936	207	ABF FREIGHT SYSTEM INC	118 REVCO RD		NORTH AUGUSTA	SC	FINDS, LUST
29842	U003525445	234	ABF FREIGHT SYSTEM INC	118 REVCO RD		NORTH AUGUSTA	SC	UST
29842	2003633825	110000355516	SPARTAN EXPRESS INC	120 REVCO RD		NORTH AUGUSTA	SC	UST
29842	1000835472		131 REVCO ROAD	131 REVCO ROAD		NORTH AUGUSTA	SC	ERNS
29842	S106349533		SURFACE SPECIALTIES INCORPORATED	312 RIVERDALE RD		NORTH AUGUSTA	SC	FINDS, TRIS
29842	U003878725	161	MELVIN YOUNGS EXXON	1129 SAND BAR FERRY RD		BEECH ISLAND	SC	SPILLS
29842	1007238365	110017098996	TODDS CONVENIENCE STORE 1	1181 SAND BAR FERRY RD		BEECH ISLAND	SC	UST
29842	U003878828	151	TODDS CONVENIENCE STORE 1	1181 SAND BAR FERRY RD		BEECH ISLAND	SC	FINDS, LUST
29842	U003622695	150	TODDS CONVENIENCE STORE 3	1721 SANDBAR FERRY ROAD		BEECH ISLAND	SC	UST
29842	1007238365	110017099003	TODDS CONVENIENCE STORE 3	1721 SANDBAR FERRY ROAD		BEECH ISLAND	SC	FINDS, LUST
29842	U003759613	18596	FOUR SEASONS FOOD & FUEL 2	2450 STORM BRANCH RD		N AUGUSTA	SC	UST
29842	1007236708	110017081717	FOUR SEASONS FOOD & FUEL 2	2450 STORM BRANCH RD		N AUGUSTA	SC	FINDS
29842	1007230038	110017012668	FOUR SEASONS FOOD & FUEL 2	40 TODDS LANDING RD		BEECH ISLAND	SC	FINDS
29842	U003524995	525	SCE&G URQUHART STATION	100 URQUHART RD		BEECH ISLAND	SC	UST
29851	1007243703	110017154826	SC ARMY NATIONAL GUARD CO C 122 EN	HWY 144		BEECH ISLAND	SC	FINDS
29851	S105860818	13219	SC ARMY NATIONAL GUARD CO C 122 EN	HWY 144		BEECH ISLAND	SC	FINDS
29851	U003520304	11001706142	SC ARMY NATIONAL GUARD CO C 122 EN	HWY 144		WARRENVILLE	SC	LUST
29851	1007234634	15912	MIDLAND VALLEY CONVENIENCE STOR	2009 AUGUSTA RD		WARRENVILLE	SC	FINDS
29851	U003508712	125	MIDLAND VALLEY CONVENIENCE STOR	2009 AUGUSTA RD		WARRENVILLE	SC	FINDS
29851	U003558665	125	PANTRY 3247 DBA DEPOT	3533 AUGUSTA RD		WARRENVILLE	SC	LUST, UST
29851	1004780418	110002199344	DEPOT	444 AUGUSTA RD		WARRENVILLE	SC	RCRAInfo-SQG, FINDS
29851	1007224346	110016953901	421 COMPOSTING SITE	PO BOX 15		WARRENVILLE	SC	FINDS
29851	1007235581	110017070097	HOME OWNER	PO BOX 264		WARRENVILLE	SC	FINDS
29851	1007230441	110017016931	WARRENVILLE W/D	PO BOX 85		WARRENVILLE	SC	FINDS
29851	1007236244	11001707018	ST JOHNS HOLY TEMPLE	CATO RD		WARRENVILLE	SC	FINDS
29851	1007236911	110017063813	CAROLINA SOLVENT			WARRENVILLE	SC	AST
29851	A100168639	1334	SCE&G - SOUTHERN COMPRESSOR STA1	2314 DBBLE ROAD		WARRENVILLE	SC	RCRAInfo-SQG, FINDS
29851	1004780701	110001671888	SC PIPELINE CORP	DIBBLE RD & HITCHCOCK PKWY		WARRENVILLE	SC	FINDS
29851	1005791397	110002185224	PC TIRES AND FLEA MARKETS	186 GOLF COURSE RD		WARRENVILLE	SC	SPILLS
29851	S106349749		KENRICK'S GAS PLUS	GREG KENRICK		WARRENVILLE	SC	FINDS
29851	1007238071	190	J M HUBER CORPORATION	SC HWY 191 & SC 421		WARRENVILLE	SC	FINDS
29851	U003522610	110017096015	J M HUBER CORPORATION	SC HWY 191 & SC 421		WARRENVILLE	SC	UST
29851	1001962022	110002184145	HONDA CARS OF AIKEN	550 JEFFERSON DAVIS HWY		WARRENVILLE	SC	RCRAInfo-SQG, FINDS
29851	10071697716	11001697716	SCE&G FLEET MAINT FAC WARRENVILLE	132 LANGLEY DAM RD		WARRENVILLE	SC	FINDS
29851	1007209151	SCR000765321	SCE&G FLEET MAINT FAC WARRENVILLE	132 LANGLEY DAM RD		WARRENVILLE	SC	RCRAInfo-SQG
29851	1007232111	110017034056	PINE LOG PIT STOP	610 LEGION RD		WARRENVILLE	SC	FINDS
29851	U003623706	11207	PINE LOG PIT STOP	610 LEGION RD		WARRENVILLE	SC	UST
29851	1007236131	110017075831	THREE WAY FOOD MART	2260 PINE LOG RD		WARRENVILLE	SC	FINDS

# EDR ZIP Code Scan Report

ZIP	EDR-ID	Facility ID	Name	Address	Map/Dir/Dist	City	State	Databases
29851	U003943121	19005	THREE WAY FOOD MART	2260 PINE LOG RD		WARRENVILLE	SC	UST
29851	1007242498	11007142233	HOME OWNER	2470 PINE LONG RD		WARRENVILLE	SC	FINDS
29851	1005532528	110006693408	DIXIE CLAY CO/RANDALL PIT	2525 PINE LOG ROAD		WARRENVILLE	SC	FINDS
29851	1005791678	110002181013	AMERICAN CONCRETE PRODUCTS WARE	2611 PINE LOG RD		WARRENVILLE	SC	FINDS
29851	A100174737	1476	KENRICK'S GAS PLUS	3007 PINE LOG ROAD		WARRENVILLE	SC	AST

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

**Elapsed ASTM days:** Provides confirmation that this EDR report meets or exceeds the 90-day updating requirement of the ASTM standard.

### FEDERAL ASTM STANDARD RECORDS

#### **NPL: National Priority List**

Source: EPA

Telephone: N/A

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 12/14/04

Date Made Active at EDR: 02/03/05

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 02/01/05

Elapsed ASTM days: 2

Date of Last EDR Contact: 02/01/05

#### **NPL Site Boundaries**

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1

Telephone 617-918-1143

EPA Region 3

Telephone 215-814-5418

EPA Region 4

Telephone 404-562-8033

EPA Region 6

Telephone: 214-655-6659

EPA Region 8

Telephone: 303-312-6774

#### **Proposed NPL: Proposed National Priority List Sites**

Source: EPA

Telephone: N/A

Date of Government Version: 12/14/04

Date Made Active at EDR: 02/03/05

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 02/01/05

Elapsed ASTM days: 2

Date of Last EDR Contact: 02/01/05

#### **CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System**

Source: EPA

Telephone: 703-413-0223

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 12/14/04

Date Made Active at EDR: 02/08/05

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 12/21/04

Elapsed ASTM days: 49

Date of Last EDR Contact: 12/21/04

#### **CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned**

Source: EPA

Telephone: 703-413-0223

As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not needlessly repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/14/04  
Date Made Active at EDR: 02/08/05  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 12/21/04  
Elapsed ASTM days: 49  
Date of Last EDR Contact: 12/21/04

### **CORRACTS: Corrective Action Report**

Source: EPA

Telephone: 800-424-9346

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 09/23/04  
Date Made Active at EDR: 11/18/04  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 10/07/04  
Elapsed ASTM days: 42  
Date of Last EDR Contact: 12/07/04

### **RCRA: Resource Conservation and Recovery Act Information**

Source: EPA

Telephone: 800-424-9346

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator off-site to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 11/23/04  
Date Made Active at EDR: 01/18/05  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 11/24/04  
Elapsed ASTM days: 55  
Date of Last EDR Contact: 11/24/04

### **ERNS: Emergency Response Notification System**

Source: National Response Center, United States Coast Guard

Telephone: 202-260-2342

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/03  
Date Made Active at EDR: 03/12/04  
Database Release Frequency: Annually

Date of Data Arrival at EDR: 01/26/04  
Elapsed ASTM days: 46  
Date of Last EDR Contact: 10/25/04

### **FEDERAL ASTM SUPPLEMENTAL RECORDS**

#### **BRS: Biennial Reporting System**

Source: EPA/NTIS

Telephone: 800-424-9346

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/01/01  
Database Release Frequency: Biennially

Date of Last EDR Contact: 12/13/04  
Date of Next Scheduled EDR Contact: 03/14/05

#### **CONSENT: Superfund (CERCLA) Consent Decrees**

Source: Department of Justice, Consent Decree Library

Telephone: Varies

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.



**Photograph No. 5:** Photograph of the smaller AST observed near the intake structure



**Photograph No. 6:** View of the debris piles located in the wooded area in the eastern part of the site



**Photograph No. 7:** Photograph of some of the asbestos-containing steam pipe insulation observed throughout the building area.



**APPENDIX C**  
**RESUMES**

**Matthew F. Cooke, P.G.**  
**Project Geologist**

---

**EDUCATION**

M.S., Geological Sciences, 1999 (University of South Carolina)  
B.S., Geology (with Honors), 1997 (University of the South)

**PROFESSIONAL MEMBERSHIPS AND ASSOCIATIONS**

Registered Professional Geologist, South Carolina #2363  
Geologic Society of America

**CAREER SUMMARY**

Mr. Cooke currently serves as Project Geologist in the Columbia, South Carolina office. He has participated in and conducted numerous geotechnical and environmental projects including site contamination assessments environmental site assessments, and sub-surface geotechnical explorations. Mr. Cooke has also been involved in natural resource projects involving wetlands delineation, classification, and permitting. Prior to joining MACTEC in 1999, he obtained his M.Sc. in Geological Sciences from the University of South Carolina. His thesis focused on the stratigraphic, geochemical, and hydrogeologic evaluation of Neogene basaltic rocks in the central Snake River Plain, Idaho.

**ENVIRONMENTAL SITE ASSESSMENTS**

Mr. Cooke has been extensively involved in environmental site assessments of commercial and industrial real estate relative to soil and ground-water contamination, and underground storage tanks. Properties assessed have included undeveloped sites, apartment complexes, hotel/conference centers, industrial facilities and various commercial facilities. Mr. Cooke has performed more than 200 environmental site assessments throughout South Carolina.

**SITE CONTAMINATION ASSESSMENTS**

Mr. Cooke has investigated soil and water quality problems related to real-estate transactions and underground storage tanks. His work experience includes conducting geological and hydrogeological investigations, as well as assessing the extent of soil and ground-water contamination. His responsibilities include supervising field activities, development of sampling programs, and selection of analytical testing procedures. He has been involved with a variety of assessment methods including soil test borings, trenches, hydrogeological analyses, and organic vapor analysis. Recent environmental projects have included the following:

- **U.S. EPA Brownfields Redevelopment Initiative.** Coordinated soil and groundwater sampling and chemical analysis at two EPA-funded brownfield sites in the City of Columbia, South Carolina.
  - Developed soil and ground-water sampling programs and selected analytical testing procedures.
  - Supervised field activities.
  - Prepared report summarizing field activities and laboratory results, including contaminant risk analysis under state and federal risk-based levels for contaminants in soil and groundwater.

- **Richland County Solid Waste Landfill – Methane Monitoring and Drilling Study.** Implemented 3-month methane sampling program for the approximate 278-acre landfill and provided technical oversight during the installation of 7 additional methane monitoring wells at the site.

## GEOTECHNICAL EXPLORATIONS

Mr. Cooke's geotechnical experience consists of planning and executing geotechnical explorations and studies in both the Atlantic Coastal Plain and Piedmont Provinces. His duties have included field supervision of drilling crews, rock and soil (USCS) classification and stratigraphic correlation, soil test boring record generation utilizing the GINT software package, and analysis and evaluation of data and preparation of reports. Recent geotechnical projects have included the following:

- **Geotechnical Exploration – Catawba Nuclear Station, SC – ISFSI Project**
  - Coordinated and supervised all drilling activities, including down-hole seismic testing,
  - Conducted soil and rock classifications,
  - Generated soil test boring records and subsurface profiles utilizing the gINT software package,
  - Assisted in report preparation.
- **Geotechnical Exploration, Proposed PDCF Facility, Department of Energy-Savannah River Site (SRS), South Carolina.** Provided technical oversight for drilling, standard penetration testing (SPT), seismic piezocone (CPT) testing, undisturbed sampling, and geophysical logging.
  - Assisted in the interpretation of geologic stratification from CPT and boring logs.
  - Developed electronic logs and subsurface profiles utilizing the gINT software package integrating both boring and CPT data.
  - Assisted in implementing project specific quality assurance levels under 10CFR50 and ASME NQA-1.
  - Assisted in report preparation, including statistical analysis of subsurface data, and seismic liquefaction and static and dynamic settlement calculations.
- **Drilled Shaft Inspector – University of South Carolina Basketball Arena**
  - Provided technical oversight during installation of drilled shafts at the project site. Inspected over 250 shafts.

## PUBLICATIONS AND PRESENTATIONS

Cooke, M.F., 1999, Geochemistry, Volcanic Stratigraphy, and Hydrogeology of Neogene Basalts, Central Snake River Plain, Idaho [M.Sc. Thesis]: University of South Carolina, 125 p.

Cooke, M.F., Shervais, J.W., 1999, Stratigraphic Controls of Basaltic Volcanism on Groundwater Recharge and Conductivity in the Central Snake River Plain, Idaho. Presented at the Meeting of the Rocky Mountain Section of the Geologic Society of America and Associated Societies, Pocatello, Idaho., GSA Abstracts with Programs, Vol. 31, No. 4, p. A-8.

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/05/04  
Database Release Frequency: Varies

Date of Last EDR Contact: 10/25/04  
Date of Next Scheduled EDR Contact: 01/24/05

## **ROD: Records Of Decision**

Source: EPA  
Telephone: 703-416-0223

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 09/09/04  
Database Release Frequency: Annually

Date of Last EDR Contact: 01/05/05  
Date of Next Scheduled EDR Contact: 04/04/05

## **DELISTED NPL: National Priority List Deletions**

Source: EPA  
Telephone: N/A

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 12/14/04  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/01/05  
Date of Next Scheduled EDR Contact: 05/02/05

## **FINDS: Facility Index System/Facility Identification Initiative Program Summary Report**

Source: EPA  
Telephone: N/A

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 09/09/04  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/03/05  
Date of Next Scheduled EDR Contact: 04/04/05

## **HMIRS: Hazardous Materials Information Reporting System**

Source: U.S. Department of Transportation  
Telephone: 202-366-4555

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 09/08/04  
Database Release Frequency: Annually

Date of Last EDR Contact: 10/28/04  
Date of Next Scheduled EDR Contact: 01/17/05

## **MLTS: Material Licensing Tracking System**

Source: Nuclear Regulatory Commission  
Telephone: 301-415-7169

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 11/30/04  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/03/05  
Date of Next Scheduled EDR Contact: 04/04/05

## **MINES: Mines Master Index File**

Source: Department of Labor, Mine Safety and Health Administration  
Telephone: 303-231-5959

Date of Government Version: 09/13/04  
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 12/28/04  
Date of Next Scheduled EDR Contact: 03/28/05

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### **NPL LIENS: Federal Superfund Liens**

Source: EPA

Telephone: 202-564-4267

Federal Superfund Liens. Under the authority granted the USEPA by the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner receives notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/91

Database Release Frequency: No Update Planned

Date of Last EDR Contact: 11/22/04

Date of Next Scheduled EDR Contact: 02/21/05

### **PADS: PCB Activity Database System**

Source: EPA

Telephone: 202-564-3887

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 09/30/04

Database Release Frequency: Annually

Date of Last EDR Contact: 11/22/04

Date of Next Scheduled EDR Contact: 02/07/05

### **DOD: Department of Defense Sites**

Source: USGS

Telephone: 703-692-8801

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 10/01/03

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/12/04

Date of Next Scheduled EDR Contact: 02/07/05

### **UMTRA: Uranium Mill Tailings Sites**

Source: Department of Energy

Telephone: 505-845-0011

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized. In 1978, 24 inactive uranium mill tailings sites in Oregon, Idaho, Wyoming, Utah, Colorado, New Mexico, Texas, North Dakota, South Dakota, Pennsylvania, and on Navajo and Hopi tribal lands, were targeted for cleanup by the Department of Energy.

Date of Government Version: 04/22/04

Database Release Frequency: Varies

Date of Last EDR Contact: 12/21/04

Date of Next Scheduled EDR Contact: 03/21/05

### **ODI: Open Dump Inventory**

Source: Environmental Protection Agency

Telephone: 800-424-9346

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/85

Database Release Frequency: No Update Planned

Date of Last EDR Contact: 05/23/95

Date of Next Scheduled EDR Contact: N/A

### **FUDS: Formerly Used Defense Sites**

Source: U.S. Army Corps of Engineers

Telephone: 202-528-4285

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/03

Database Release Frequency: Varies

Date of Last EDR Contact: 01/03/05

Date of Next Scheduled EDR Contact: 04/04/05

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### INDIAN RESERV: Indian Reservations

Source: USGS

Telephone: 202-208-3710

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 10/01/03

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 11/12/04

Date of Next Scheduled EDR Contact: 02/07/05

### RAATS: RCRA Administrative Action Tracking System

Source: EPA

Telephone: 202-564-4104

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/95

Database Release Frequency: No Update Planned

Date of Last EDR Contact: 12/06/04

Date of Next Scheduled EDR Contact: 03/07/05

### TRIS: Toxic Chemical Release Inventory System

Source: EPA

Telephone: 202-566-0250

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/02

Database Release Frequency: Annually

Date of Last EDR Contact: 12/20/04

Date of Next Scheduled EDR Contact: 03/21/05

### TSCA: Toxic Substances Control Act

Source: EPA

Telephone: 202-260-5521

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/02

Database Release Frequency: Every 4 Years

Date of Last EDR Contact: 12/06/04

Date of Next Scheduled EDR Contact: 03/07/05

### FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Source: EPA

Telephone: 202-564-2501

Date of Government Version: 04/13/04

Database Release Frequency: Quarterly

Date of Last EDR Contact: 12/01/04

Date of Next Scheduled EDR Contact: 03/21/05

### SSTS: Section 7 Tracking Systems

Source: EPA

Telephone: 202-564-5008

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/03

Database Release Frequency: Annually

Date of Last EDR Contact: 11/29/04

Date of Next Scheduled EDR Contact: 04/18/05

### FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-564-2501

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/13/04  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 12/01/04  
Date of Next Scheduled EDR Contact: 03/21/05

## STATE OF SOUTH CAROLINA ASTM STANDARD RECORDS

### **SHWS: Site Assessment Section Project List**

Source: Department of Health and Environmental Control  
Telephone: 803-734-5376

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 10/29/04  
Date Made Active at EDR: 12/10/04  
Database Release Frequency: Annually

Date of Data Arrival at EDR: 11/15/04  
Elapsed ASTM days: 25  
Date of Last EDR Contact: 01/10/05

### **SWF/LF: Permitted Landfills List**

Source: Department of Health and Environmental Control  
Telephone: 803-734-5165

Source: Department of Health and Environmental Control, GIS Section  
Telephone: 803-896-4084

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 08/25/04  
Date Made Active at EDR: 10/06/04  
Database Release Frequency: Varies

Date of Data Arrival at EDR: 08/30/04  
Elapsed ASTM days: 37  
Date of Last EDR Contact: 01/10/05

### **LUST: Leaking Underground Storage Tank List**

Source: Department of Health and Environmental Control  
Telephone: 803-898-4350

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 12/10/04  
Date Made Active at EDR: 02/02/05  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 12/20/04  
Elapsed ASTM days: 44  
Date of Last EDR Contact: 11/22/04

### **UST: Comprehensive Underground Storage Tanks**

Source: Department of Health and Environmental Control  
Telephone: 803-898-4350

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 12/10/04  
Date Made Active at EDR: 02/02/05  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 12/20/04  
Elapsed ASTM days: 44  
Date of Last EDR Contact: 11/22/04

### **VCP: Voluntary Cleanup Sites**

Source: Department of Health and Environmental Control  
Telephone: 803-896-4049

Date of Government Version: 07/14/04  
Date Made Active at EDR: 08/09/04  
Database Release Frequency: Varies

Date of Data Arrival at EDR: 07/14/04  
Elapsed ASTM days: 26  
Date of Last EDR Contact: 01/10/05

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## STATE OF SOUTH CAROLINA ASTM SUPPLEMENTAL RECORDS

### **AST:** Aboveground Storage Tank List

Source: Department of Health and Environmental Control  
Telephone: 803-898-4350  
Registered Aboveground Storage Tanks.

Date of Government Version: 03/25/04  
Database Release Frequency: Varies

Date of Last EDR Contact: 12/27/04  
Date of Next Scheduled EDR Contact: 03/28/05

### **SPILLS:** Spill List

Source: Department of Health and Environmental Control  
Telephone: 803-898-4111

Date of Government Version: 11/22/04  
Database Release Frequency: Varies

Date of Last EDR Contact: 12/27/04  
Date of Next Scheduled EDR Contact: 03/28/05

### **GWC:** Groundwater Contamination Inventory

Source: Department of Health and Environmental Control  
Telephone: 803-898-3798  
An inventory of all groundwater contamination cases in the state.

Date of Government Version: 07/01/04  
Database Release Frequency: Annually

Date of Last EDR Contact: 10/25/04  
Date of Next Scheduled EDR Contact: 01/24/05

### **DRYCLEANERS:** Drycleaner Database

Source: Department of Health & Environmental Control  
Telephone: 803-898-3882

The Drycleaning Facility Restoration Trust Fund database is used to access, prioritize and cleanup contaminated registered drycleaning sites.

Date of Government Version: 12/14/04  
Database Release Frequency: Varies

Date of Last EDR Contact: 11/29/04  
Date of Next Scheduled EDR Contact: 02/28/05

## EDR PROPRIETARY HISTORICAL DATABASES

**Former Manufactured Gas (Coal Gas) Sites:** The existence and location of Coal Gas sites is provided exclusively to EDR by Real Property Scan, Inc. ©Copyright 1993 Real Property Scan, Inc. For a technical description of the types of hazards which may be found at such sites, contact your EDR customer service representative.

### **Disclaimer Provided by Real Property Scan, Inc.**

The information contained in this report has predominantly been obtained from publicly available sources produced by entities other than Real Property Scan. While reasonable steps have been taken to insure the accuracy of this report, Real Property Scan does not guarantee the accuracy of this report. Any liability on the part of Real Property Scan is strictly limited to a refund of the amount paid. No claim is made for the actual existence of toxins at any site. This report does not constitute a legal opinion.

## BROWNFIELDS DATABASES

### **VCP:** Voluntary Cleanup Sites

Source: Department of Health and Environmental Control  
Telephone: N/A

Date of Government Version: 07/14/04  
Database Release Frequency: Varies

Date of Last EDR Contact: 01/10/05  
Date of Next Scheduled EDR Contact: 04/11/05

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## US BROWNFIELDS: A Listing of Brownfields Sites

Source: Environmental Protection Agency

Telephone: 202-566-2777

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities—especially those without EPA Brownfields Assessment Demonstration Pilots—minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients—States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: N/A

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: N/A

Date of Next Scheduled EDR Contact: N/A

## AUL: Land Use Controls

Source: Department of Health & Environmental Control

Telephone: 803-896-4049

The term Land Use Controls or "LUCs" encompass institutional controls, such as those involved in real estate interests, governmental permitting, zoning, public advisories, deed notices, and other legal restrictions. The term also includes restrictions on access, whether achieved by means of engineered barriers (e.g., fence or concrete pad) or by human means (e.g., the presence of security guards). Additionally, the term includes both affirmative measures to achieve the desired restrictions (e.g., night lighting of an area) and prohibitive directives (e.g., restrictions on certain types of wells for the duration of the corrective action). Considered altogether, the LUCs for a facility will provide a tool for how the property should be used in order to maintain the level of protectiveness that one or more corrective actions were designed to achieve.

Date of Government Version: 01/11/05

Database Release Frequency: Varies

Date of Last EDR Contact: 01/10/05

Date of Next Scheduled EDR Contact: 04/11/05

## BROWNFIELDS: Brownfields Sites Listing

Source: Department of Health & Environmental Control

Telephone: 803-896-4069

The Brownfields component of the Voluntary Cleanup Program allows a non-responsible party to acquire a contaminated property with State Superfund liability protection for existing contamination by agreeing to perform an environmental assessment and/or remediation.

Date of Government Version: 01/11/05

Database Release Frequency: Varies

Date of Last EDR Contact: 01/10/05

Date of Next Scheduled EDR Contact: 04/11/05

## OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

**Oil/Gas Pipelines:** This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

### **Electric Power Transmission Line Data**

Source: PennWell Corporation

Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

**Sensitive Receptors:** There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

### **AHA Hospitals:**

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

### **Medical Centers: Provider of Services Listing**

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

### **Nursing Homes**

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

### **Public Schools**

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

### **Private Schools**

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

### **Daycare Centers: Child Day Care List**

Source: Department of Social Services

Telephone: 803-898-7345

**Flood Zone Data:** This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

**NWI:** National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 from the U.S. Fish and Wildlife Service.


### **STREET AND ADDRESS INFORMATION**

© 2003 Geographic Data Technology, Inc., Rel. 07/2003. This product contains proprietary and confidential property of Geographic Data Technology, Inc. Unauthorized use, including copying for other than testing and standard backup procedures, of this product is expressly prohibited.

**APPENDIX B**  
**SITE PHOTOGRAPHS**




**Photograph No. 1:** View of the interior of the former mill building

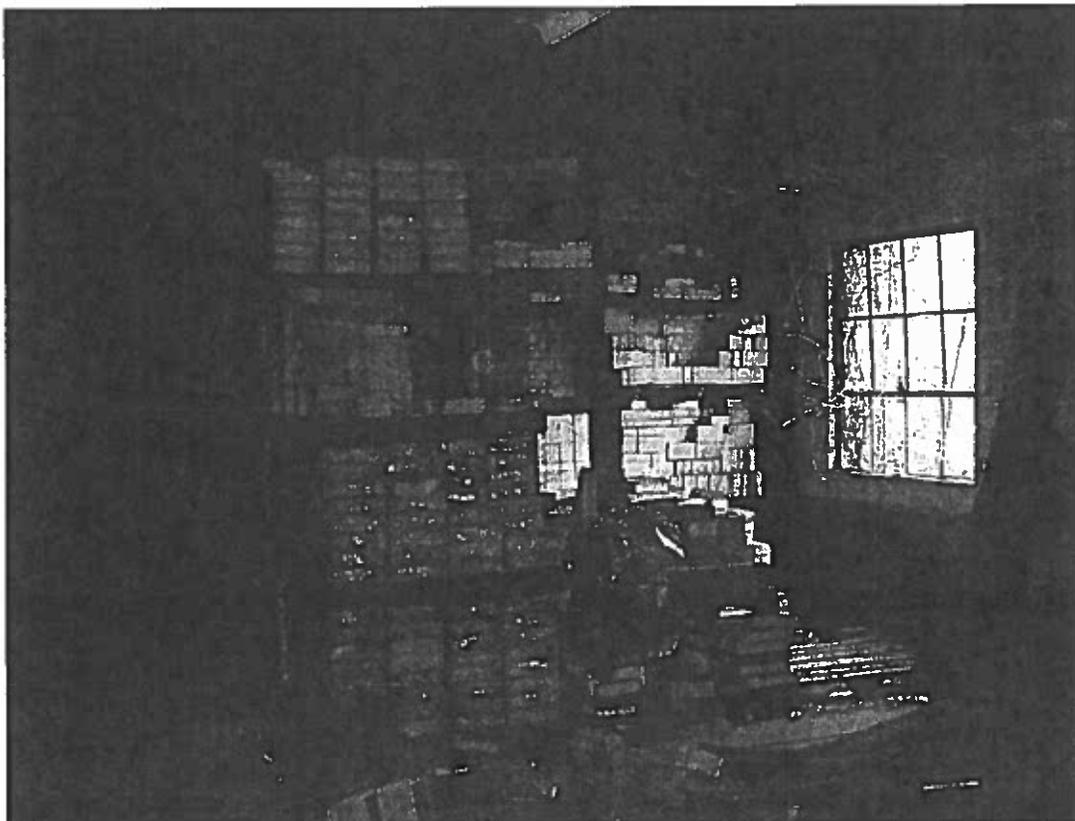

**Photograph No. 2:** View of the interior of the maintenance shed on the eastern portion of the site



**Photograph No. 3:** Photograph of the elevated water tank on the eastern portion of the site

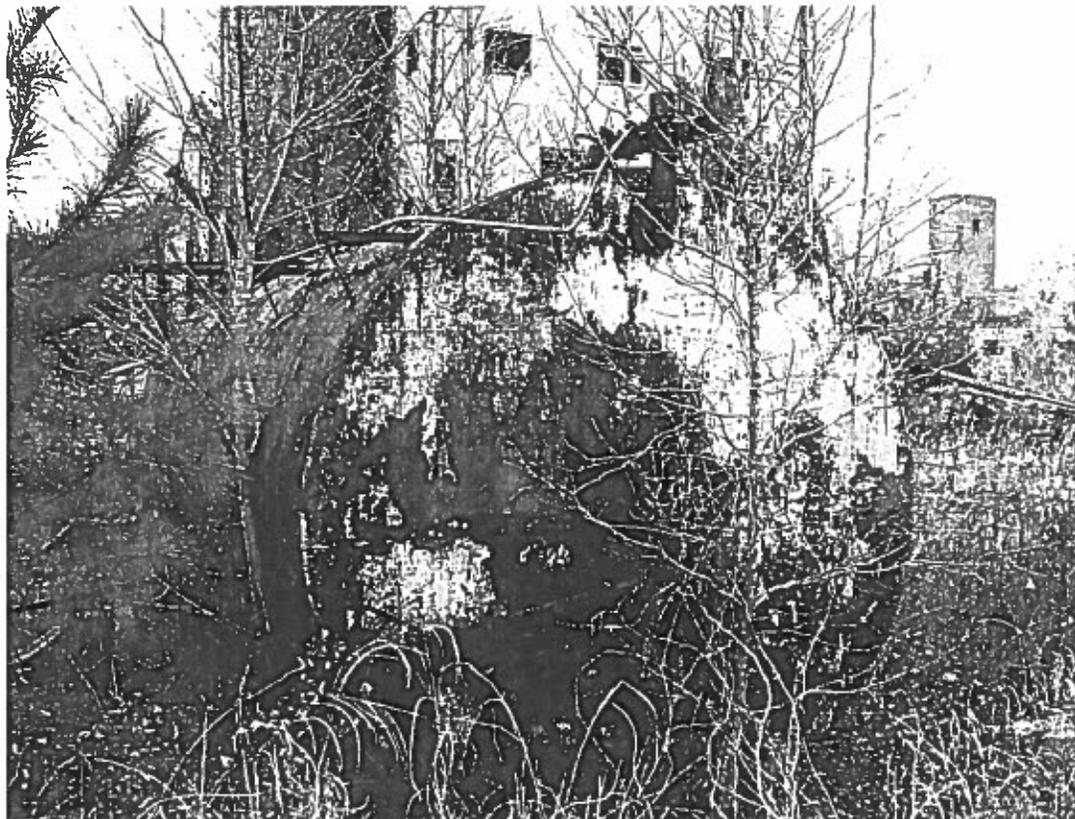

**Photograph No. 4:** Photograph of the large AST located on the eastern portion of the site

*Aiken County has made this information available from the Seminole Mill Project for interested parties. The County does not guarantee the information remains correct or accurate as it was collected some years ago, but the information can be considered a reference for those interested in the project.*